OIL ANALYSIS REPORT

Sample Rating Trend

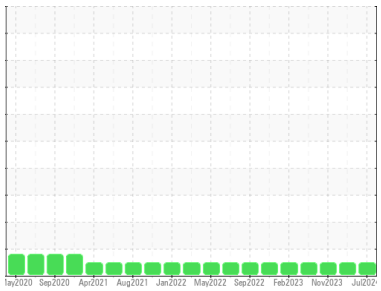

NORMAL

Machine Id
FREIGHTLINER 1176
Component
Diesel Engine
Fluid
CHEVRON DELO 400 XLE 10W30 (40 LTR)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0851796**	WC0851830	WC0733143
Sample Date		Client Info		**04 Jul 2024**	04 Mar 2024	02 Nov 2023
Machine Age	kms	Client Info		**1263483**	1204104	1139533
Oil Age	kms	Client Info		**65000**	65000	65000
Oil Changed		Client Info		**Changed**	Changed	Changed
Sample Status				**NORMAL**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>65	**20**	28	24
Chromium	ppm	ASTM D5185m	>5	**1**	2	2
Nickel	ppm	ASTM D5185m	>3	**0**	0	0
Titanium	ppm	ASTM D5185m	>5	**0**	<1	<1
Silver	ppm	ASTM D5185m	>2	**0**	0	0
Aluminum	ppm	ASTM D5185m	>35	**9**	14	10
Lead	ppm	ASTM D5185m	>10	**0**	0	0
Copper	ppm	ASTM D5185m	>180	**4**	3	5
Tin	ppm	ASTM D5185m	>8	**0**	<1	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**22**	23	20
Barium	ppm	ASTM D5185m		**0**	0	6
Molybdenum	ppm	ASTM D5185m		**2**	<1	<1
Manganese	ppm	ASTM D5185m		**<1**	<1	0
Magnesium	ppm	ASTM D5185m		**827**	748	746
Calcium	ppm	ASTM D5185m	2900	**1624**	1332	1323
Phosphorus	ppm	ASTM D5185m	1100	**800**	685	798
Zinc	ppm	ASTM D5185m	1200	**903**	816	855
Sulfur	ppm	ASTM D5185m	4000	**3587**	3197	3201

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	**6**	7	6
Sodium	ppm	ASTM D5185m		**4**	4	2
Potassium	ppm	ASTM D5185m	>20	**5**	6	9

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	**0.7**	0.8	0.8
Nitration	Abs/cm	*ASTM D7624	>20	**10.6**	10.6	10.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	**24.3**	24.3	24.4

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	**19.6**	20.1	19.8
Base Number (BN)	mg KOH/g	ASTM D2896	10.3	**6.48**	6.11	6.25

OIL ANALYSIS REPORT

FT-IR (Direct Trend)

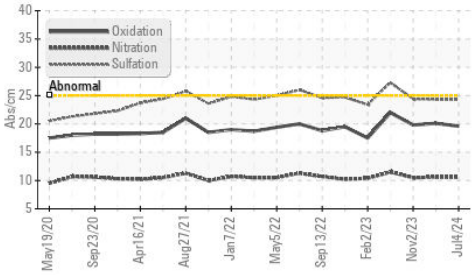

Base Number

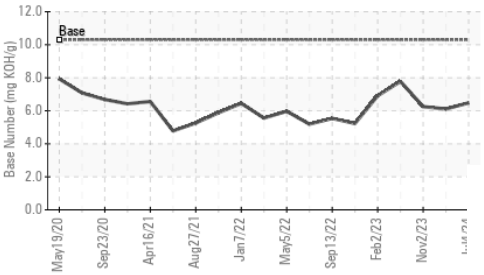

Viscosity @ 100°C

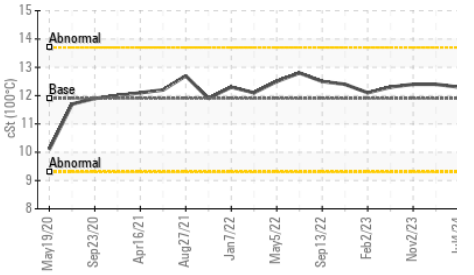

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	11.9	**12.3**	12.4	12.4

GRAPHS

Iron (ppm)

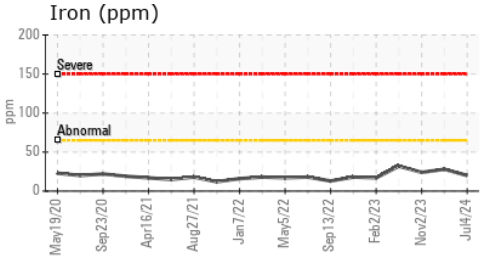

Lead (ppm)

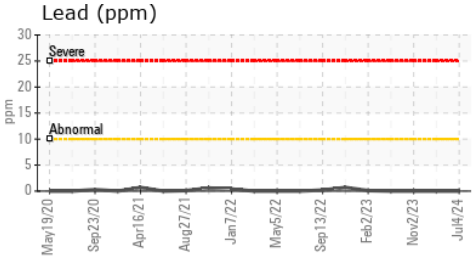

Aluminum (ppm)

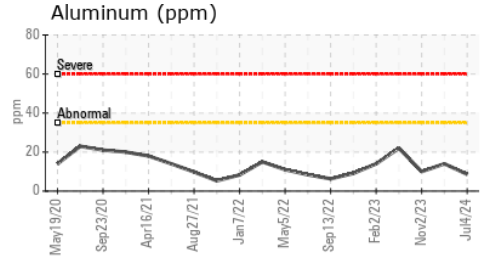

Chromium (ppm)

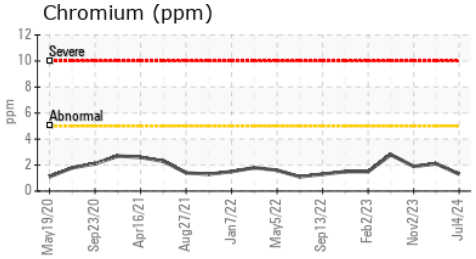

Copper (ppm)

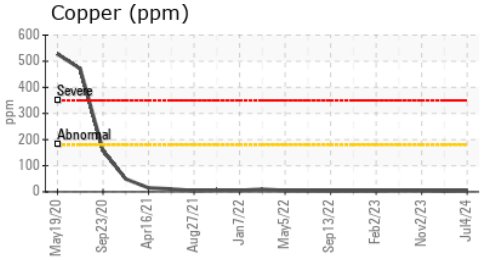

Silicon (ppm)

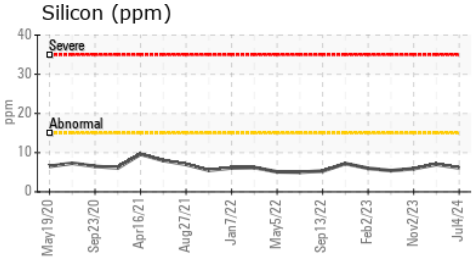

Viscosity @ 100°C

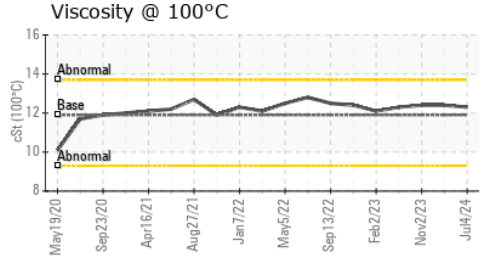

Base Number

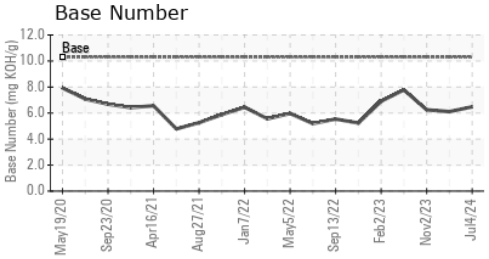

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0851796
Lab Number : 06236274
Unique Number : 11125108
Test Package : MOB 2

Received : 15 Jul 2024
Tested : 16 Jul 2024
Diagnosed : 16 Jul 2024 - Sean Felton

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LYNDEN TRANSPORT - SPRUCE GROVE
27340 ACHESON RD, ACHESON INDUSTRIAL PARK
ACHESON, AB
CA T7X 6B1
Contact: Mathieu Carby
mcarby@lynden.com
T:
F: