OIL ANALYSIS REPORT

WEAR CONTAMINATION **FLUID CONDITION** **NORMAL** NORMAL **NORMAL**


Machine Id

KENWORTH C-10

Component **Hydrostatic**

TRC HYDRAIII IC OIL 30W (26 GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History
Resample at the next service interval to monitor.	Sample Number		Client Info		TR02488851		
	Sample Date		Client Info		17 Sep 2009		
	Machine Age	hrs	Client Info		1765		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
VEAR	Iron	nnm	ASTM D5185m		2		
/LAIT	Chromium	ppm	ASTM D5185m		0		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		2		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		0		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		16		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m		2		
There is no indication of any contamination in the component.	Potassium	ppm	ASTM D5185m		0		
	Water		WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual		NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		1		
	Boron	ppm	ASTM D5185m		<1		
The condition of oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m		0		
	Calcium	ppm	ASTM D5185m		78		
	Phosphorus	ppm	ASTM D5185m		305		
	Zinc	ppm	ASTM D5185m		384		
			ASTM D5185m		6092		
	Sulfur	ppm	ASTIVI DSTOSIII		0032		
	Sulfur Acid Number (AN)	mg KOH/g	ASTM D3163111 ASTM D8045		0.485		

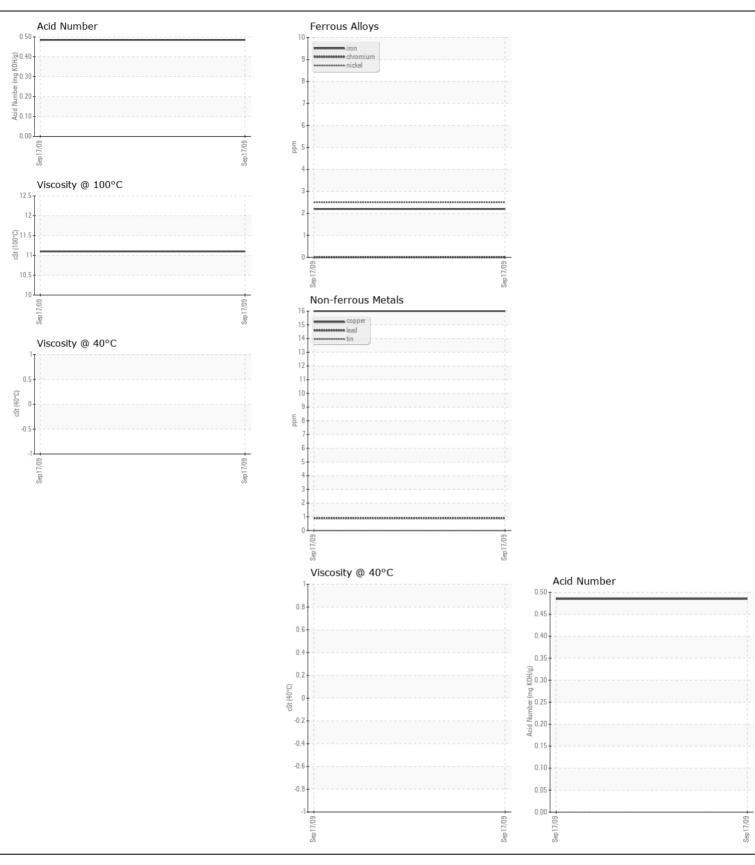



Laboratory Sample No.

: TR02488851 Lab Number : 02488851 Unique Number : 4963619

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 29 Sep 2009 **Tested** : 30 Sep 2009 Diagnosed

: 30 Sep 2009 - Jonathan Hester

VALLEY FARMS, AZ US 85291 Contact: MARK OPHEIM

11034 N. VALLEY FARMS RD.

jrh.quickmud@gmail.com

Test Package : MOB 2 (Additional Tests: KV100, PrtCount) To discuss this sample report, contact Customer Service at 1-800-827-0711. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (520)723-9346

QUICK MUD