



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	ABNORMAL

Area  
**QC Engine**  
 Machine Id  
**QC230725MOB2**  
 Component  
**Diesel Engine**  
 Fluid  
**DIESEL ENGINE OIL SAE 40 (--- GAL)**

**RECOMMENDATION**

We advise that you check for the source of water entry. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0894142	WC0894141	WC0894140
Sample Date		Client Info		05 Jan 2024	04 Jan 2024	03 Jan 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	20	20	19
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		2	2	2
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	5	5	5
Lead	ppm	ASTM D5185(m)	>40	1	1	2
Copper	ppm	ASTM D5185(m)	>330	9	9	9
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0

**CONTAMINATION**














There is a moderate amount of fuel present in the oil. There is a moderate concentration of water present in the oil. Tests confirm the presence of fuel in the oil.

Silicon	ppm	ASTM D5185(m)	>25	7	7	7
Potassium	ppm	ASTM D5185(m)	>20	▲ 16	0	▲ 15
Fuel	%	ASTM D7593*	>5	▲ 5.2	▲ 5.2	▲ 5.2
Water	%	ASTM D6304*	>0.2	▲ 0.441	▲ 0.451	▲ 0.403
ppm Water	ppm	ASTM D6304*	>2000	▲ 4412	▲ 4514	▲ 4034
Glycol	%	ASTM D7922*		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	10.2	10.1	10.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.1	20.1	20.0
Emulsified Water	scalar	Visual*	>0.2	▲ .2%	▲ .2%	▲ .2%

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil. Viscosity of sample indicates oil is within SAE 10W30 range, advise investigate. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185(m)	>216	▲ 74	▲ 73	▲ 74
Boron	ppm	ASTM D5185(m)	250	28	30	31
Barium	ppm	ASTM D5185(m)	10	0	0	0
Molybdenum	ppm	ASTM D5185(m)	100	48	48	47
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	450	629	613	616
Calcium	ppm	ASTM D5185(m)	3000	1515	1508	1465
Phosphorus	ppm	ASTM D5185(m)	1150	884	864	872
Zinc	ppm	ASTM D5185(m)	1350	1038	1015	1015
Sulfur	ppm	ASTM D5185(m)	4250	2839	2757	2793
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.5	16.4	16.6
Base Number (BN)	mg KOH/g	ASTM D2896*	8.5	9.65	9.13	8.96
Visc @ 40°C	cSt	ASTM D7279(m)	138	▲ 75.5	▲ 75.5	▲ 75.7
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	▲ 11.3	▲ 11.4	▲ 11.4
Viscosity Index (VI)	Scale	ASTM D2270*	102	140	143	142

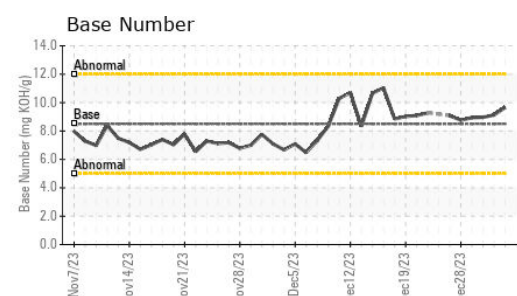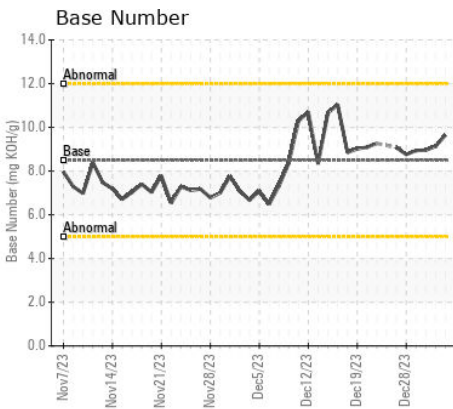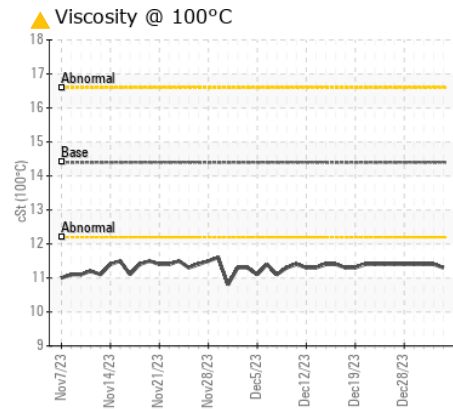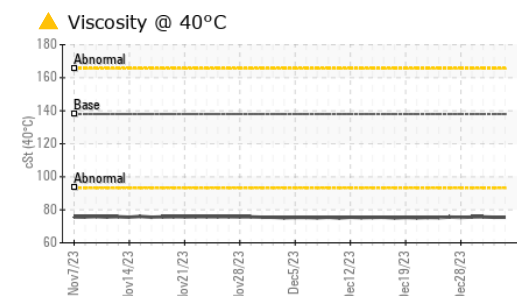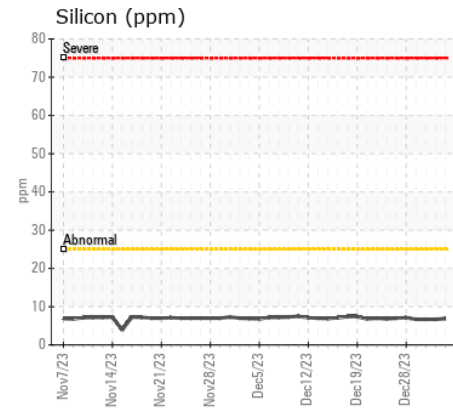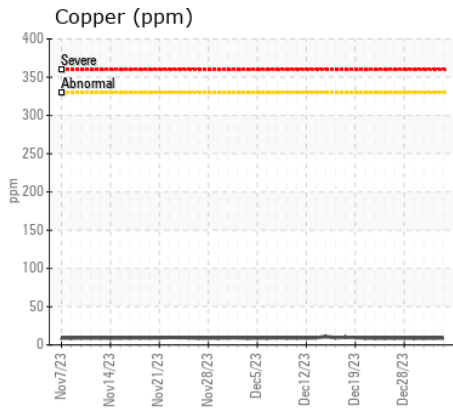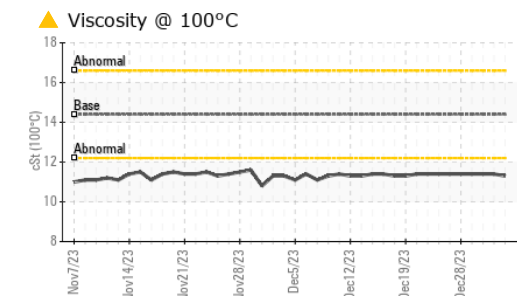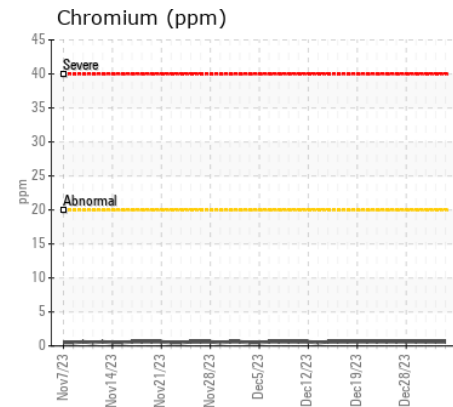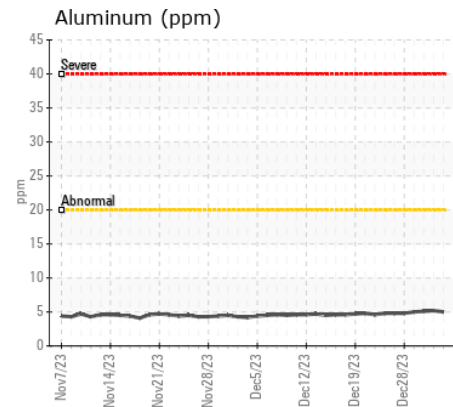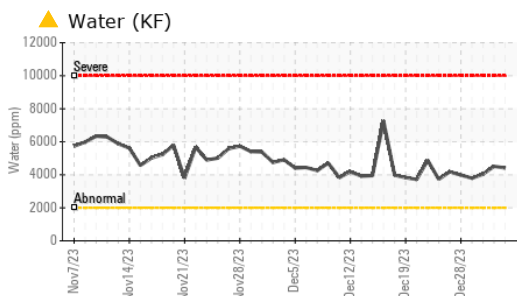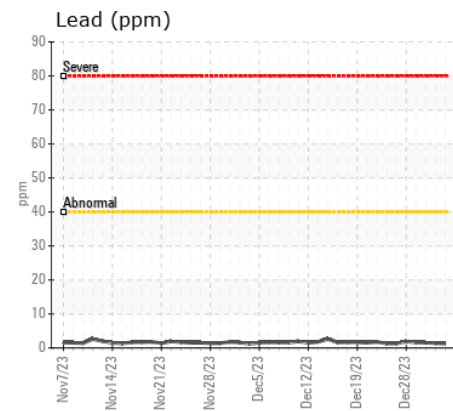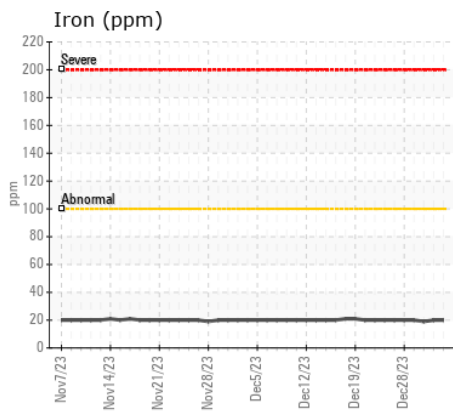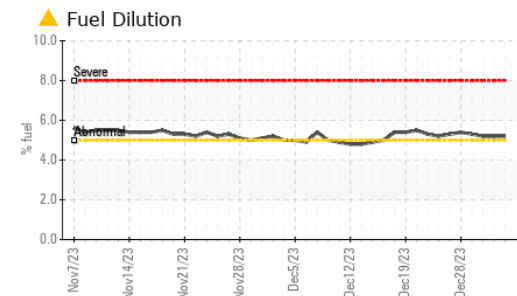

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **WearCheck Quality Control Sample Results**  
**Sample No.** : WC0894142 **Received** : 05 Jan 2024  
**Lab Number** : 02606711 **Diagnosed** : 08 Jan 2024  
**Unique Number** : 5707797 **Diagnostician** : Kevin Marson  
**Test Package** : MOB 2 ( Additional Tests: Glycol, KF, KV40, PercentFuel, VI )  
 To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

Burlington, ON  
CA  
Contact: Dorian Anderson  
dorian.anderson@wearcheck.com  
T: (289)291-4652  
F: (905)569-8605