



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
OR419
Component
2 Transmission (Manual)
Fluid
TDTO FLUID SAE 30 (--- GAL)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition. Le fluide n'était pas spécifié, toutefois, une comparaison avec d'autres fluides indiqua que ce fluide est du (GENERIC) TDTO FLUID SAE 30. Veuillez confirmer.

WEAR

Les taux d'usure de tous les composants sont normaux.










CONTAMINATION

Il n'y a aucun indice de contamination dans le fluide.

FLUID CONDITION

L'état de le fluide est acceptable pour la durée de service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0103731	---	---
Sample Date		Client Info		04 Jan 2024	---	---
Machine Age	hrs	Client Info		20523	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changed	---	---
Filter Changed		Client Info		Not Changed	---	---
Sample Status				NORMAL	---	---
Iron	ppm	ASTM D5185(m)	>200	81	---	---
Chromium	ppm	ASTM D5185(m)	>5	<1	---	---
Nickel	ppm	ASTM D5185(m)	>5	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>7	0	---	---
Aluminum	ppm	ASTM D5185(m)	>25	4	---	---
Lead	ppm	ASTM D5185(m)	>45	<1	---	---
Copper	ppm	ASTM D5185(m)	>225	4	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>125	10	---	---
Potassium	ppm	ASTM D5185(m)	>20	6	---	---
Water		WC Method	>0.1	NEG	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Boron	ppm	ASTM D5185(m)	37	1	---	---
Barium	ppm	ASTM D5185(m)	7	0	---	---
Molybdenum	ppm	ASTM D5185(m)	5	<1	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)	40	13	---	---
Calcium	ppm	ASTM D5185(m)	2650	3098	---	---
Phosphorus	ppm	ASTM D5185(m)	1050	1054	---	---
Zinc	ppm	ASTM D5185(m)	1075	1193	---	---
Sulfur	ppm	ASTM D5185(m)	5750	8957	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	101	92.5	---	---

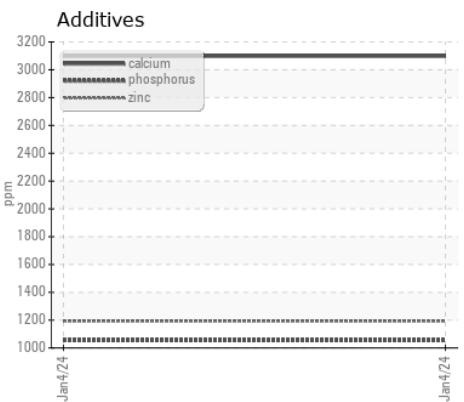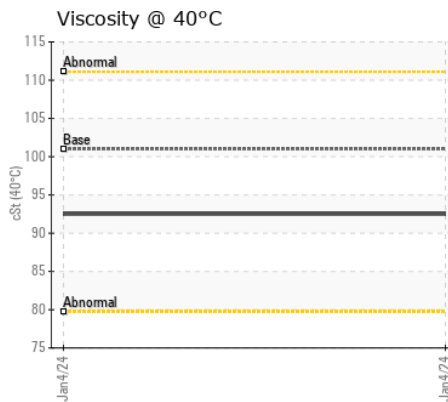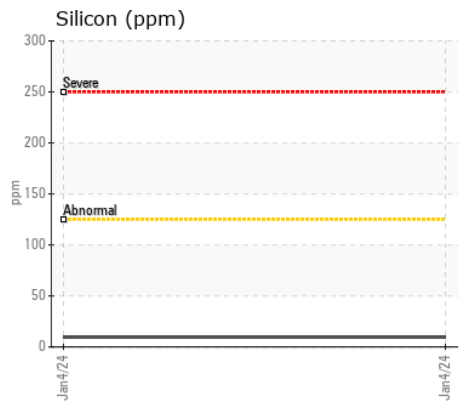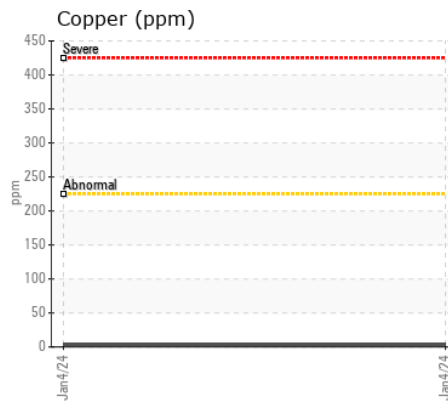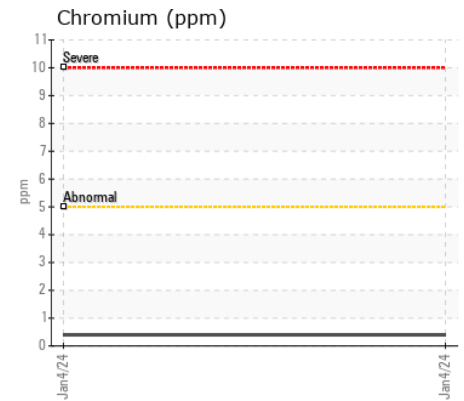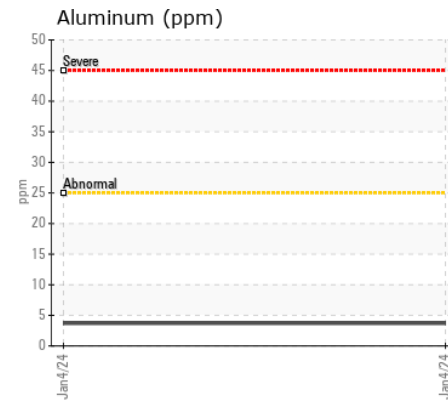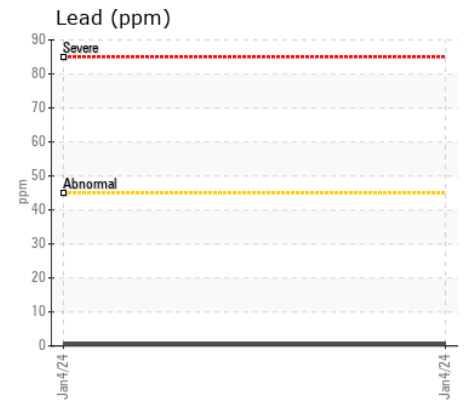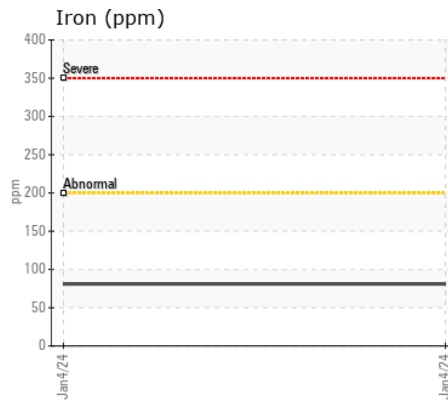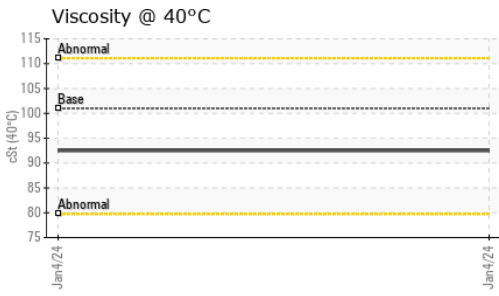

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 780 - GMA - ICI - Solid Waste
Sample No. : GFL0103731 **Received** : 11 Jan 2024 4365 boul. St-Elzear Ouest, Laval, QC
Lab Number : 02608249 **Diagnosed** : 11 Jan 2024 CA H7P 4J3
Unique Number : 5709335 **Diagnostician** : Wes Davis
Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Pieces Laval
 pieces.laval@gflenv.com
 T: (450)687-3838
 F: