



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR R938 050294-1650

Component
Splitter Box

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0172357	LH0172348	LH0257077
Sample Date		Client Info		03 Jan 2024	11 Jul 2023	21 Mar 2023
Machine Age	hrs	Client Info		4951	4478	4098
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		None	Not Changd	None
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	59	57	70
Chromium	ppm	ASTM D5185(m)	>5	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>5	0	0	0
Titanium	ppm	ASTM D5185(m)		0	0	<1
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	<1	2	<1
Lead	ppm	ASTM D5185(m)	>30	<1	0	<1
Copper	ppm	ASTM D5185(m)	>20	<1	1	1
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION












The water content is negligible. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>30	4	12	7
Potassium	ppm	ASTM D5185(m)	>20	6	2	2
Water	%	ASTM D6304*	>0.1	0.022	---	---
ppm Water	ppm	ASTM D6304*	>1000	224	---	---
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	.2%	NEG	NEG

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	4	1	2
Boron	ppm	ASTM D5185(m)	328	33	288	268
Barium	ppm	ASTM D5185(m)	1	2	2	8
Molybdenum	ppm	ASTM D5185(m)		<1	0	0
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	9	2	2
Calcium	ppm	ASTM D5185(m)	7	85	30	21
Phosphorus	ppm	ASTM D5185(m)	1145	641	1306	1418
Zinc	ppm	ASTM D5185(m)	3	84	24	19
Sulfur	ppm	ASTM D5185(m)	17909	23542	20365	22984
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	95.6	95.3	95.8

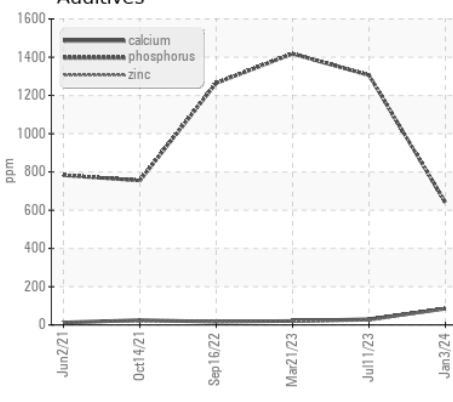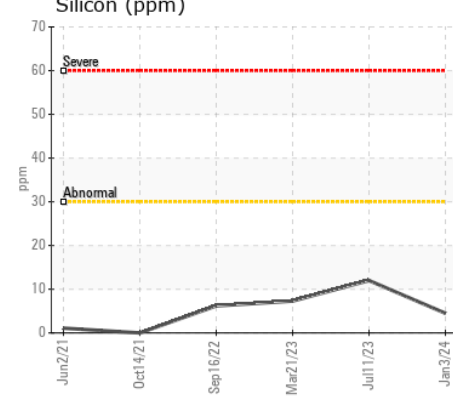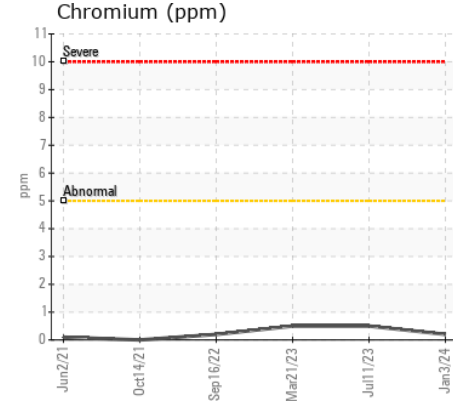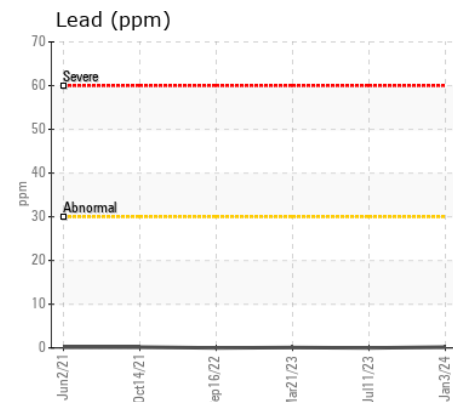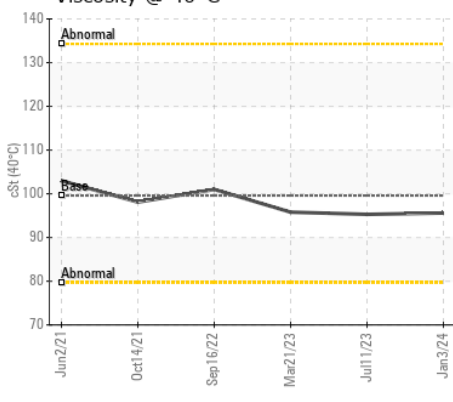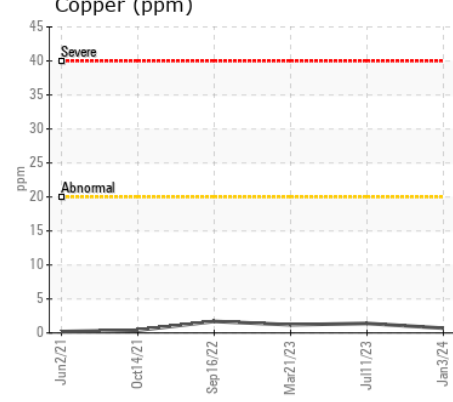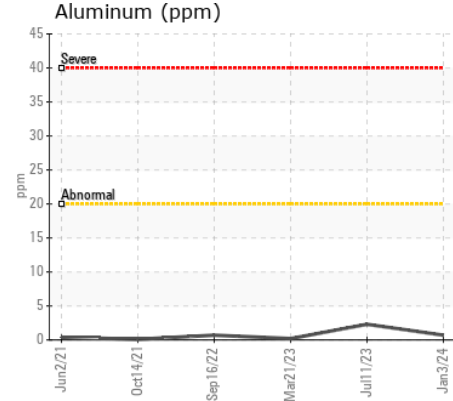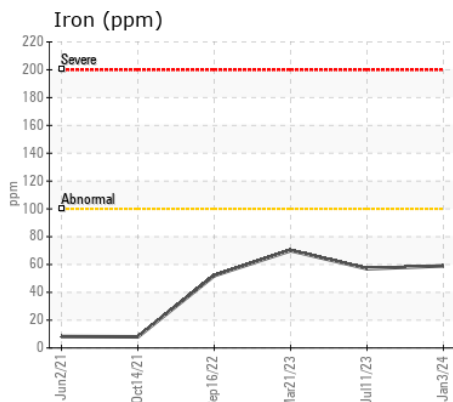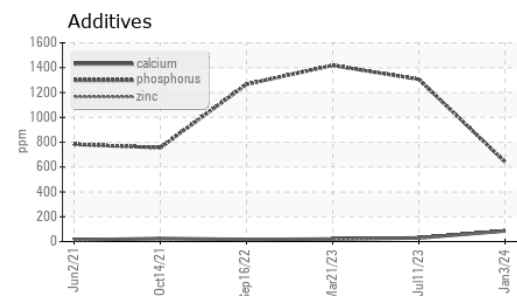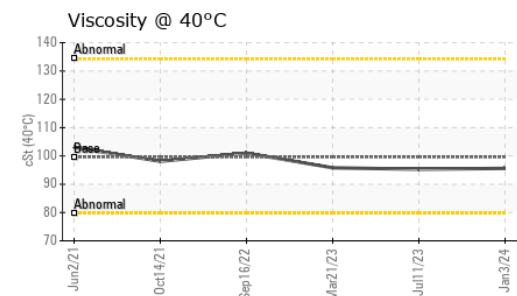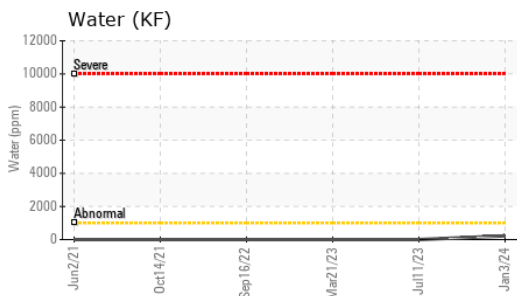

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0172357 **Received** : 11 Jan 2024
Lab Number : 02608288 **Diagnosed** : 15 Jan 2024
Unique Number : 5709374 **Diagnostician** : Wes Davis
Test Package : MOBCE (Additional Tests: KF, Visual)

MOOREFIELD EXCAVATING LTD.
 6297 WELLINGTON RD. 109S, RR #3
 HARRISTON, ON
 CA N0G 1Z0
 Contact: John Landman
 info@moorefieldex.ca
 T: (519)343-3571
 F: (519)510-3277

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.