



LIEBHERR

OIL ANALYSIS REPORT

| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |



Machine Id
LIEBHERR LH50 14791
Component
Rear Differential
Fluid
CHEVRON DELO GEAR ESI OIL 80W90 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | LH0180273 | LH | LH0260760 |
| Sample Date | | Client Info | | 09 Jan 2024 | 27 Dec 2023 | 10 Oct 2023 |
| Machine Age | hrs | Client Info | | 16000 | 22000 | 21000 |
| Oil Age | hrs | Client Info | | 0 | 0 | 0 |
| Filter Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | | Client Info | | Changed | Changed | Changed |
| Filter Changed | | Client Info | | N/A | N/A | N/A |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|---------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185(m) | >190 | 14 | 8 | 14 |
| Chromium | ppm | ASTM D5185(m) | >2 | 0 | 0 | 0 |
| Nickel | ppm | ASTM D5185(m) | >2 | 0 | 0 | 0 |
| Titanium | ppm | ASTM D5185(m) | | 0 | 0 | 0 |
| Silver | ppm | ASTM D5185(m) | | 0 | 0 | <1 |
| Aluminum | ppm | ASTM D5185(m) | >5 | <1 | <1 | <1 |
| Lead | ppm | ASTM D5185(m) | >15 | 0 | 0 | 0 |
| Copper | ppm | ASTM D5185(m) | >70 | <1 | <1 | 1 |
| Tin | ppm | ASTM D5185(m) | >2 | 0 | 0 | 0 |
| Vanadium | ppm | ASTM D5185(m) | | 0 | 0 | 0 |
| White Metal | scalar | Visual* | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | Visual* | NONE | NONE | NONE | NONE |

CONTAMINATION










There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|--------|---------------|-------|--------------|-------|-------|
| Silicon | ppm | ASTM D5185(m) | >20 | 2 | 1 | 4 |
| Potassium | ppm | ASTM D5185(m) | >20 | <1 | <1 | <1 |
| Water | | WC Method | >.2 | NEG | NEG | NEG |
| Silt | scalar | Visual* | NONE | NONE | NONE | NONE |
| Debris | scalar | Visual* | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | Visual* | NONE | NONE | NONE | NONE |
| Appearance | scalar | Visual* | NORML | NORML | NORML | NORML |
| Odor | scalar | Visual* | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | Visual* | >.2 | NEG | NEG | NEG |

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

| | | | | | | |
|-------------|-----|---------------|-------|--------------|-------|-------|
| Sodium | ppm | ASTM D5185(m) | | <1 | <1 | 2 |
| Boron | ppm | ASTM D5185(m) | 15 | 293 | 295 | 317 |
| Barium | ppm | ASTM D5185(m) | 0 | 0 | 0 | <1 |
| Molybdenum | ppm | ASTM D5185(m) | 0 | 2 | 2 | <1 |
| Manganese | ppm | ASTM D5185(m) | | 0 | 0 | 0 |
| Magnesium | ppm | ASTM D5185(m) | 0 | 4 | 3 | 3 |
| Calcium | ppm | ASTM D5185(m) | 5 | 22 | 27 | 12 |
| Phosphorus | ppm | ASTM D5185(m) | 600 | 1665 | 1668 | 1710 |
| Zinc | ppm | ASTM D5185(m) | 0 | 13 | 14 | 10 |
| Sulfur | ppm | ASTM D5185(m) | 22000 | 18975 | 18974 | 19194 |
| Visc @ 40°C | cSt | ASTM D7279(m) | 140 | 130 | 130 | 128 |

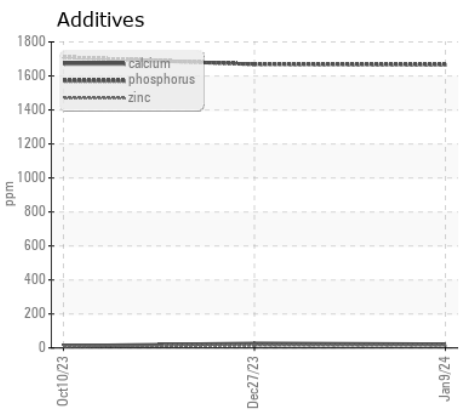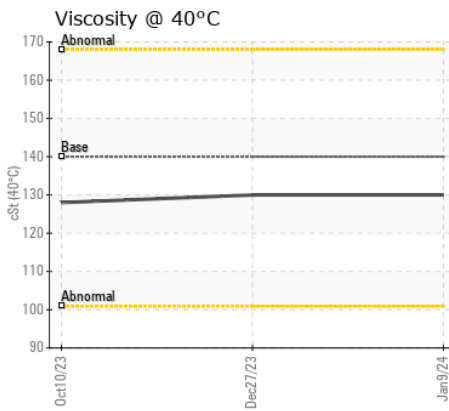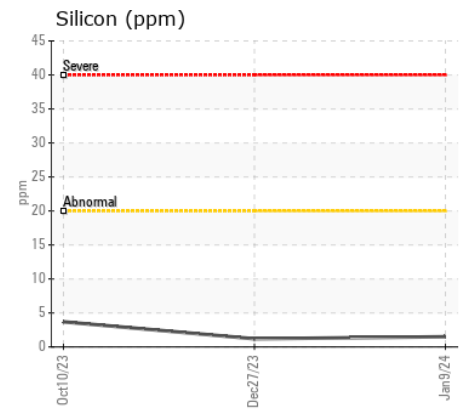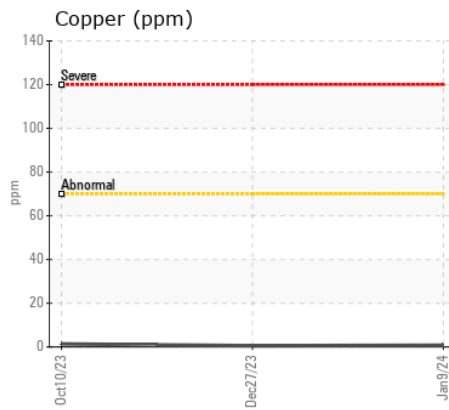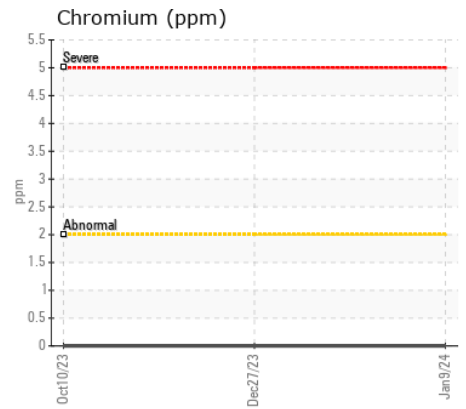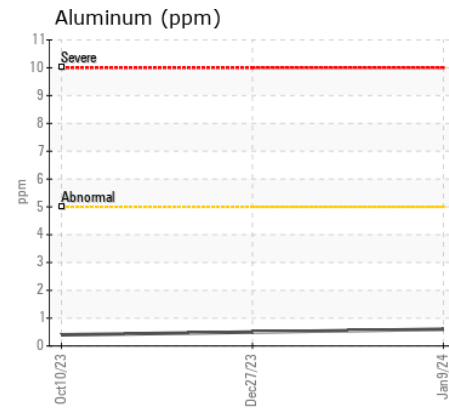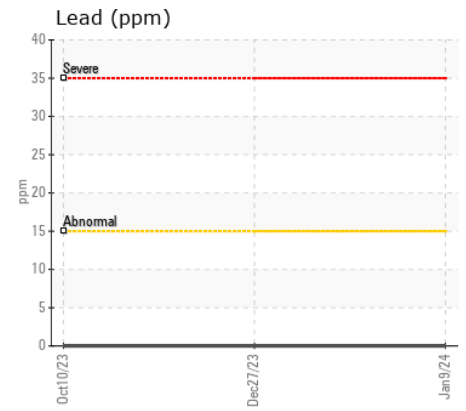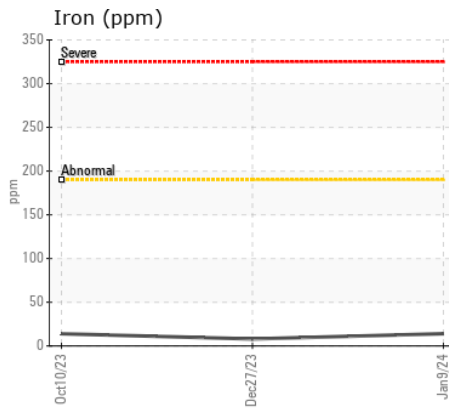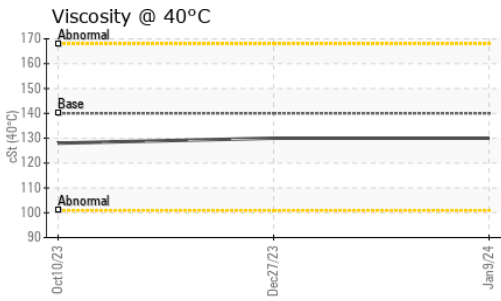

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0180273 **Received** : 15 Jan 2024
Lab Number : 02608779 **Diagnosed** : 15 Jan 2024
Unique Number : 5709865 **Diagnostician** : Wes Davis
Test Package : MOB 1

INTERFOR CORP
 5060 RTE 430
 BRUNSWICK MINE, NB
 CA E2A 6W6
 Contact: Daniel Hachey
 daniel.hachey@interfor.com
 T: (506)547-8700
 F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.