



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
SENNEBOGEN 830E 3309
 Component
Diesel Engine
 Fluid
IRVING 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0849311	WC0849303	WC0849323
Sample Date		Client Info		08 Jan 2024	01 Nov 2023	22 Sep 2023
Machine Age	hrs	Client Info		9000	8000	7500
Oil Age	hrs	Client Info		500	500	500
Filter Age	hrs	Client Info		500	500	500
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	5	6	6
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	2	2	2
Lead	ppm	ASTM D5185(m)	>40	0	0	<1
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	2	0	3
Potassium	ppm	ASTM D5185(m)	>20	0	0	<1
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0.2	0.1
Nitration	Abs/cm	ASTM D7624*	>20	7.8	9.4	9.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.6	21.5	20.8
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>101	<1	0	2
Boron	ppm	ASTM D5185(m)		41	38	37
Barium	ppm	ASTM D5185(m)		0	<1	0
Molybdenum	ppm	ASTM D5185(m)		3	4	4
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		30	33	34
Calcium	ppm	ASTM D5185(m)		1831	1948	2169
Phosphorus	ppm	ASTM D5185(m)		873	913	983
Zinc	ppm	ASTM D5185(m)		1027	1088	1203
Sulfur	ppm	ASTM D5185(m)		2904	2850	3110
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.6	17.0	16.8
Visc @ 100°C	cSt	ASTM D7279(m)		12.1	12.6	13.3

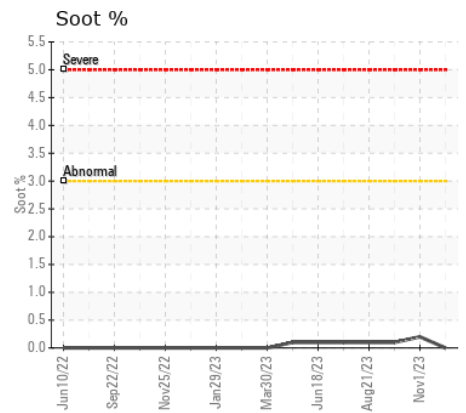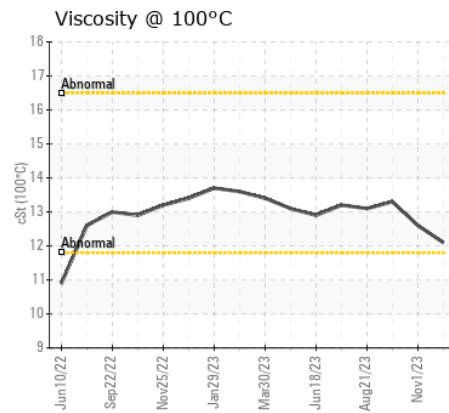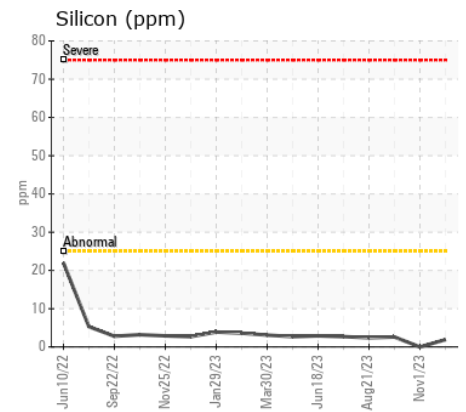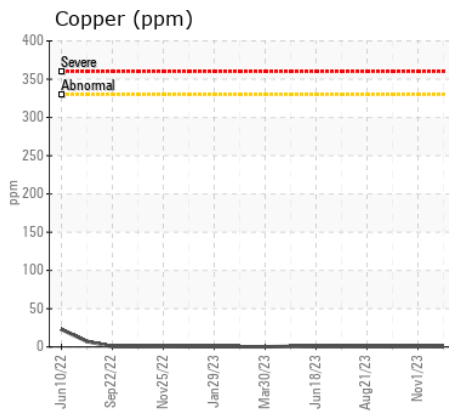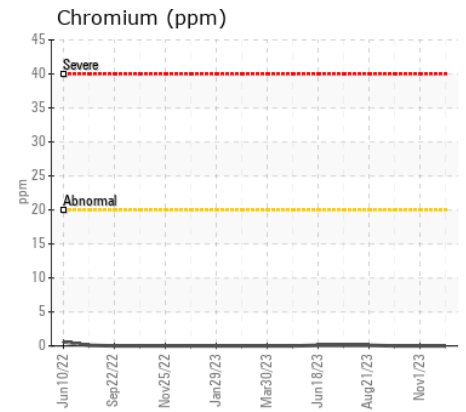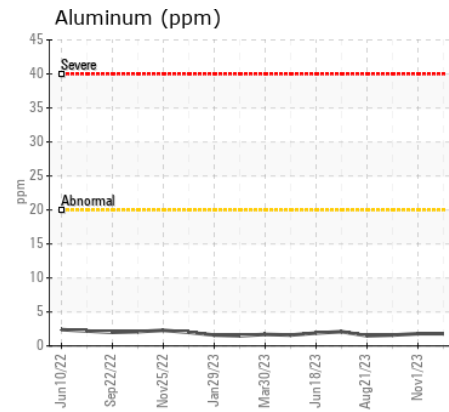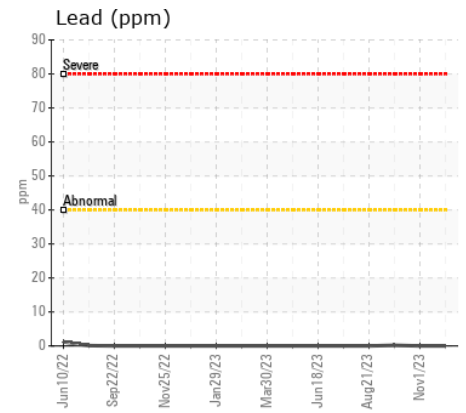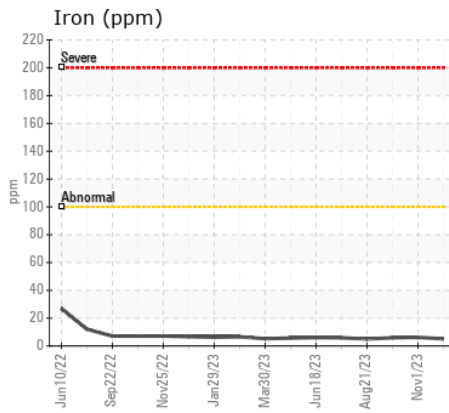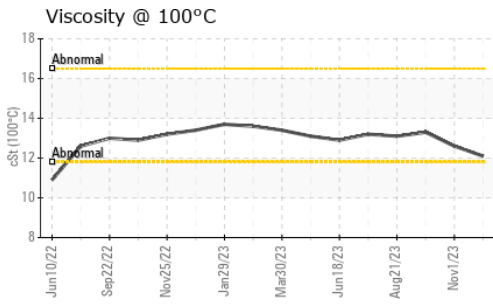

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0849311 **Received** : 16 Jan 2024
Lab Number : 02608904 **Diagnosed** : 16 Jan 2024
Unique Number : 5709990 **Diagnostician** : Wes Davis
Test Package : MOB 1

INTERFOR CORP
 5060 RTE 430
 BRUNSWICK MINE, NB
 CA E2A 6W6
 Contact: Daniel Hachey
 daniel.hachey@interfor.com
 T: (506)547-8700
 F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.