



TRAAP

Texas Refinery Advanced Analysis Program

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
VOLVO A40G VCE0A40GKE0338

Component
Transmission (Auto)

Fluid
DEXRON III (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		TR02609038	---	---
Sample Date		Client Info		05 Jan 2024	---	---
Machine Age	hrs	Client Info		9762	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

PQ		ASTM D8184*	>50	0	---	---
Iron	ppm	ASTM D5185(m)	>160	21	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>5	2	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>5	0	---	---
Aluminum	ppm	ASTM D5185(m)	>50	8	---	---
Lead	ppm	ASTM D5185(m)	>50	<1	---	---
Copper	ppm	ASTM D5185(m)	>225	6	---	---
Tin	ppm	ASTM D5185(m)	>10	<1	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION













There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185(m)	>20	5	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Water		WC Method	>0.1	NEG	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

Sodium	ppm	ASTM D5185(m)		1	---	---
Boron	ppm	ASTM D5185(m)		86	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		2	---	---
Calcium	ppm	ASTM D5185(m)		166	---	---
Phosphorus	ppm	ASTM D5185(m)		219	---	---
Zinc	ppm	ASTM D5185(m)		32	---	---
Sulfur	ppm	ASTM D5185(m)		1845	---	---
Acid Number (AN)	mg KOH/g	ASTM D974*		0.52	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	26.0	29.0	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	5.5	5.8	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	155	147	---	---

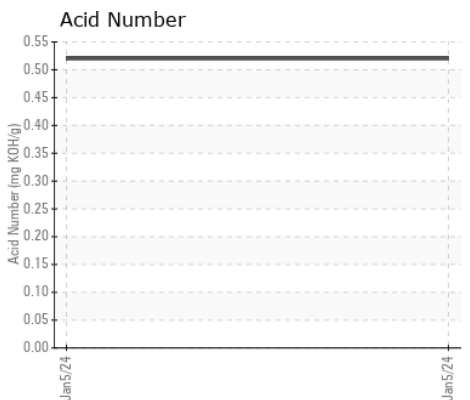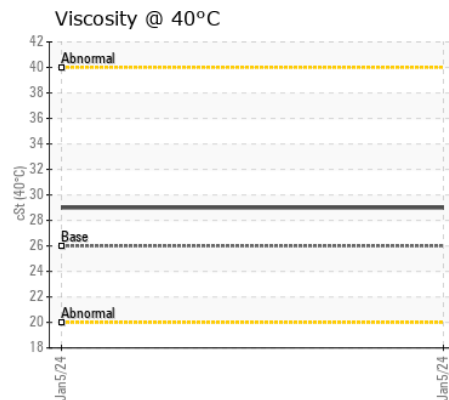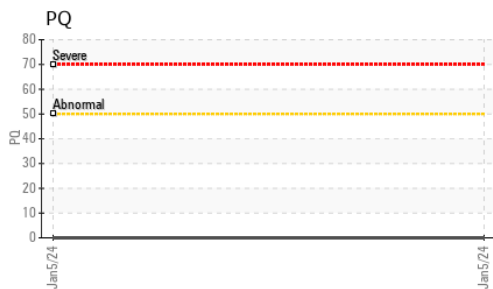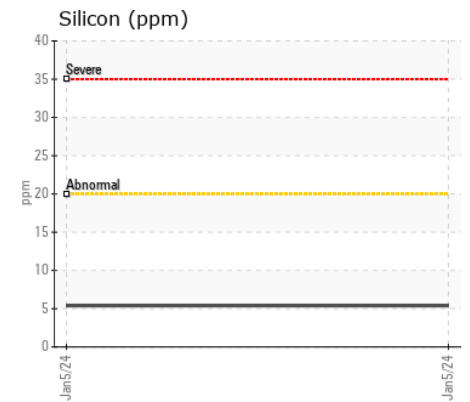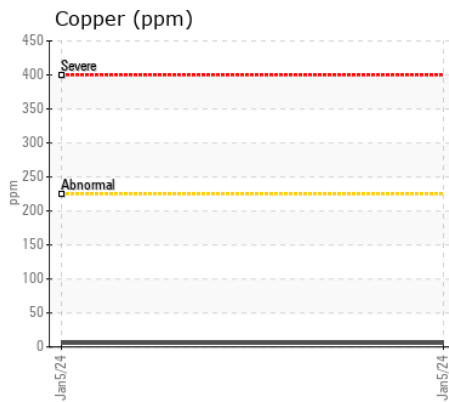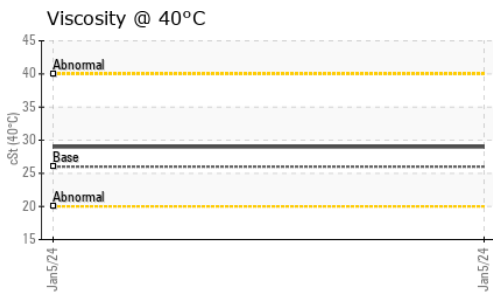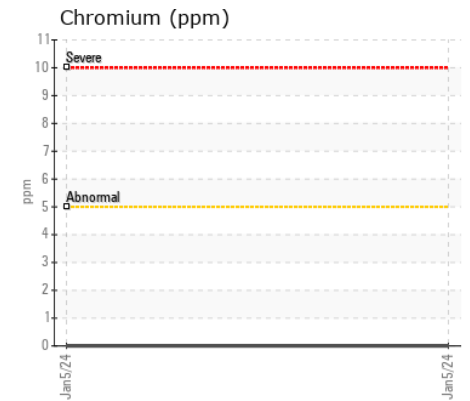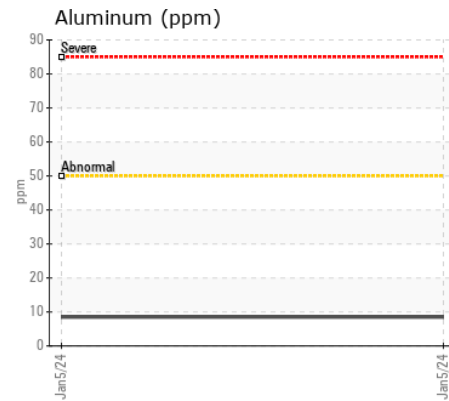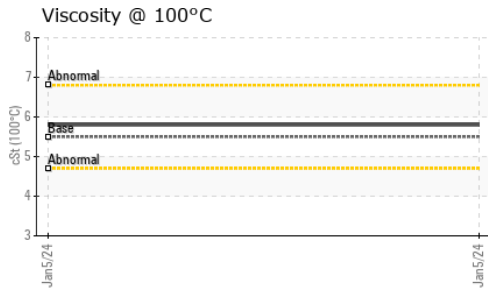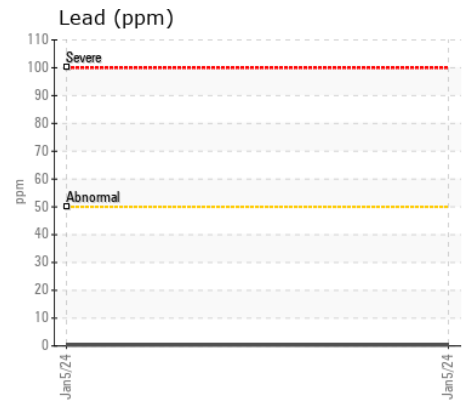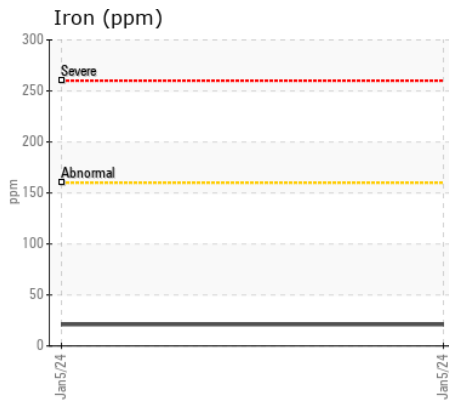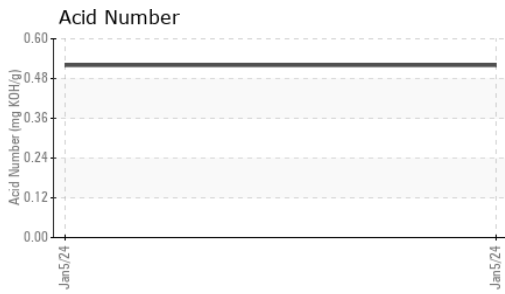

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : TR02609038 **Received** : 16 Jan 2024
Lab Number : 02609038 **Diagnosed** : 17 Jan 2024
Unique Number : 5710124 **Diagnostician** : Kevin Marson
Test Package : MOB 2 (Additional Tests: KV100, PQ, VI)

GARDEN PLANE COLONY
 BOX # 399
 FRONTIER, SK
 CA S0N 0W0
 Contact: JAKE

To discuss this sample report, contact Customer Service at 1-800-827-0711.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (306)294-0825
 F: (306)296-4476