



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id  
**SENNEBOGEN 830E 3309**  
 Component  
**Swing Drive**  
 Fluid  
**IRVING HDH SAE 75W90 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0849312</b>	WC0849304	WC0849320
Sample Date		Client Info		<b>08 Jan 2024</b>	01 Nov 2023	21 Aug 2023
Machine Age	hrs	Client Info		<b>9000</b>	8000	7000
Oil Age	hrs	Client Info		<b>1000</b>	1000	1000
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>400	<b>59</b>	53	40
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	0	0
Lead	ppm	ASTM D5185(m)	>50	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>200	<b>10</b>	13	15
Tin	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>50	<b>&lt;1</b>	0	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>0</b>	0	1
Boron	ppm	ASTM D5185(m)		<b>149</b>	164	148
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	<1
Calcium	ppm	ASTM D5185(m)		<b>13</b>	9	10
Phosphorus	ppm	ASTM D5185(m)		<b>1066</b>	1028	1071
Zinc	ppm	ASTM D5185(m)		<b>10</b>	10	14
Sulfur	ppm	ASTM D5185(m)		<b>21684</b>	21874	21175
Visc @ 40°C	cSt	ASTM D7279(m)	83.2	<b>108</b>	109	108

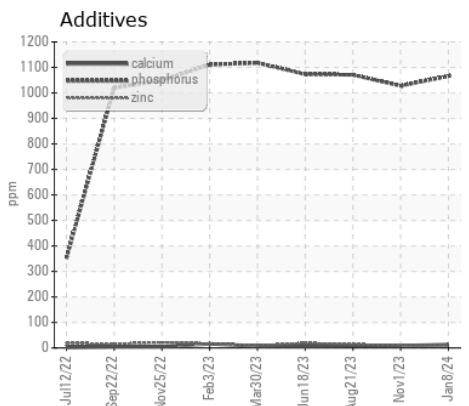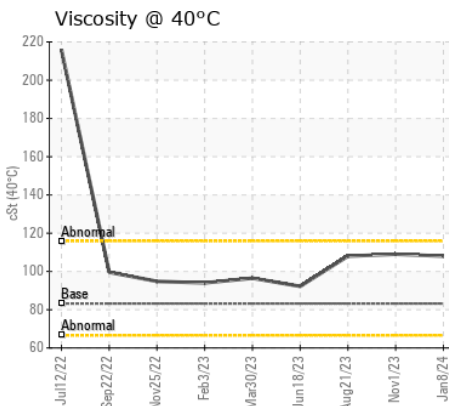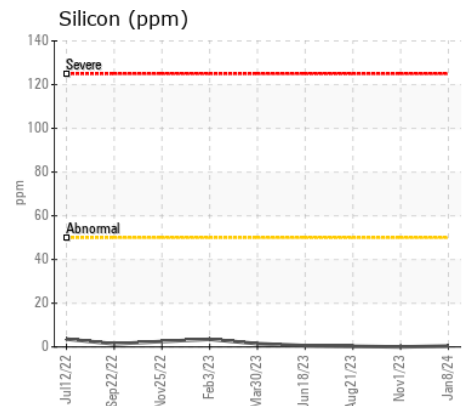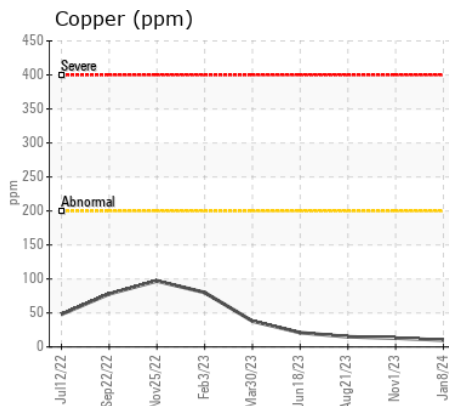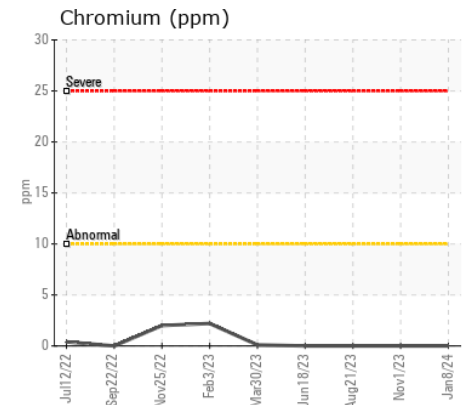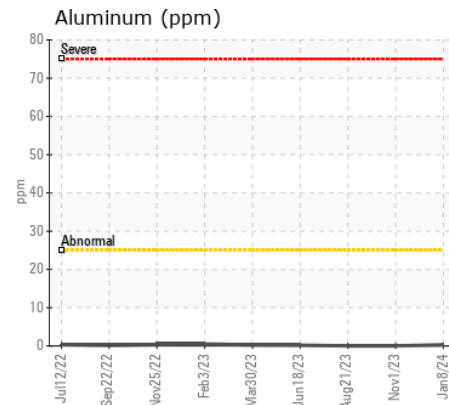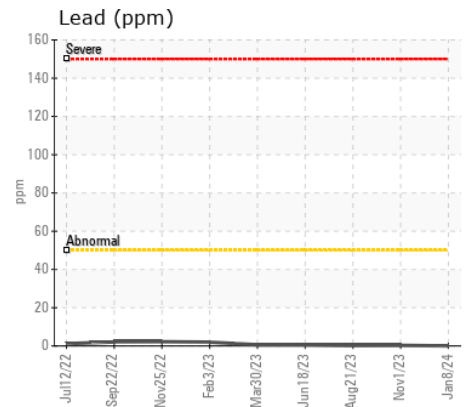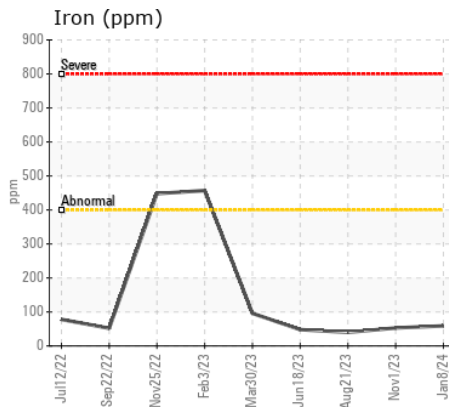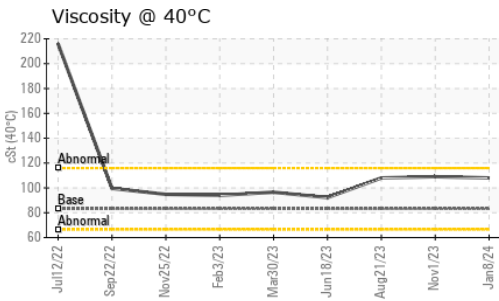

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0849312 **Received** : 16 Jan 2024  
**Lab Number** : 02609055 **Diagnosed** : 16 Jan 2024  
**Unique Number** : 5710141 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**INTERFOR CORP**  
 5060 RTE 430  
 BRUNSWICK MINE, NB  
 CA E2A 6W6  
 Contact: Daniel Hachey  
 daniel.hachey@interfor.com  
 T: (506)547-8700  
 F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.