



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
[331281]
 Machine Id
1860 G2
 Component
Diesel Engine
 Fluid
DIESEL ENGINE OIL SAE 15W40 (--- GAL)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		CU0020299	---	---
Sample Date		Client Info		23 Dec 2023	---	---
Machine Age	hrs	Client Info		2018	---	---
Oil Age	hrs	Client Info		600	---	---
Filter Age	hrs	Client Info		600	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>90	18	---	---
Chromium	ppm	ASTM D5185(m)	>20	<1	---	---
Nickel	ppm	ASTM D5185(m)	>2	<1	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	2	---	---
Lead	ppm	ASTM D5185(m)	>40	<1	---	---
Copper	ppm	ASTM D5185(m)	>330	<1	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

CONTAMINATION











Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>25	3	---	---
Potassium	ppm	ASTM D5185(m)	>20	19	---	---
Fuel		WC Method	>3.0	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol	%	ASTM D7922*		0.0	---	---
Soot %	%	ASTM D7844*	>6	0.1	---	---
Nitration	Abs/cm	ASTM D7624*	>20	11.0	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	22.3	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)	>158	4	---	---
Boron	ppm	ASTM D5185(m)	250	36	---	---
Barium	ppm	ASTM D5185(m)	10	0	---	---
Molybdenum	ppm	ASTM D5185(m)	100	62	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	450	1060	---	---
Calcium	ppm	ASTM D5185(m)	3000	846	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	964	---	---
Zinc	ppm	ASTM D5185(m)	1350	1142	---	---
Sulfur	ppm	ASTM D5185(m)	4250	2812	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	23.5	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	13.9	---	---

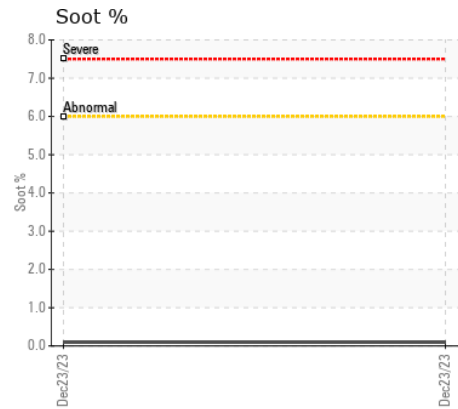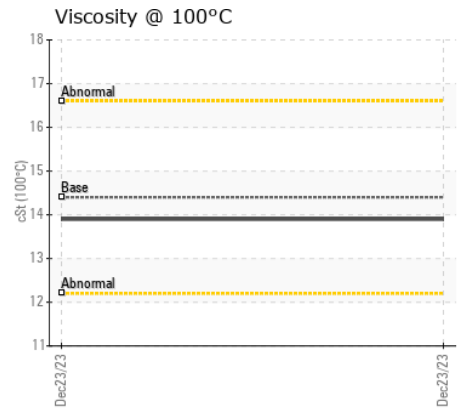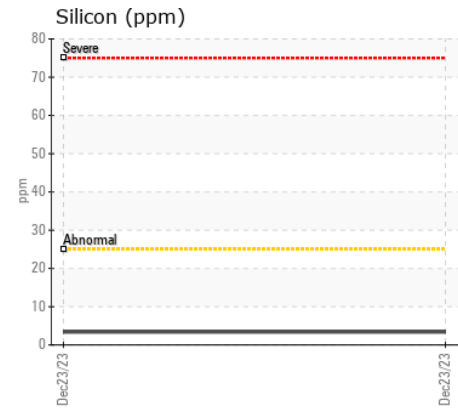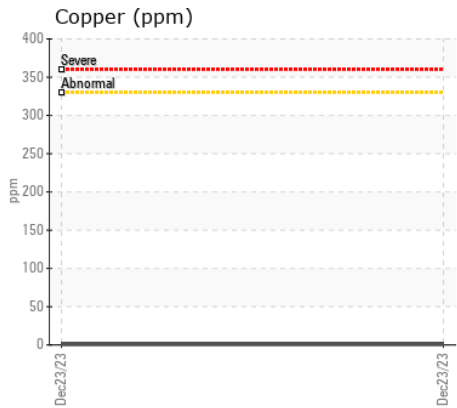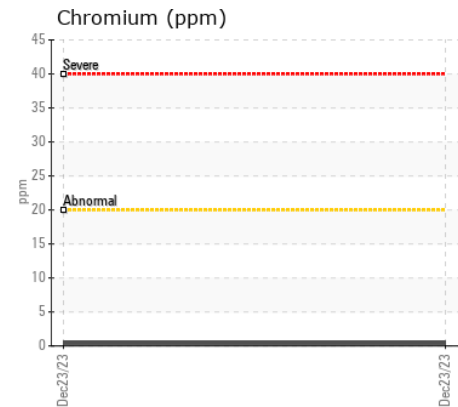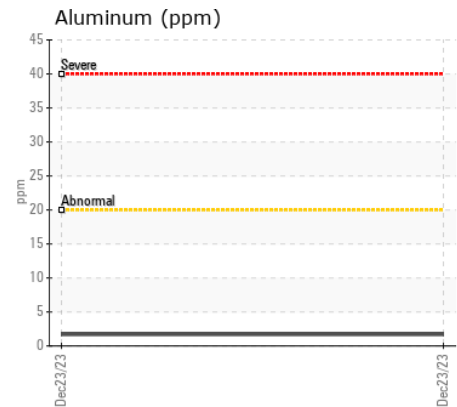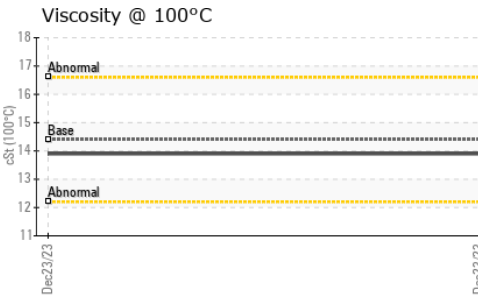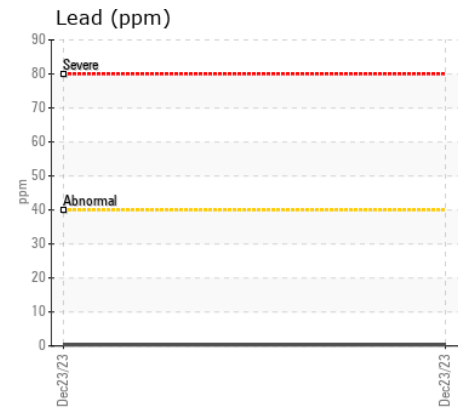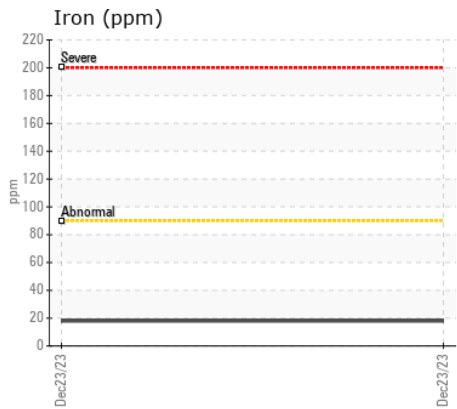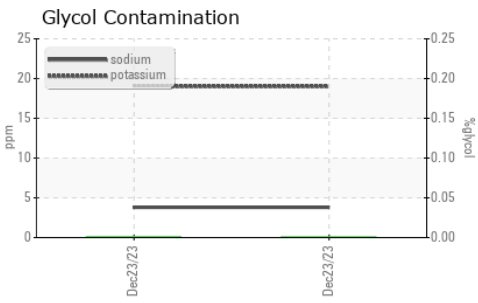

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : CU0020299 **Received** : 18 Jan 2024
Lab Number : 02609610 **Diagnosed** : 18 Jan 2024
Unique Number : 5710696 **Diagnostician** : Kevin Marson
Test Package : MOB 1 (Additional Tests: Glycol)

CUMMINS EASTERN CANADA LP
 315 AV LIBERTE
 CANDIAC, QC
 CA J5R 6Z7
 Contact: Thomas Owens
 is275@cummins.com
 T: (450)638-6863
 F: (450)638-1202

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.