



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH50M 145793-1216

Component
Splitter Box

Fluid
LIEBHERR GEAR BASIC 90 LS (--- GAL)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH	LH	LH
Sample Date		Client Info		16 Jan 2024	19 Dec 2023	30 Nov 2023
Machine Age	hrs	Client Info		6000	5500	5000
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		None	None	None
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>100	20	15	11
Chromium	ppm	ASTM D5185(m)	>5	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	<1	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	2	2	<1
Lead	ppm	ASTM D5185(m)	>30	<1	0	0
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>30	7	7	3
Potassium	ppm	ASTM D5185(m)	>20	1	2	0
Water		WC Method	>0.1	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

Les niveaux d'additifs indiquent l'ajout d'une autre marque ou d'un autre type d'huile. L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)	>25	2	2	1
Boron	ppm	ASTM D5185(m)	0	<1	<1	<1
Barium	ppm	ASTM D5185(m)	0	0	0	<1
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)	0	0	0	0
Magnesium	ppm	ASTM D5185(m)	<1	<1	1	3
Calcium	ppm	ASTM D5185(m)	<1	23	25	43
Phosphorus	ppm	ASTM D5185(m)	2143	2249	2247	2271
Zinc	ppm	ASTM D5185(m)	<1	18	18	26
Sulfur	ppm	ASTM D5185(m)	23468	24250	24261	23801
Visc @ 40°C	cSt	ASTM D7279(m)	170	181	188	185

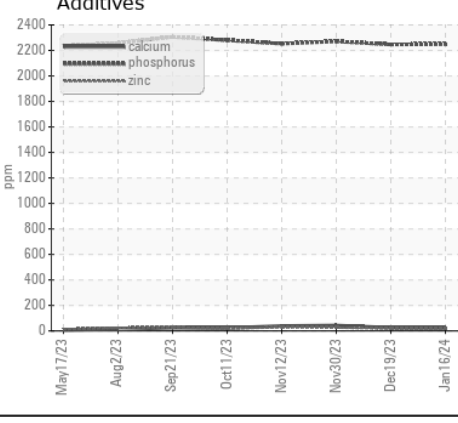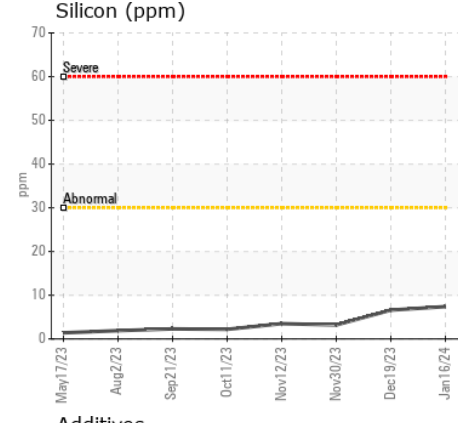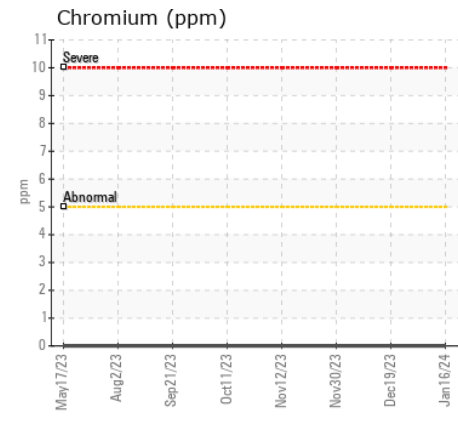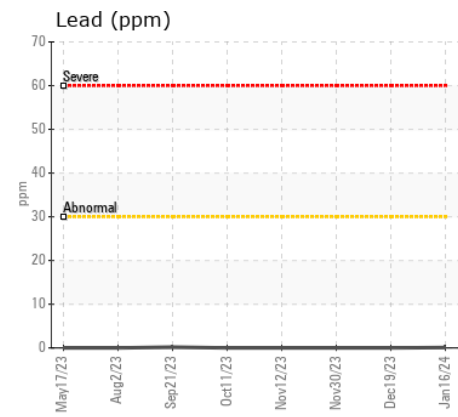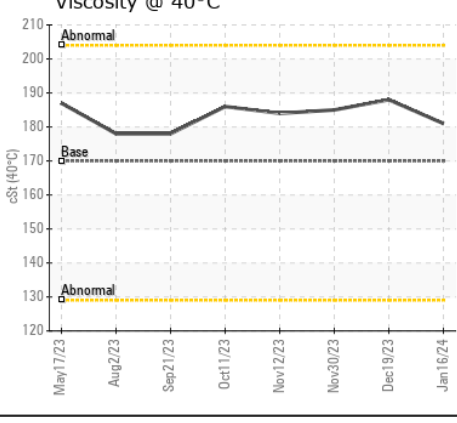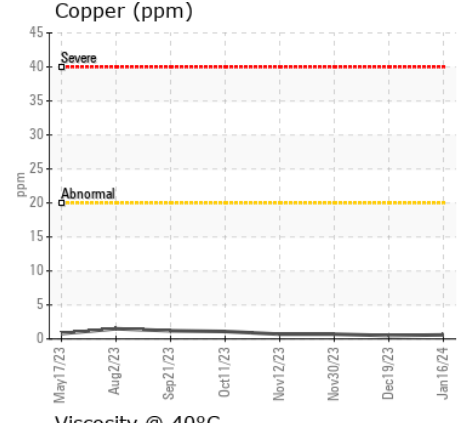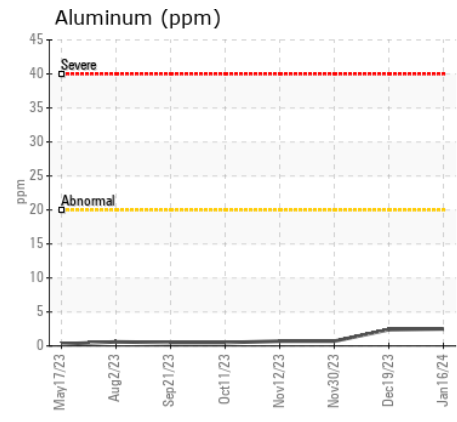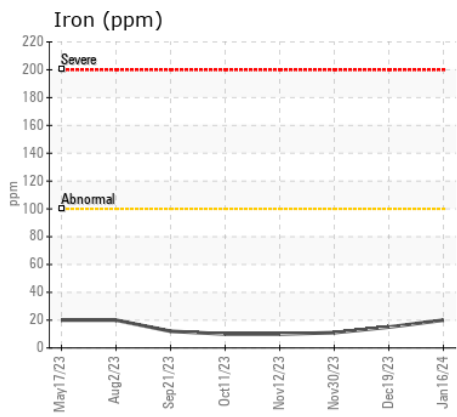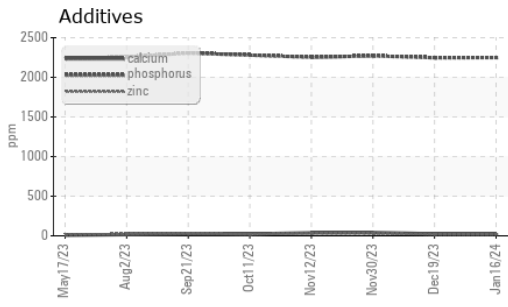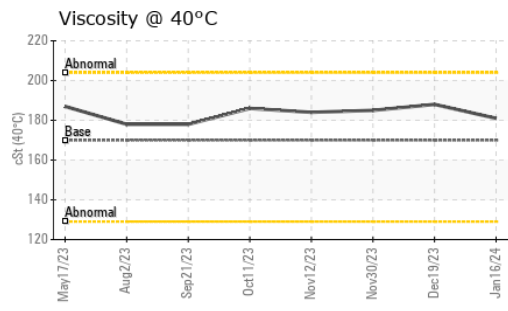

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH **Received** : 19 Jan 2024
Lab Number : 02610021 **Diagnosed** : 19 Jan 2024
Unique Number : 5711107 **Diagnostician** : Wes Davis
Test Package : MOB 1

PF Resolu Canada Inc.
 5850 avenue des jardins
 La Dore, QC
 CA G8J 1B4
 Contact: Dominic Caron

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: