



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
511056

Component
Diesel Engine

Fluid
PETRO CANADA DURON SHP 10W30 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0102646	---	---
Sample Date		Client Info		03 Jan 2024	---	---
Machine Age	hrs	Client Info		1343	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	15	---	---
Chromium	ppm	ASTM D5185(m)	>20	<1	---	---
Nickel	ppm	ASTM D5185(m)	>2	<1	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	<1	---	---
Aluminum	ppm	ASTM D5185(m)	>25	1	---	---
Lead	ppm	ASTM D5185(m)	>40	<1	---	---
Copper	ppm	ASTM D5185(m)	>330	2	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>3	0.1	---	---
Nitration	Abs/cm	ASTM D7624*	>20	7.3	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.5	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		3	---	---
Boron	ppm	ASTM D5185(m)	2	1	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	50	57	---	---
Manganese	ppm	ASTM D5185(m)	0	0	---	---
Magnesium	ppm	ASTM D5185(m)	950	930	---	---
Calcium	ppm	ASTM D5185(m)	1050	1021	---	---
Phosphorus	ppm	ASTM D5185(m)	995	988	---	---
Zinc	ppm	ASTM D5185(m)	1180	1138	---	---
Sulfur	ppm	ASTM D5185(m)	2600	2649	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.0	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	10.7	---	---

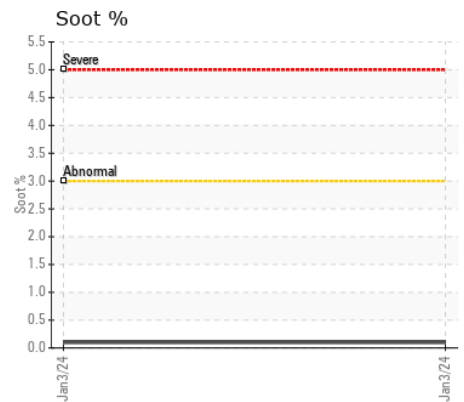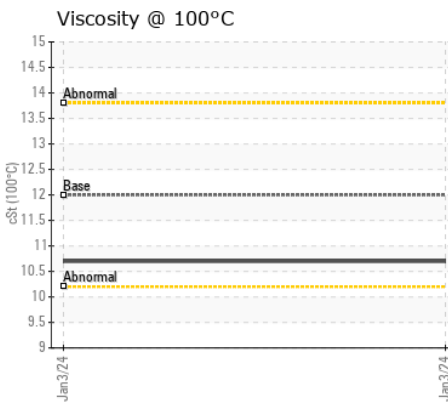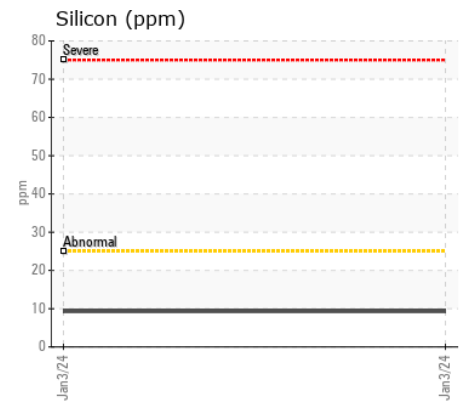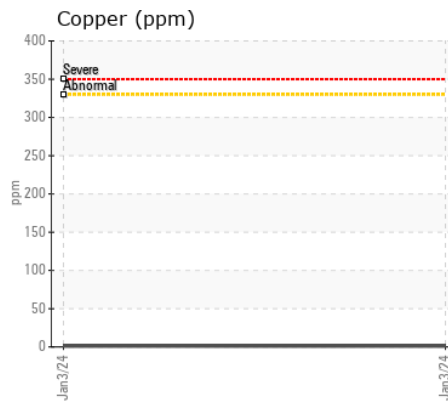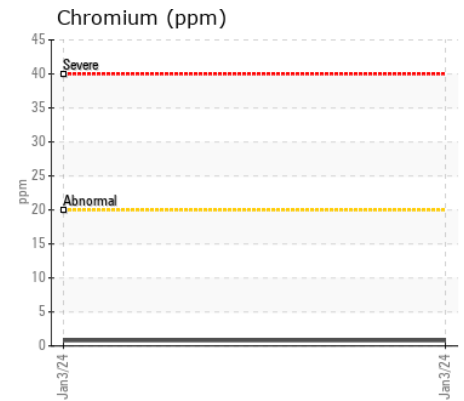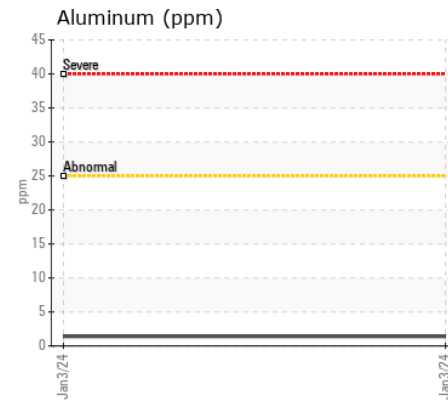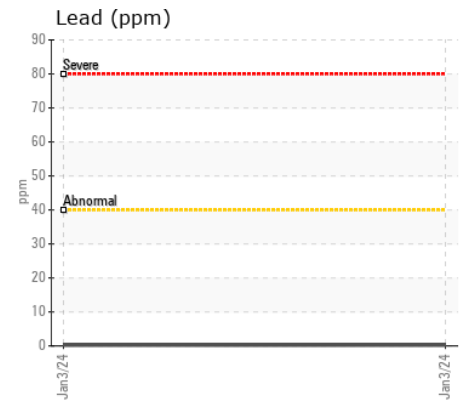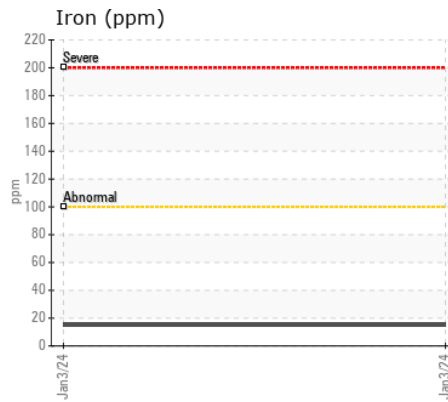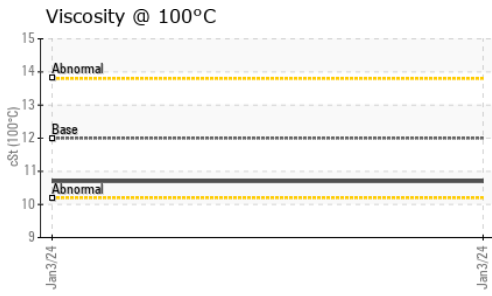

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 554 - Edmonton SW
Sample No. : GFL0102646 **Received** : 22 Jan 2024
Lab Number : 02610167 **Diagnosed** : 22 Jan 2024
Unique Number : 5711253 **Diagnostician** : Wes Davis
Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

8409 -15th Street NW
 Edmonton, AB
 CA T6P 0B8
 Contact: Kenny Hawkins
 khawkins2@gflenv.com
 T: (780)444-8805
 F: