

Area QC Engine Machine Id QC230725MOB2 Component Diesel Engine Fluid DIESEL ENGINE OIL SAE 40 (--- GAL)

RECOMMENDATION

We advise that you check for the source of water entry. We recommend that you drain the oil from the component if this has not already been done. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample.

WEAR

All component wear rates are normal.


CONTAMINATION

There is a moderate amount of fuel present in the oil. There is a light concentration of water present in the oil. Tests confirm the presence of fuel in the oil.

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. Viscosity of sample indicates oil is within SAE 10W30 range, advise investigate. The oil is no longer serviceable due to the presence of contaminants.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0894160	WC0894159	WC0894156
Sample Date		Client Info		23 Jan 2024	22 Jan 2024	19 Jan 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Iron	ppm	ASTM D5185(m)	>100	20	20	20
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		2	2	2
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	5	5	5
Lead	ppm	ASTM D5185(m)	>40	1	1	2
Copper	ppm	ASTM D5185(m)	>330	9	9	9
Tin	ppm	ASTM D5185(m)	>15	<1	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Silicon	ppm	ASTM D5185(m)	>25	6	7	6
Potassium	ppm	ASTM D5185(m)	>20	<u> </u>	▲ 17	<u> </u>
Fuel	%	ASTM D7593*	>5	5.5	▲ 5.4	▲ 5.5
Water	%	ASTM D6304*	>0.2	▲ 0.360	▲ 0.353	0.279
ppm Water	ppm	ASTM D6304*	>2000	3601	▲ 3533	▲ 2792
Glycol	%	ASTM D7922*		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	10.2	10.3	10.0
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.7	20.5	20.6
Emulsified Water	scalar	Visual*	>0.2	.5%	.5%	.2%
Sodium	ppm	ASTM D5185(m)	>216	6 8	▲ 74	▲ 63
Boron	ppm	ASTM D5185(m)	250	29	31	31
Barium	ppm	ASTM D5185(m)	10	0	0	0
Molybdenum	ppm	ASTM D5185(m)	100	46	47	47
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	450	613	619	614
Calcium	ppm	ASTM D5185(m)	3000	1495	1493	1498
Phosphorus	ppm	ASTM D5185(m)	1150	860	867	881
Zinc	ppm	ASTM D5185(m)	1350	1011	1013	1017
Sulfur	ppm	ASTM D5185(m)	4250	2756	2773	2781
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.6	16.9	16.3
Base Number (BN)	mg KOH/g	ASTM D2896*	8.5	7.63	8.29	8.23
Visc @ 40°C	cSt	ASTM D7279(m)	138	A 75.3	▲ 75.4	▲ 75.0
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	11.3	▲ 11.4	▲ 11.3
Viscosity Index (VI)	Scale	ASTM D2270*	102	141	143	142

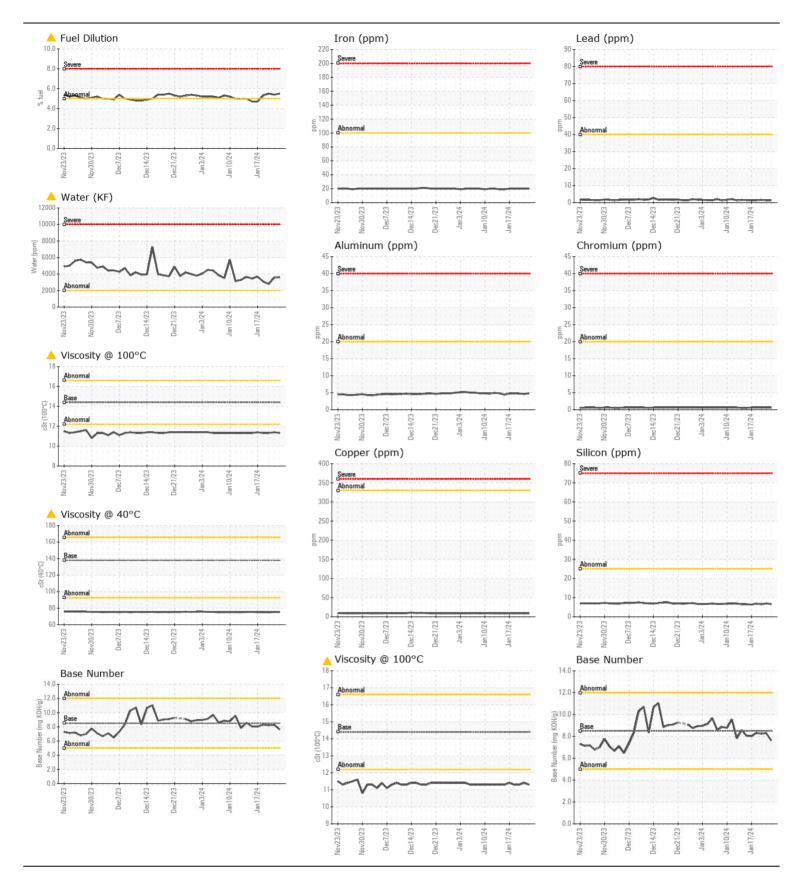

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 WearCheck Quality Control Sample Results CALA : WC0894160 Recieved Sample No. : 23 Jan 2024 Ĺτ : 02610506 Lab Number Diagnosed : 24 Jan 2024 Burlington, ON ISO 17025:2017 Accredited : 5711592 **Unique Number** Diagnostician : Kevin Marson CA Laboratory Test Package : MOB 2 (Additional Tests: Glycol, KF, KV40, PercentFuel, VI) Contact: Dorian Anderson To discuss this sample report, contact Customer Service at 1-800-268-2131. dorian.anderson@wearcheck.com T: (289)291-4652 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. F: (905)569-8605 Validity of results and interpretation are based on the sample and information as supplied.