



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
[103468]
 Machine Id
6624
 Component
Diesel Engine
 Fluid
{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		CU0021057	---	---
Sample Date		Client Info		19 Feb 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>75	11	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>4	0	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	0	---	---
Aluminum	ppm	ASTM D5185(m)	>15	2	---	---
Lead	ppm	ASTM D5185(m)	>25	<1	---	---
Copper	ppm	ASTM D5185(m)	>100	2	---	---
Tin	ppm	ASTM D5185(m)	>4	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	159	---	---
Fuel		WC Method	>3.0	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol	%	ASTM D7922*		0.0	---	---
Soot %	%	ASTM D7844*	>6	0.2	---	---
Nitration	Abs/cm	ASTM D7624*	>20	7.9	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.7	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		83	---	---
Boron	ppm	ASTM D5185(m)		24	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		64	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		749	---	---
Calcium	ppm	ASTM D5185(m)		1129	---	---
Phosphorus	ppm	ASTM D5185(m)		740	---	---
Zinc	ppm	ASTM D5185(m)		797	---	---
Sulfur	ppm	ASTM D5185(m)		2117	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.7	---	---
Visc @ 100°C	cSt	ASTM D7279(m)		13.1	---	---

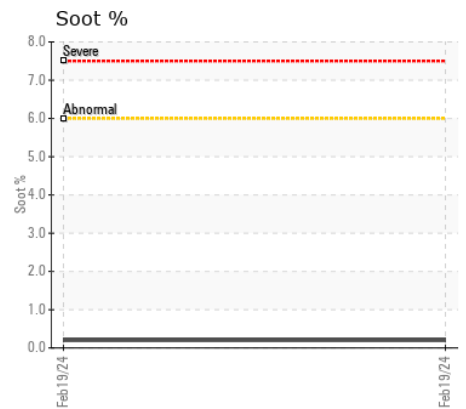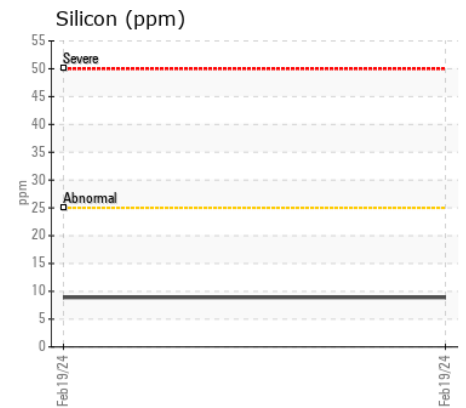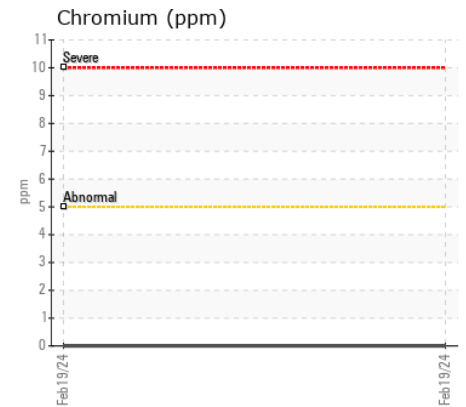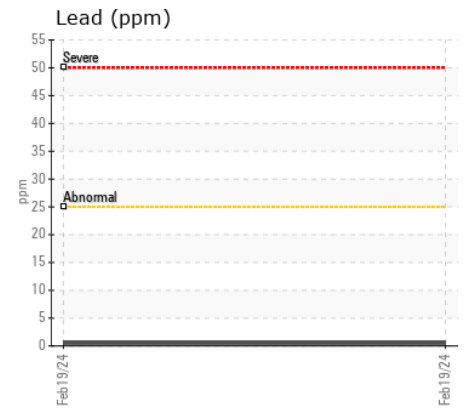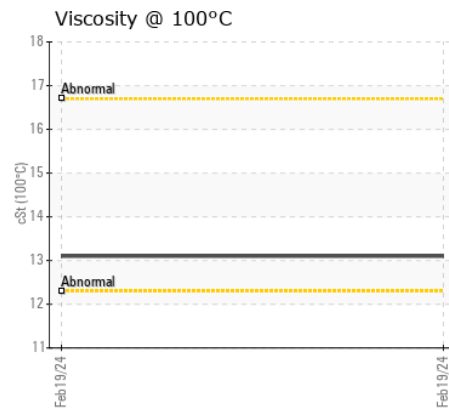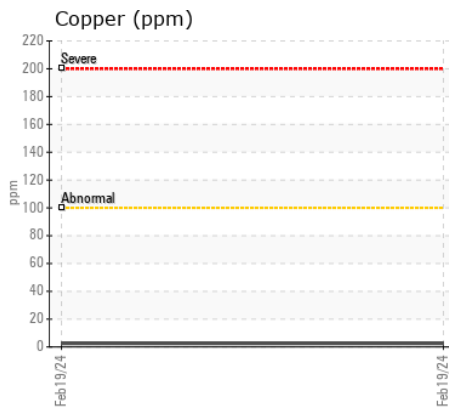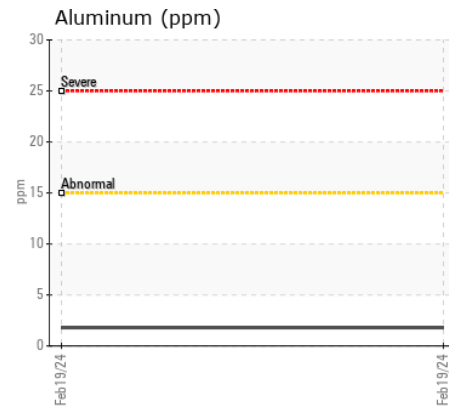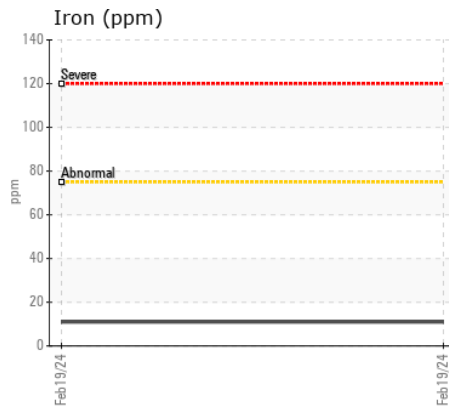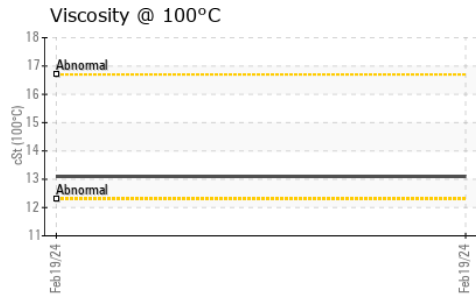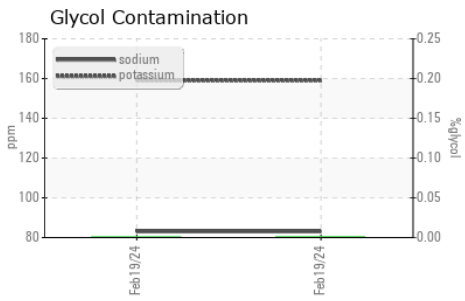

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : CU0021057 **Received** : 20 Feb 2024
Lab Number : 02616599 **Tested** : 20 Feb 2024
Unique Number : 5733709 **Diagnosed** : 21 Feb 2024 - Kevin Marson
Test Package : MOB 1 (Additional Tests: Glycol, Visual)

CUMMINS EASTERN CANADA LP
 3189 SWANSEA CRESCENT
 OTTAWA, ON
 CA K1G 3W5
 Contact: Cindy Harrison
 cindy.harrison@cummins.com
 T: (613)736-1146
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.