



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL



Machine Id
CATERPILLAR AD30 TRK218

Component
Rear Left Planetary

Fluid
PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0908127	WC0871329	WC0654909
Sample Date		Client Info		14 Feb 2024	01 Oct 2023	17 Feb 2022
Machine Age	hrs	Client Info		15677	14549	6460
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changed	Changed	Changed
Filter Changed		Client Info		Not Changed	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	44	37	38
Chromium	ppm	ASTM D5185(m)	>10	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>25	4	3	3
Lead	ppm	ASTM D5185(m)	>25	<1	<1	2
Copper	ppm	ASTM D5185(m)	>75	26	16	58
Tin	ppm	ASTM D5185(m)	>10	<1	<1	2
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











There is a moderate concentration of dirt present in the oil.

Silicon	ppm	ASTM D5185(m)	>75	▲ 147	69	17
Potassium	ppm	ASTM D5185(m)	>20	1	0	<1
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185(m)		1	1	<1
Boron	ppm	ASTM D5185(m)	2	1	2	2
Barium	ppm	ASTM D5185(m)	0	0	<1	0
Molybdenum	ppm	ASTM D5185(m)	0	0	<1	2
Manganese	ppm	ASTM D5185(m)	0	0	0	<1
Magnesium	ppm	ASTM D5185(m)	9	13	16	12
Calcium	ppm	ASTM D5185(m)	3114	3452	4106	3781
Phosphorus	ppm	ASTM D5185(m)	1099	875	891	918
Zinc	ppm	ASTM D5185(m)	1245	1024	1062	1061
Sulfur	ppm	ASTM D5185(m)	7086	11335	7694	6625
Visc @ 40°C	cSt	ASTM D7279(m)	213.9	197	205	202

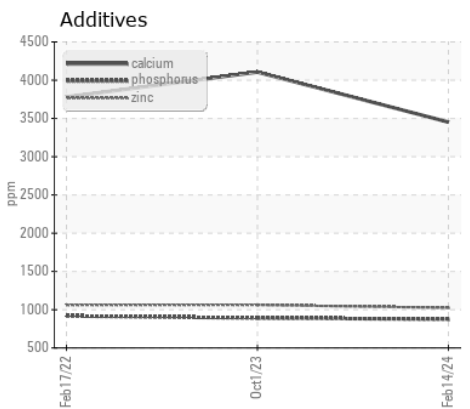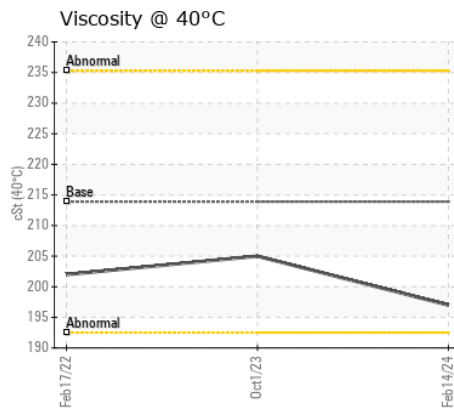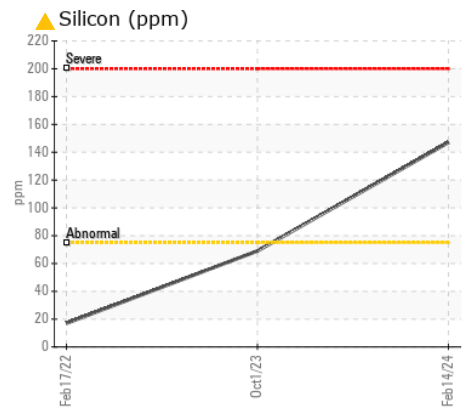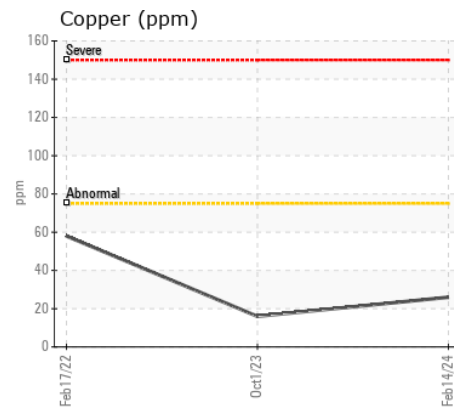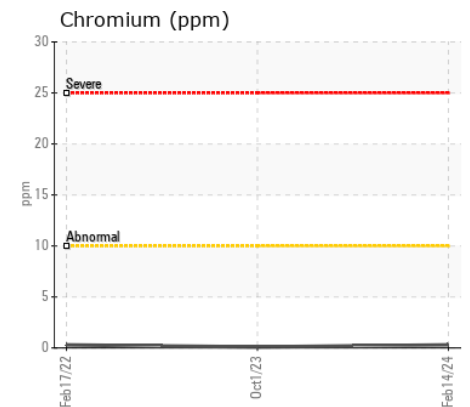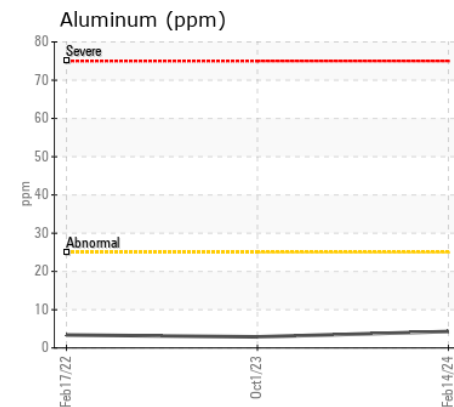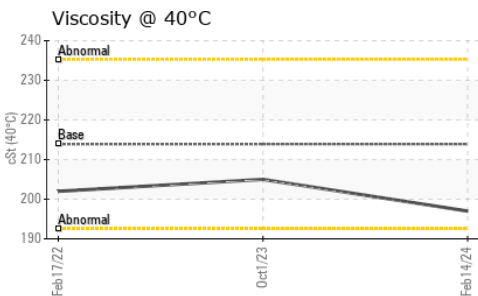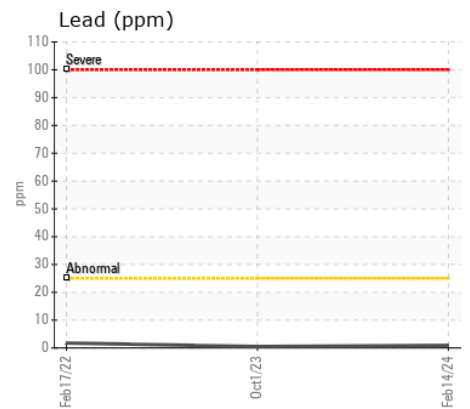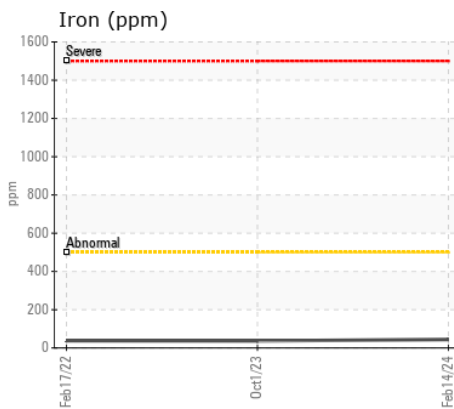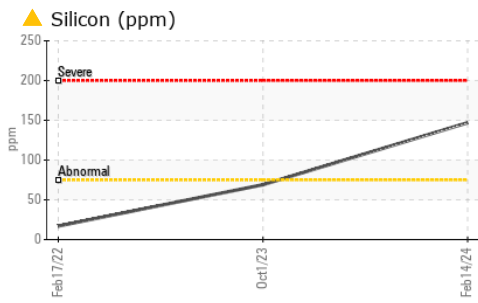

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0908127
Lab Number : 02617187
Unique Number : 5734297
Test Package : MOB 1

Received : 21 Feb 2024
Tested : 21 Feb 2024
Diagnosed : 22 Feb 2024 - Kevin Marson

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1
 Contact: Jay Gould
 MacassaMobileUGPlanning@agnicoeagle.com
 T: (705)567-5208
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.