



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(374940)
Machine Id
LIEBHERR LH30M 137944-1253
Component
Splitter Box
Fluid
LIEBHERR GEAR BASIC 90 LS (--- GAL)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0278728	LH0256533	LH0203077
Sample Date		Client Info		22 Feb 2024	13 Jun 2023	13 Feb 2023
Machine Age	hrs	Client Info		2777	1701	1206
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	Changed	Not Changd
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	13	15	28
Chromium	ppm	ASTM D5185(m)	>5	0	0	<1
Nickel	ppm	ASTM D5185(m)	>5	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	<1
Lead	ppm	ASTM D5185(m)	>30	<1	<1	0
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>30	<1	<1	1
Potassium	ppm	ASTM D5185(m)	>20	1	<1	0
Water		WC Method	>0.1	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	VLITE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	1	2	2
Boron	ppm	ASTM D5185(m)	0	192	60	65
Barium	ppm	ASTM D5185(m)	0	0	<1	<1
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)	0	0	<1	1
Magnesium	ppm	ASTM D5185(m)	<1	5	2	1
Calcium	ppm	ASTM D5185(m)	<1	18	14	14
Phosphorus	ppm	ASTM D5185(m)	2143	1212	1303	1352
Zinc	ppm	ASTM D5185(m)	<1	21	14	11
Sulfur	ppm	ASTM D5185(m)	23468	20874	23638	25626
Visc @ 40°C	cSt	ASTM D7279(m)	170	119	159	160

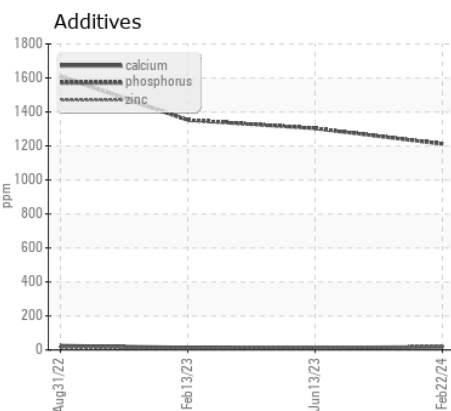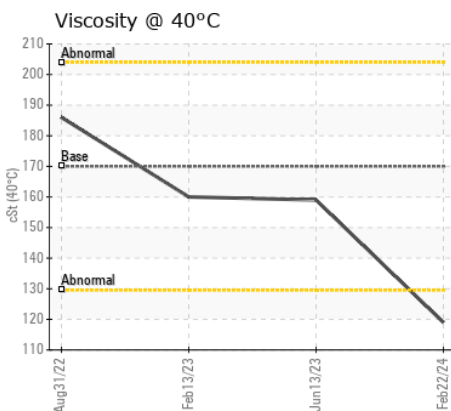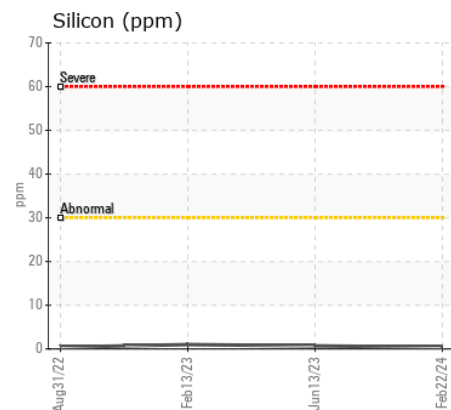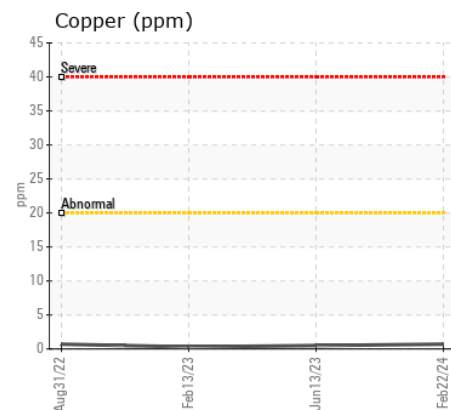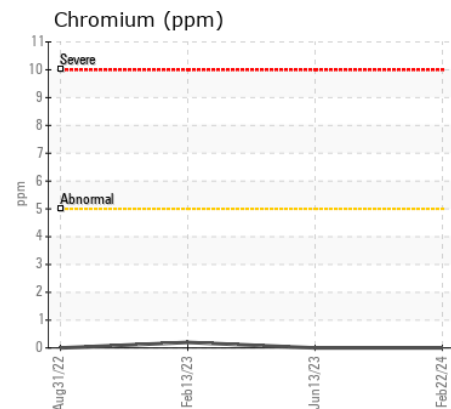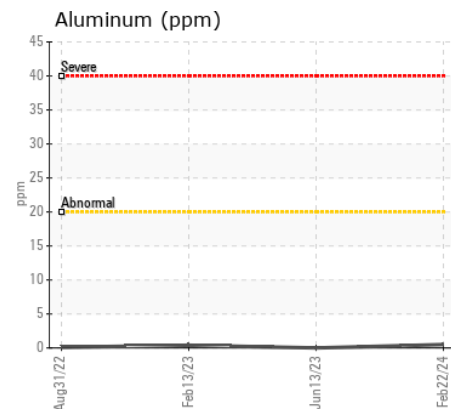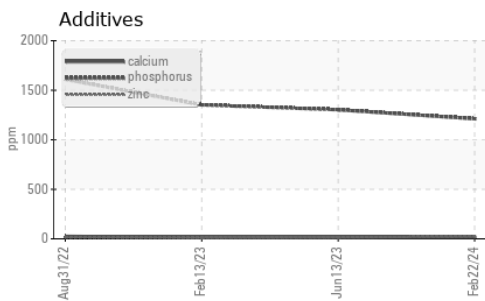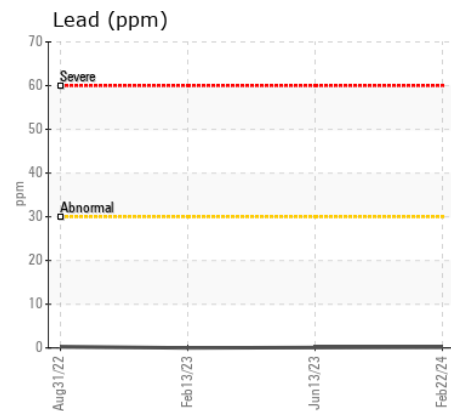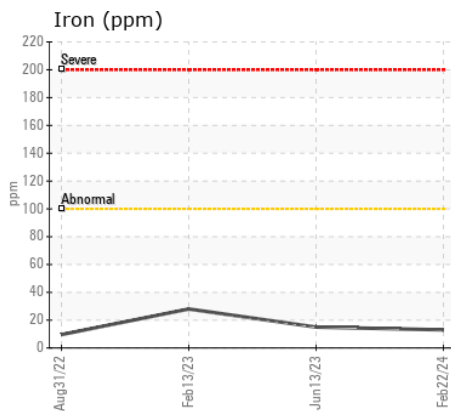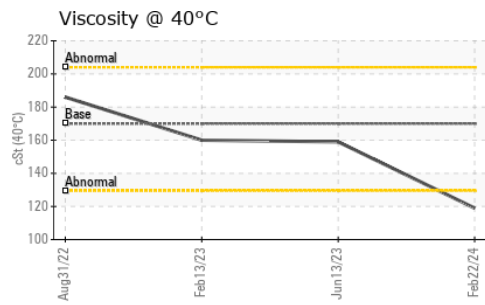

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0278728
Lab Number : 02617724
Unique Number : 5734834
Test Package : MOB 1
Received : 23 Feb 2024
Tested : 23 Feb 2024
Diagnosed : 23 Feb 2024 - Wes Davis

KINGS AUTO WRECKERS
 1866 DRUMMOND LINE
 PETERBOROUGH, ON
 CA K9J 6X8
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: