

**OIL ANALYSIS REPORT** 


**WEAR CONTAMINATION FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

(CFIOA) OREA AIRWAYS [53011] [CFIOA] FAIRCHILD SA227AT P-44372 (S/N AT-492)

Right Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

<u></u>							
IENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT57692	GT57673	GT57341
	Sample Date		Client Info		22 Feb 2024	07 Feb 2024	20 Jan 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		256	177	109
	Filter Age	hrs	Client Info		79	68	59
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status					NORMAL	NORMAL
	Iron	ppm	ASTM D5185(m)	>8	0	0	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	<1
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	0	<1
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.24	1.10	0.97
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2		24.2	24.6

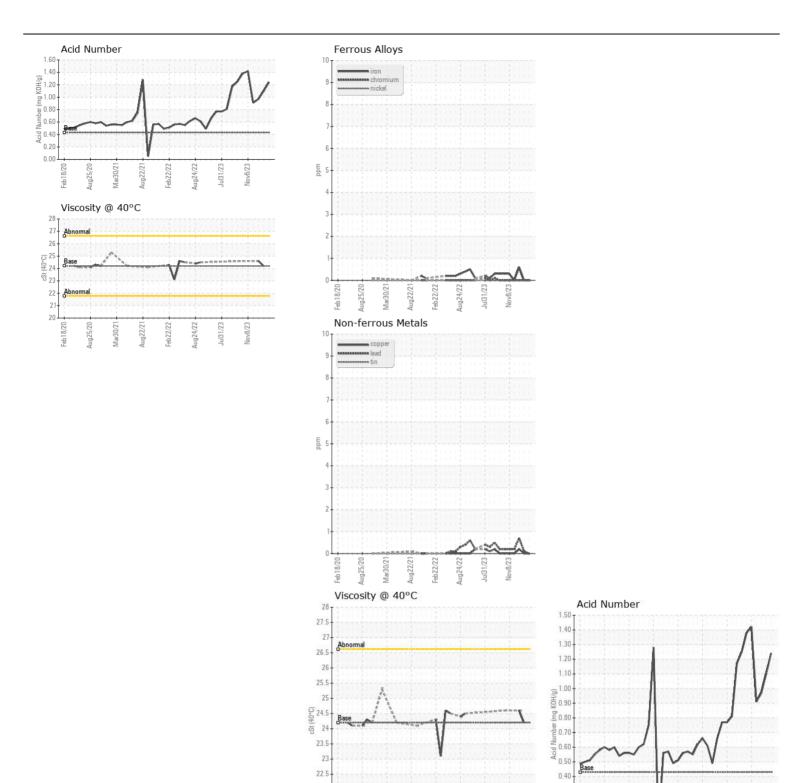



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No.

: GT57692 Lab Number : 02617932 Unique Number : 5735042

21.

20.5

Feb18/20

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Tested

Diagnosed

Jul31/23

**Honeywell Engines** : 23 Feb 2024 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

0.30

0.20 0.10

0.00

PHOENIX, AZ US 85034 Contact: GARRETT

Test Package : G331 ( Additional Tests: ICP ) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

Jul31/23