



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(349193)
Machine Id
LIEBHERR L556 052705-1332
Component
Rear Left Wheel Hub
Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0276928	LH0259814	LH0250631
Sample Date		Client Info		22 Jan 2024	18 Sep 2023	05 Apr 2023
Machine Age	hrs	Client Info		11046	10006	8174
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	28	43	83
Chromium	ppm	ASTM D5185(m)	>8	0	0	<1
Nickel	ppm	ASTM D5185(m)	>5	0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>5	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>5	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>50	8	10	22
Tin	ppm	ASTM D5185(m)		0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	VLITE	VLITE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	1	2	2
Potassium	ppm	ASTM D5185(m)	>20	<1	0	0
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	LIGHT	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<1	1	<1
Boron	ppm	ASTM D5185(m)	328	225	291	268
Barium	ppm	ASTM D5185(m)	1	0	<1	0
Molybdenum	ppm	ASTM D5185(m)		2	2	11
Manganese	ppm	ASTM D5185(m)		0	0	1
Magnesium	ppm	ASTM D5185(m)	1	<1	1	2
Calcium	ppm	ASTM D5185(m)	7	1	4	8
Phosphorus	ppm	ASTM D5185(m)	1145	2878	2701	2806
Zinc	ppm	ASTM D5185(m)	3	4	13	16
Sulfur	ppm	ASTM D5185(m)	17909	22397	20398	20026
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	93.6	97.3	92.1

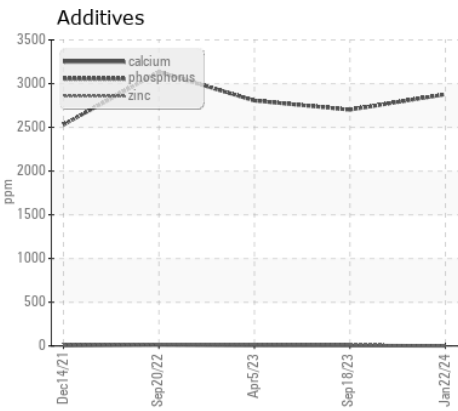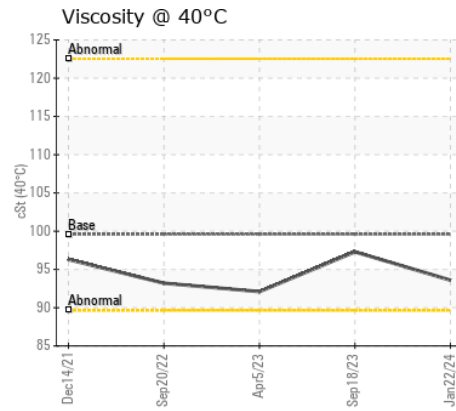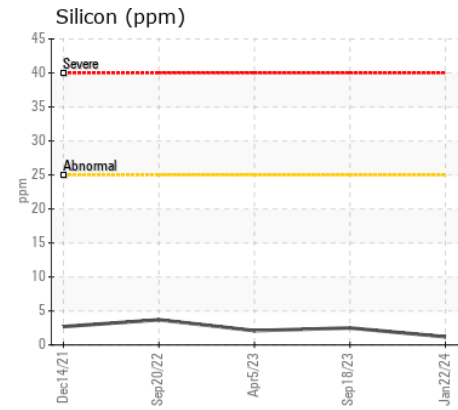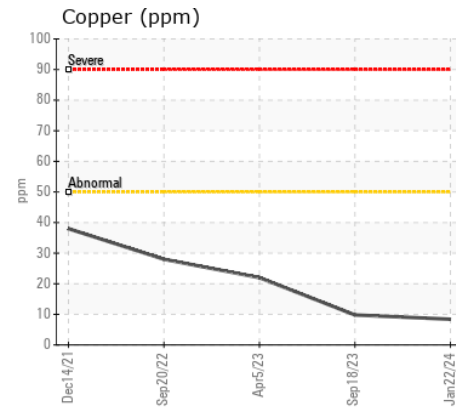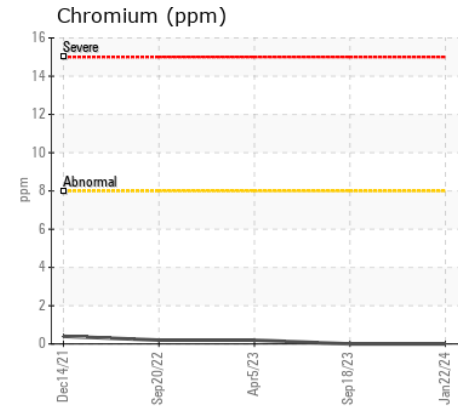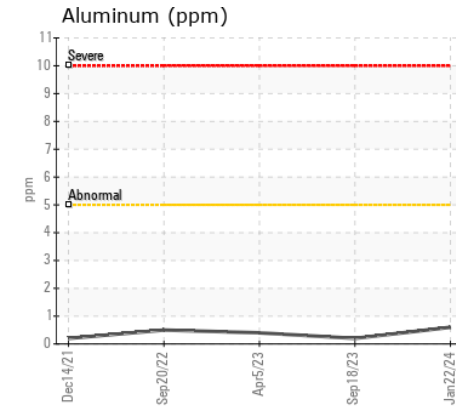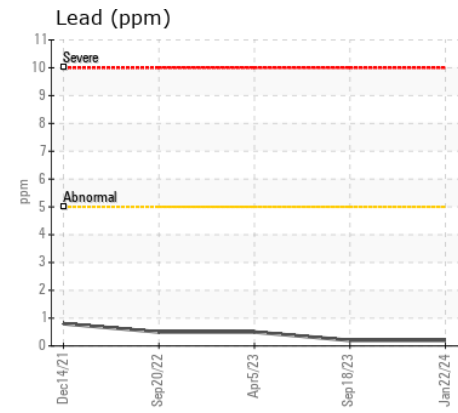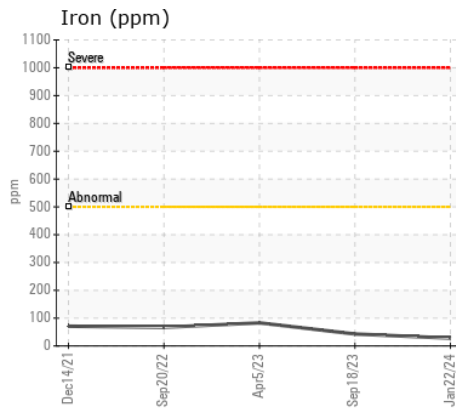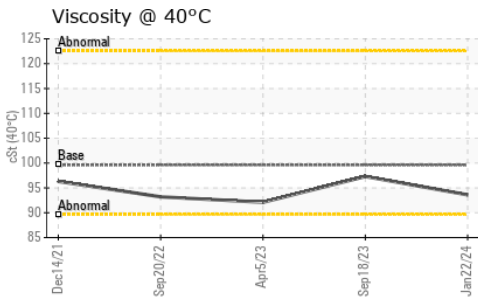

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0276928
Lab Number : 02619340
Unique Number : 5736450
Test Package : MOB 1
Received : 01 Mar 2024
Tested : 01 Mar 2024
Diagnosed : 01 Mar 2024 - Wes Davis

Eacom Timber Corporation
 100 Old Nairn Centre Road
 Nairn Centre, ON
 CA P0M 2L0
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: