



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH50M 124550-1216**

Component  
**Splitter Box**

Fluid  
**PETRO CANADA TRAXON SYNTHETIC 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0278735</b>	LH0278896	LH0270141
Sample Date		Client Info		<b>04 Mar 2024</b>	09 Jan 2024	27 Sep 2023
Machine Age	hrs	Client Info		<b>14018</b>	13772	12565
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>80	<b>12</b>	13	13
Chromium	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	<1	0
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>10	<b>2</b>	2	4
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	0	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	<1	1
Boron	ppm	ASTM D5185(m)	328	<b>275</b>	245	63
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1	<b>2</b>	2	<1
Calcium	ppm	ASTM D5185(m)	7	<b>26</b>	31	22
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1205</b>	1150	827
Zinc	ppm	ASTM D5185(m)	3	<b>85</b>	116	82
Sulfur	ppm	ASTM D5185(m)	17909	<b>19619</b>	18283	18528
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>88.9</b>	83.1	79.3

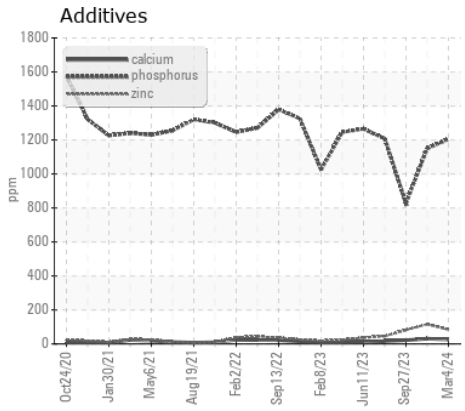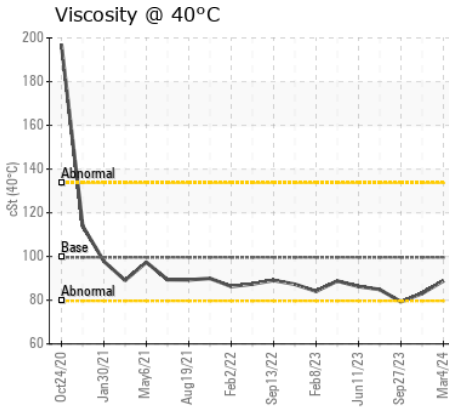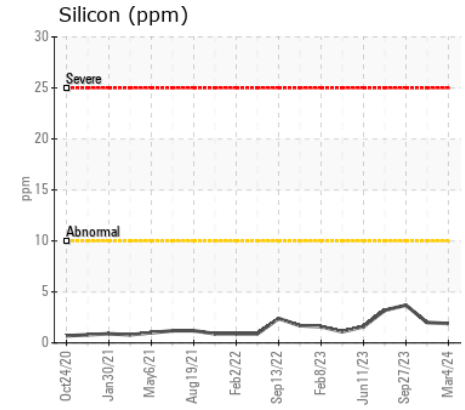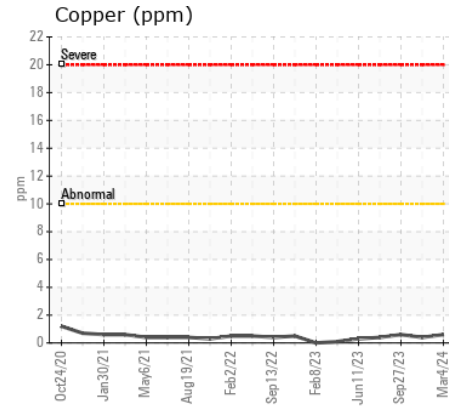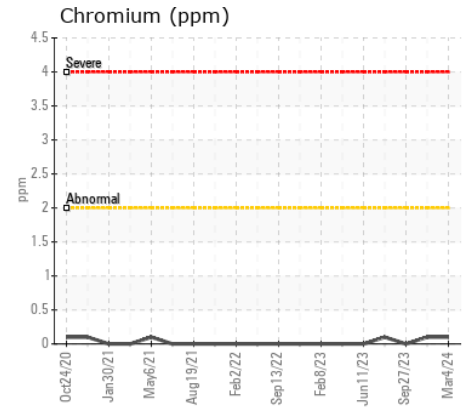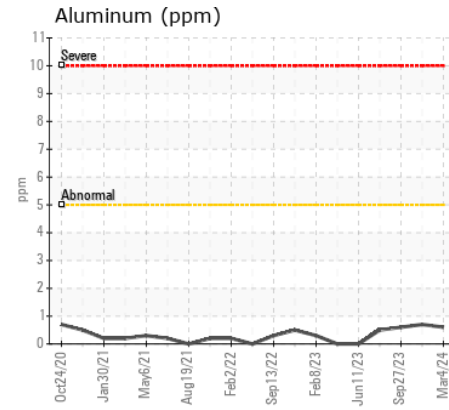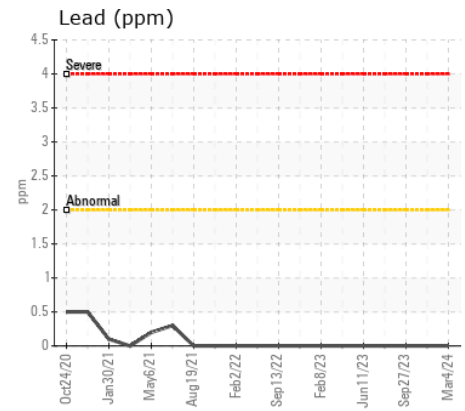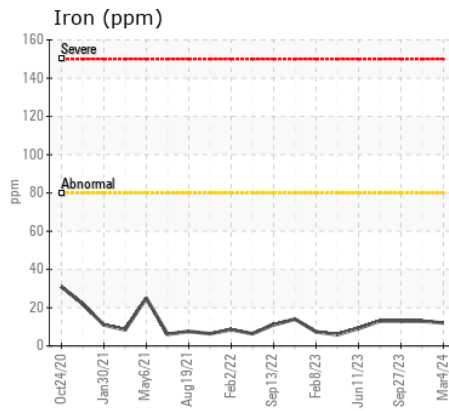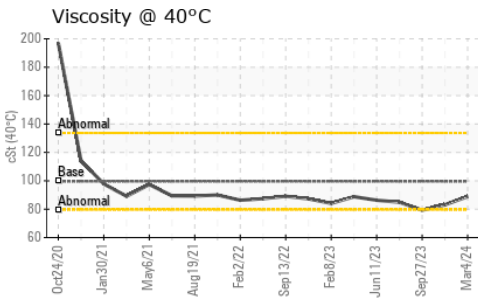

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0278735  
**Lab Number** : 02620655  
**Unique Number** : 5737765  
**Test Package** : MOB 1  
**Received** : 07 Mar 2024  
**Tested** : 07 Mar 2024  
**Diagnosed** : 07 Mar 2024 - Wes Davis

**COMBINED METAL INDUSTRIES-PUBLIC YARD**  
 129 FENMAR DR  
 TORONTO, ON  
 CA M9L 1M7  
 Contact: Greg Sacher  
 gsacher@combinedmetal.com  
 T: (416)642-7262  
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.