



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR L586 059953-1334

Component
Front Left Wheel Hub

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0270305	---	---
Sample Date		Client Info		05 Mar 2024	---	---
Machine Age	hrs	Client Info		7962	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>1625	92	---	---
Chromium	ppm	ASTM D5185(m)	>8	<1	---	---
Nickel	ppm	ASTM D5185(m)	>4	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		<1	---	---
Aluminum	ppm	ASTM D5185(m)	>25	1	---	---
Lead	ppm	ASTM D5185(m)	>8	1	---	---
Copper	ppm	ASTM D5185(m)	>150	40	---	---
Tin	ppm	ASTM D5185(m)	>10	2	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>100	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	---	---
Boron	ppm	ASTM D5185(m)	328	35	---	---
Barium	ppm	ASTM D5185(m)	1	0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		1	---	---
Magnesium	ppm	ASTM D5185(m)	1	3	---	---
Calcium	ppm	ASTM D5185(m)	7	97	---	---
Phosphorus	ppm	ASTM D5185(m)	1145	2603	---	---
Zinc	ppm	ASTM D5185(m)	3	196	---	---
Sulfur	ppm	ASTM D5185(m)	17909	21435	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	101	---	---

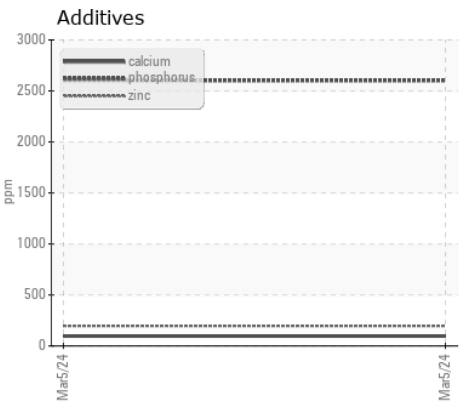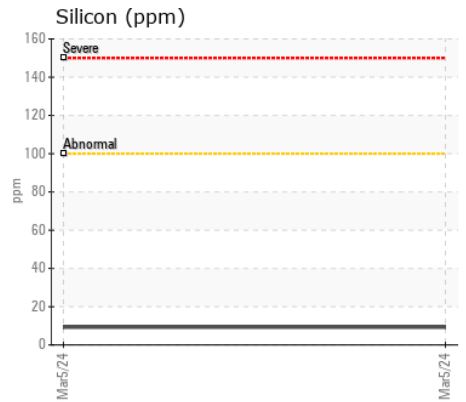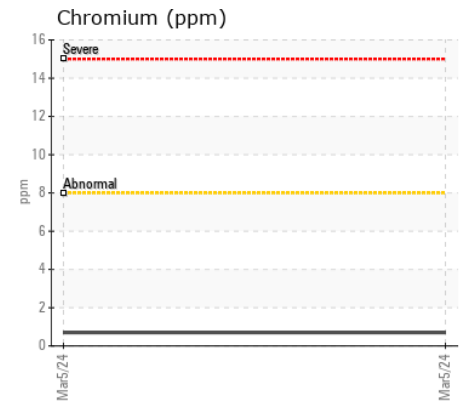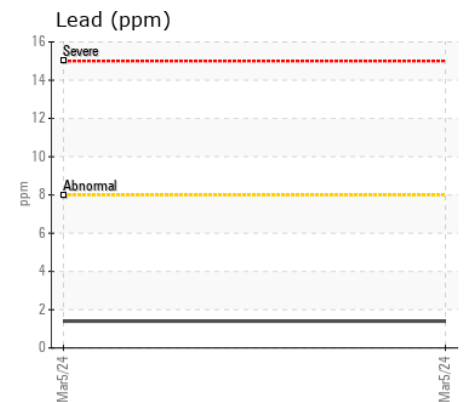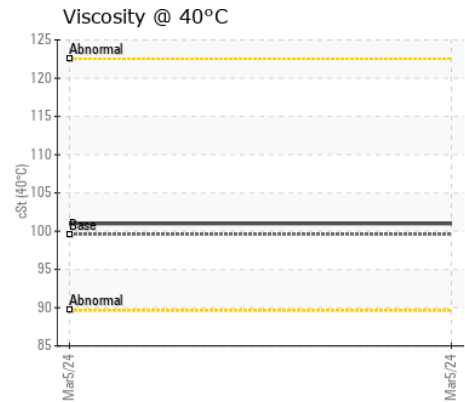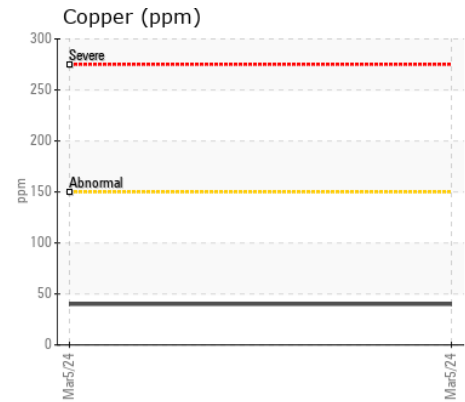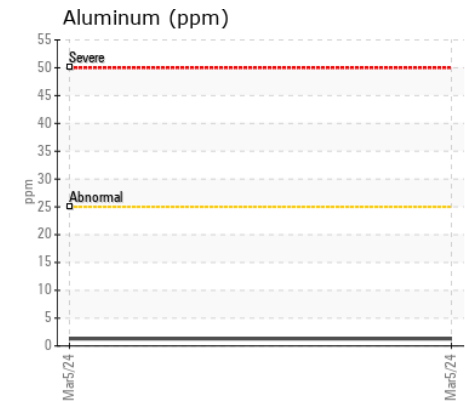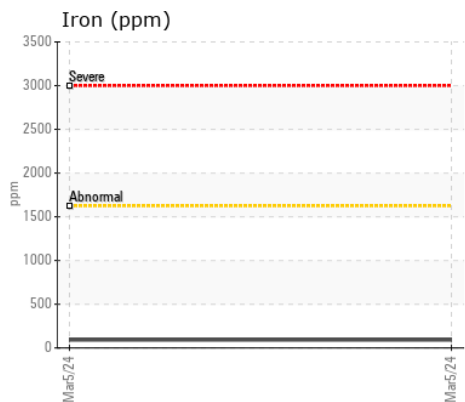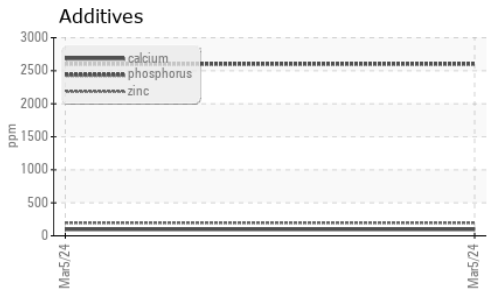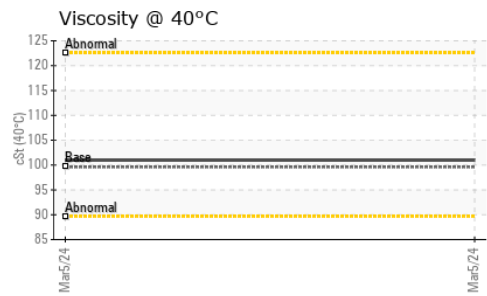

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0270305
Lab Number : 02620664
Unique Number : 5737774
Test Package : MOB 1
Received : 07 Mar 2024
Tested : 07 Mar 2024
Diagnosed : 08 Mar 2024 - Kevin Marson

THOMAS CAVANAGH CONSTRUCTION LTD
 RR # 2, 9094 CAVANAGH ROAD
 ASHTON, ON
 CA K0A 1B0
 Contact: Keith

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T: (613)257-4995
 F: (613)253-0071