



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
NOVA BUS 173
Component
Rear Transmission (Auto)
Fluid
CASTROL TRANSYND (--- LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0889036	WC0866637	WC0816383
Sample Date		Client Info		22 Mar 2024	15 Nov 2023	04 Oct 2023
Machine Age	kms	Client Info		0	0	0
Oil Age	kms	Client Info		36200	27792	17792
Filter Age	kms	Client Info		36200	27792	17792
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

PQ		ASTM D8184*	>105	0	0	---
Iron	ppm	ASTM D5185(m)	>230	74	63	54
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	0	0	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>5	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>65	12	10	8
Lead	ppm	ASTM D5185(m)	>55	2	2	2
Copper	ppm	ASTM D5185(m)	>85	6	6	6
Tin	ppm	ASTM D5185(m)	>5	1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	VLITE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION













There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185(m)	>20	8	8	6
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

Sodium	ppm	ASTM D5185(m)		4	4	4
Boron	ppm	ASTM D5185(m)	150	73	75	75
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	2	1	1
Calcium	ppm	ASTM D5185(m)	40	124	124	123
Phosphorus	ppm	ASTM D5185(m)	320	234	237	235
Zinc	ppm	ASTM D5185(m)	5	5	5	5
Sulfur	ppm	ASTM D5185(m)	1050	1441	1514	1519
Acid Number (AN)	mg KOH/g	ASTM D974*	1.0	1.14	1.39	1.39
Visc @ 40°C	cSt	ASTM D7279(m)	38.9	33.4	33.3	33.5
Visc @ 100°C	cSt	ASTM D7279(m)	7.3	6.5	6.6	6.6
Viscosity Index (VI)	Scale	ASTM D2270*	168	152	158	156

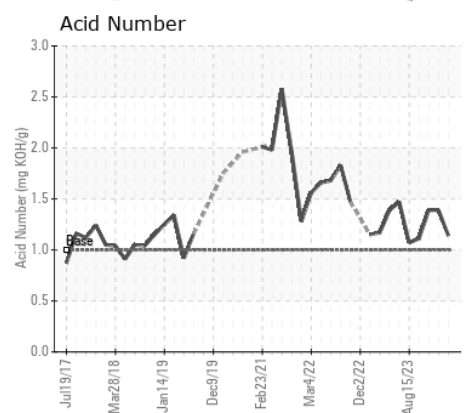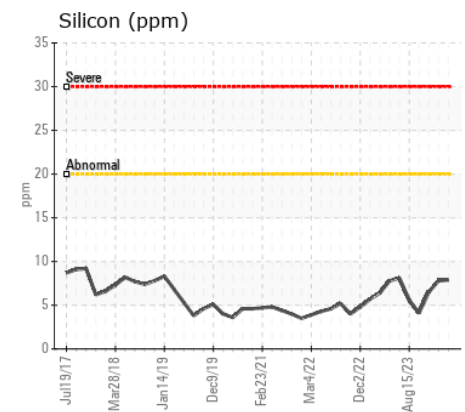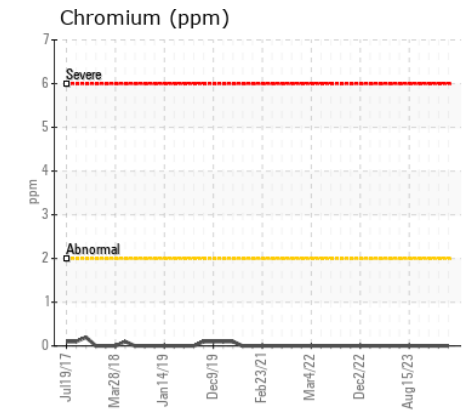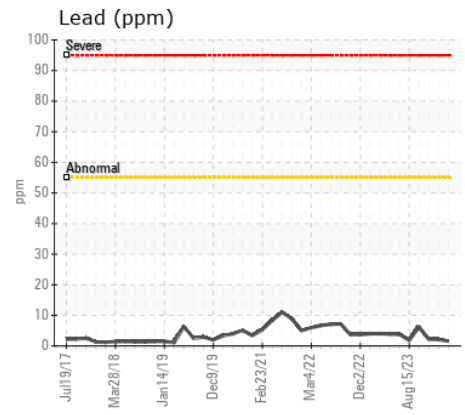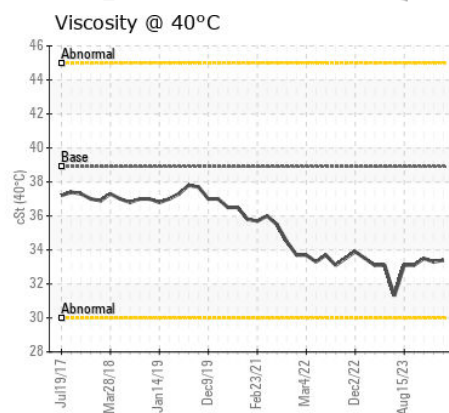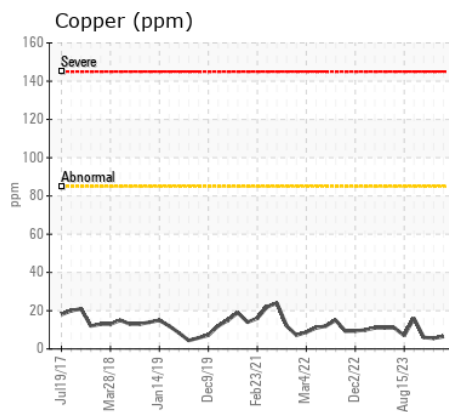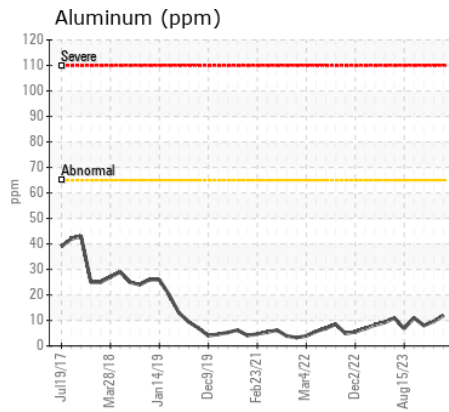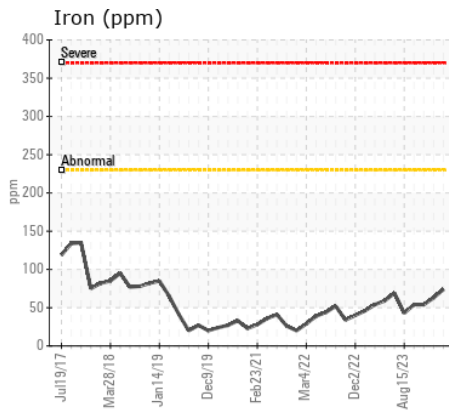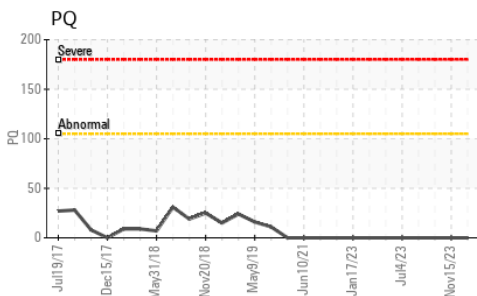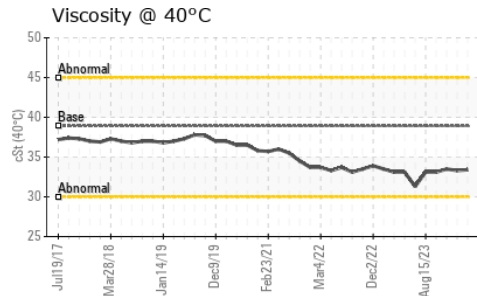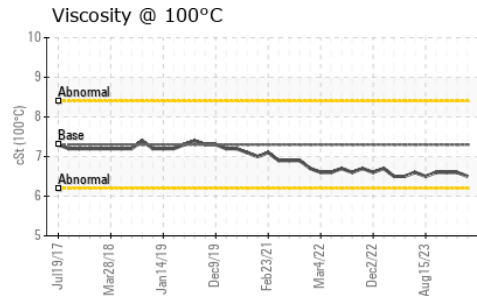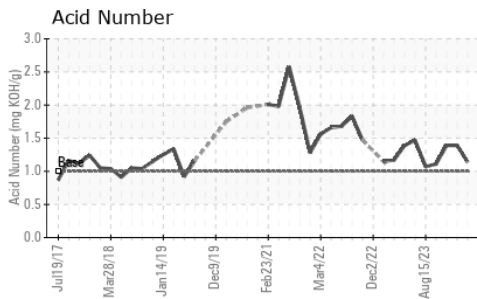

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0889036
Lab Number : 02625003
Unique Number : 5750122
Test Package : MOB 2 (Additional Tests: KV100, PQ, VI)

Received : 27 Mar 2024
Tested : 28 Mar 2024
Diagnosed : 28 Mar 2024 - Wes Davis

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.