



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
51000 series
Machine Id
Navistar 51862
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (40 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0893688	WC0857721	WC0828199
Sample Date		Client Info		09 Feb 2024	21 Nov 2023	03 Aug 2023
Machine Age	mls	Client Info		720603	694226	642856
Oil Age	mls	Client Info		26377	25776	27370
Filter Age	mls	Client Info		26377	25776	27370
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	17	16	22
Chromium	ppm	ASTM D5185(m)	>20	2	2	2
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	2	2	2
Lead	ppm	ASTM D5185(m)	>40	0	<1	<1
Copper	ppm	ASTM D5185(m)	>330	2	3	9
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	6	5	8
Potassium	ppm	ASTM D5185(m)	>20	<1	1	1
Fuel		WC Method	>2.0	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.4	0.4	0.4
Nitration	Abs/cm	ASTM D7624*	>20	8.7	8.3	8.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.7	19.3	20.1
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	2	3
Boron	ppm	ASTM D5185(m)	2	1	3	1
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	50	61	61	60
Manganese	ppm	ASTM D5185(m)	0	0	0	<1
Magnesium	ppm	ASTM D5185(m)	950	1011	992	991
Calcium	ppm	ASTM D5185(m)	1050	1098	1106	1107
Phosphorus	ppm	ASTM D5185(m)	995	1001	1010	1070
Zinc	ppm	ASTM D5185(m)	1180	1201	1202	1224
Sulfur	ppm	ASTM D5185(m)	2600	2424	2623	2455
Oxidation	Abs/.1mm	ASTM D7414*	>25	15.9	15.5	14.6
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.6	11.3	11.4

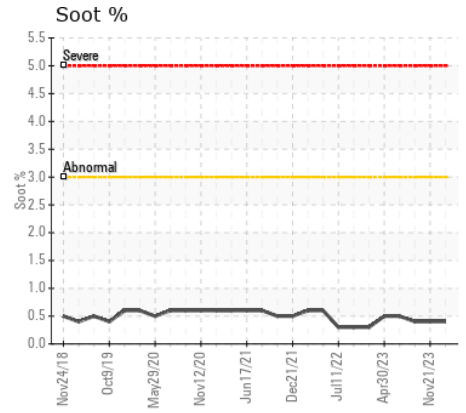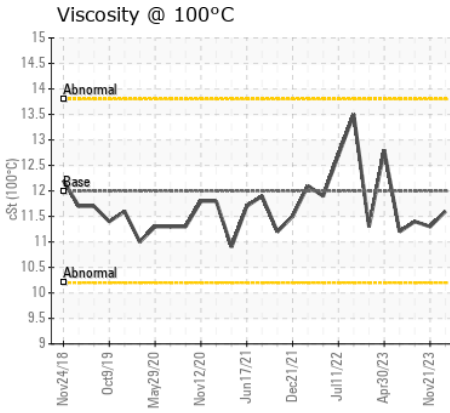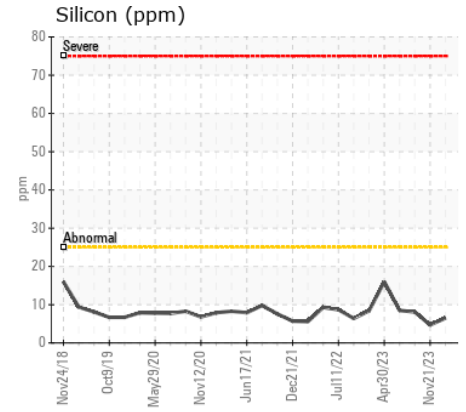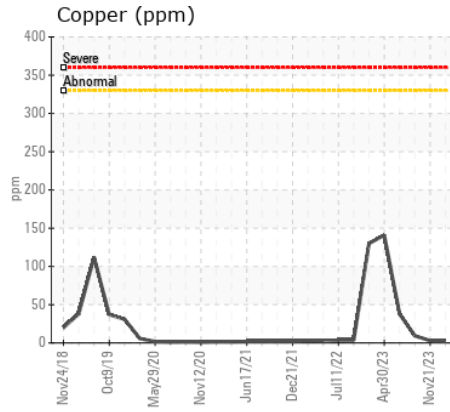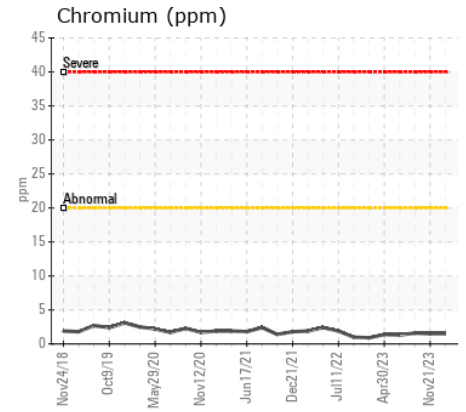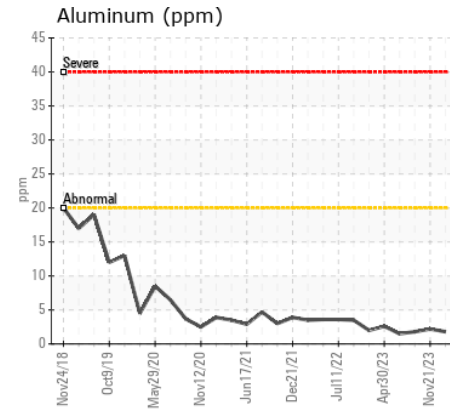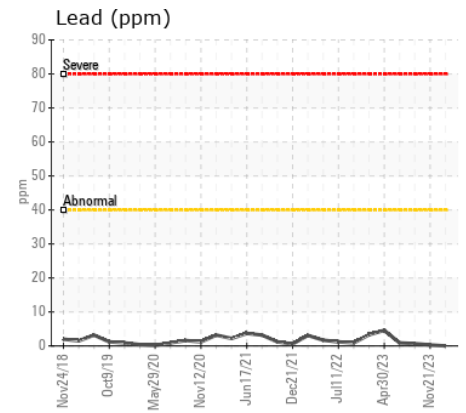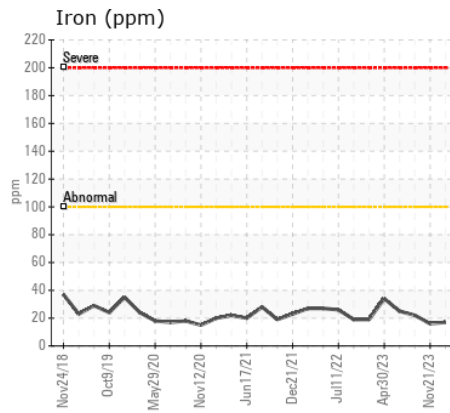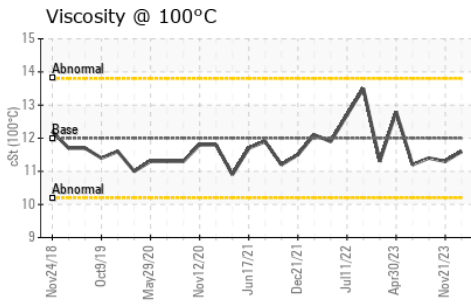

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0893688
Lab Number : 02625563
Unique Number : 5750682
Test Package : MOB 1
Received : 01 Apr 2024
Tested : 01 Apr 2024
Diagnosed : 01 Apr 2024 - Wes Davis

MANITOU LIN TRANSPORT
 161 MAIN STREET
 THUNDER BAY, ON
 CA P7B 6S5
 Contact: Ivan Brady
 ibrady@manitoulintransport.com
 T: (807)345-6501
 F: (807)345-6731

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.