

Area
(L913894)
Machine Id
429132
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (39 LTR)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0081639	---	---
Sample Date		Client Info		02 Apr 2024	---	---
Machine Age	hrs	Client Info		11491	---	---
Oil Age	hrs	Client Info		600	---	---
Filter Age	hrs	Client Info		600	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>100	38	---	---
Chromium	ppm	ASTM D5185(m)	>20	1	---	---
Nickel	ppm	ASTM D5185(m)	>4	<1	---	---
Titanium	ppm	ASTM D5185(m)		<1	---	---
Silver	ppm	ASTM D5185(m)	>3	0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	17	---	---
Lead	ppm	ASTM D5185(m)	>40	0	---	---
Copper	ppm	ASTM D5185(m)	>330	3	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	VLITE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>25	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	21	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol	%	ASTM D7922*		0.0	---	---
Soot %	%	ASTM D7844*	>3	0.2	---	---
Nitration	Abs/cm	ASTM D7624*	>20	9.9	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.8	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		31	---	---
Boron	ppm	ASTM D5185(m)	2	2	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	50	63	---	---
Manganese	ppm	ASTM D5185(m)	0	0	---	---
Magnesium	ppm	ASTM D5185(m)	950	1004	---	---
Calcium	ppm	ASTM D5185(m)	1050	1114	---	---
Phosphorus	ppm	ASTM D5185(m)	995	1005	---	---
Zinc	ppm	ASTM D5185(m)	1180	1234	---	---
Sulfur	ppm	ASTM D5185(m)	2600	2402	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	17.4	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.7	---	---

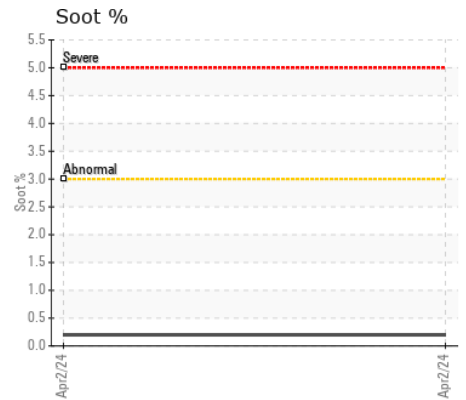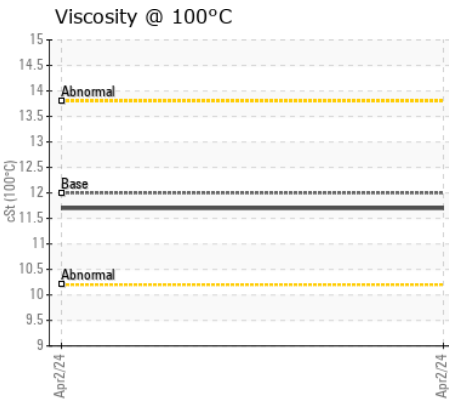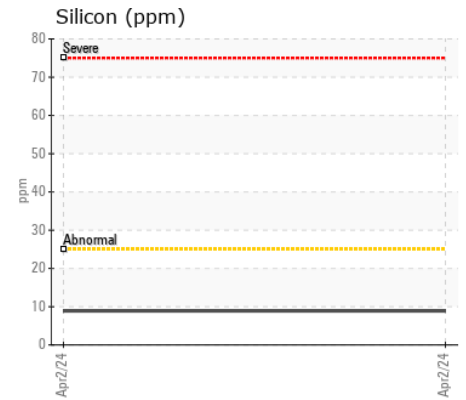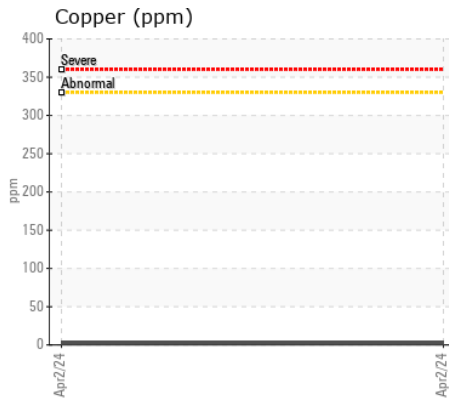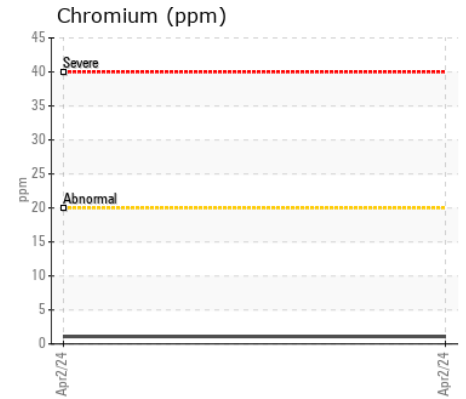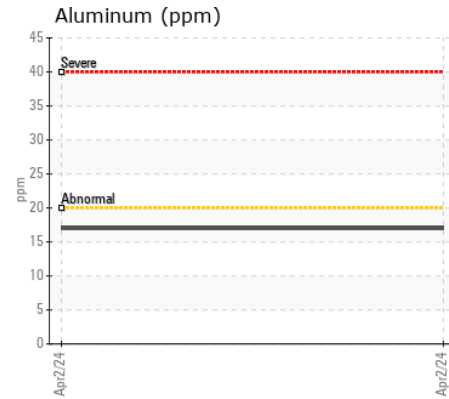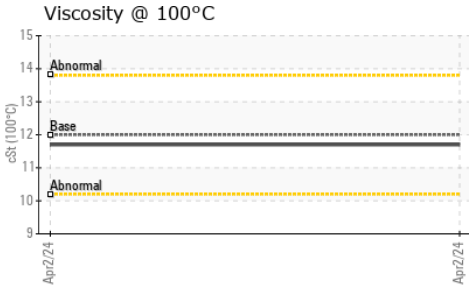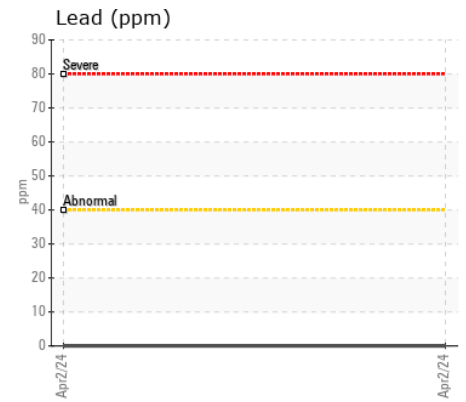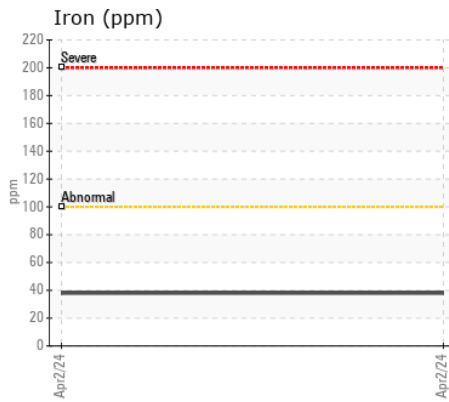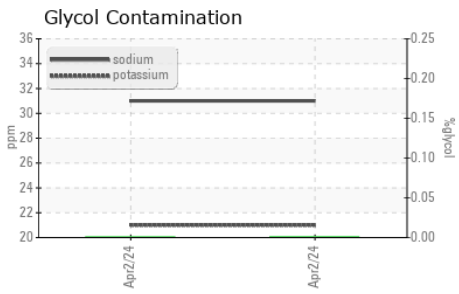

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0081639 **Received** : 03 Apr 2024
Lab Number : 02626412 **Tested** : 03 Apr 2024
Unique Number : 5759544 **Diagnosed** : 03 Apr 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: Glycol, Visual)

GFL Environmental - 774
 169 Route 117
 Mont-Tremblant, QC
 CA J8E 1A1
 Contact: Stephane Filteau
 sfilteau@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: