



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
24016

Component
Splitter Box

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (4 LTR)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0276282	LH0104267	LH0216223
Sample Date		Client Info		08 Apr 2024	10 Oct 2023	21 Apr 2023
Machine Age	hrs	Client Info		21501	20995	20510
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>880	78	19	15
Chromium	ppm	ASTM D5185(m)	>10	1	<1	<1
Nickel	ppm	ASTM D5185(m)	>5	0	<1	0
Titanium	ppm	ASTM D5185(m)	>5	0	0	0
Silver	ppm	ASTM D5185(m)	>5	0	<1	0
Aluminum	ppm	ASTM D5185(m)	>15	2	<1	<1
Lead	ppm	ASTM D5185(m)	>25	0	0	2
Copper	ppm	ASTM D5185(m)	>60	9	2	4
Tin	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	VLITE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>55	6	5	4
Potassium	ppm	ASTM D5185(m)	>20	4	<1	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	3	1	<1
Boron	ppm	ASTM D5185(m)	328	96	33	242
Barium	ppm	ASTM D5185(m)	1	<1	<1	0
Molybdenum	ppm	ASTM D5185(m)		0	0	<1
Manganese	ppm	ASTM D5185(m)		<1	0	0
Magnesium	ppm	ASTM D5185(m)	1	10	7	9
Calcium	ppm	ASTM D5185(m)	7	51	37	47
Phosphorus	ppm	ASTM D5185(m)	1145	2239	1924	1151
Zinc	ppm	ASTM D5185(m)	3	174	138	141
Sulfur	ppm	ASTM D5185(m)	17909	15711	20979	16202
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	79.7	130	80.4

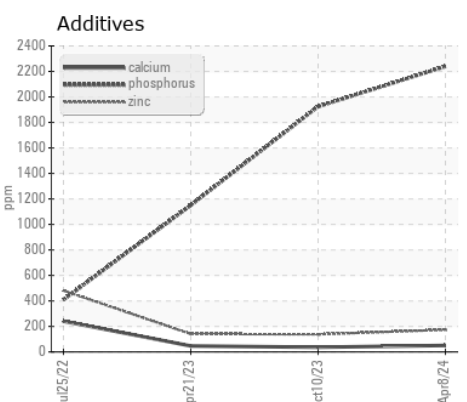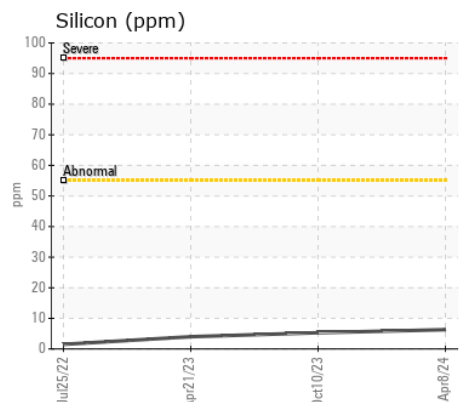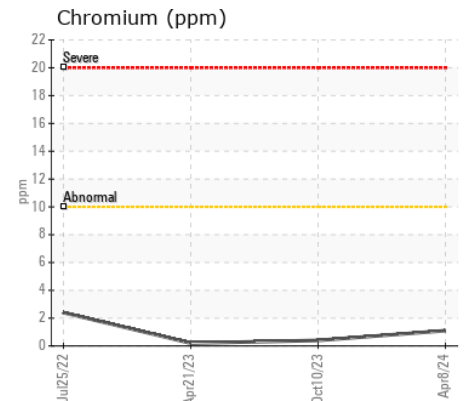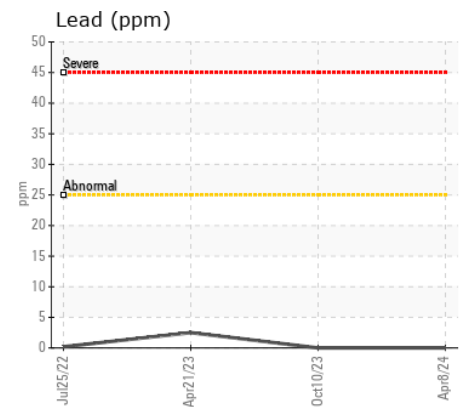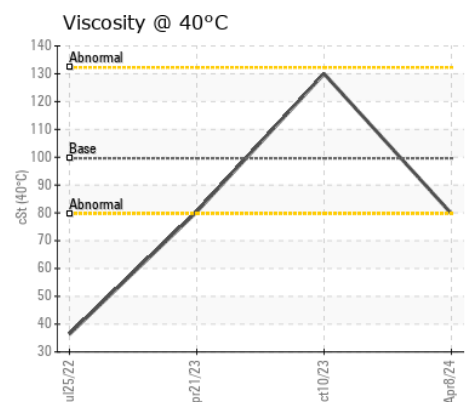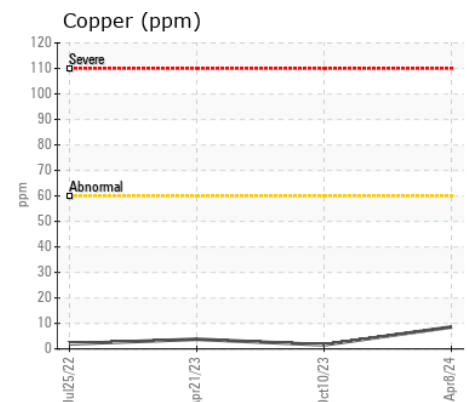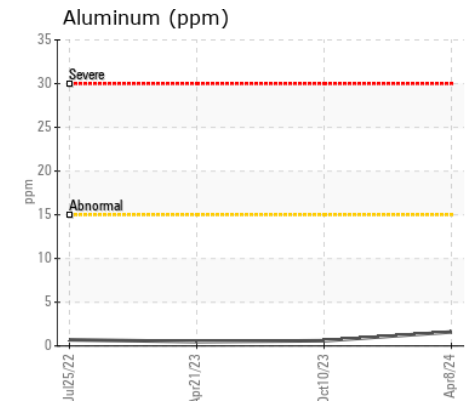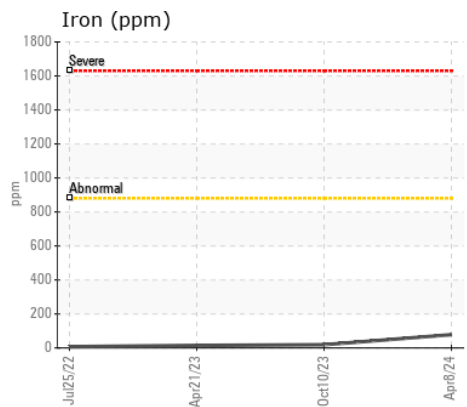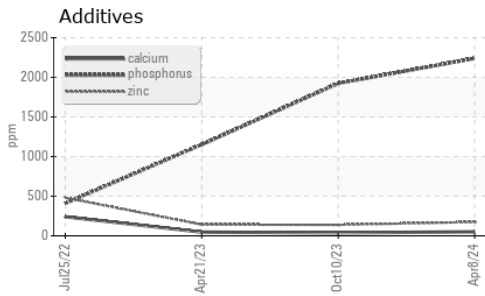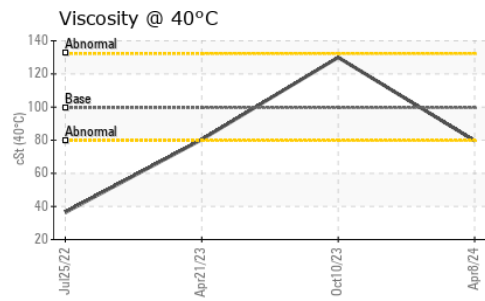

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0276282
Lab Number : 02627939
Unique Number : 5761071
Test Package : MOB 1
Received : 10 Apr 2024
Tested : 10 Apr 2024
Diagnosed : 10 Apr 2024 - Wes Davis

American Iron and Metal
 75 Steel City Court
 Hamilton, ON
 CA L8H 3Y2
 Contact: Heavy Equipment
 hamiltonmobileassetmaintenance@aim-recycling.com
 T: (905)547-5533
 F: (905)544-5671

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.