



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
239
 Component
Diesel Engine
 Fluid
ESSO XD-3 EXTRA 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0888991	WC0889129	WC0889102
Sample Date		Client Info		15 Apr 2024	15 Feb 2024	03 Jan 2024
Machine Age	kms	Client Info		0	0	0
Oil Age	kms	Client Info		8310	9212	8989
Filter Age	kms	Client Info		8310	9212	8989
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>90	6	5	6
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	<1	0	<1
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	1	2	1
Lead	ppm	ASTM D5185(m)	>40	0	<1	0
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	2	2	2
Potassium	ppm	ASTM D5185(m)	>20	6	6	3
Fuel		WC Method	>3.0	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>6	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	8.3	8.7	8.6
Sulfation	Abs/.1mm	ASTM D7415*	>30	21.8	22.6	22.5
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	2	2	2
Boron	ppm	ASTM D5185(m)		118	107	116
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	1	<1
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		15	20	14
Calcium	ppm	ASTM D5185(m)	3780	2211	2164	2203
Phosphorus	ppm	ASTM D5185(m)	1370	947	935	984
Zinc	ppm	ASTM D5185(m)	1500	1154	1118	1146
Sulfur	ppm	ASTM D5185(m)	3800	2809	2940	3014
Oxidation	Abs/.1mm	ASTM D7414*	>25	18.4	19.5	19.2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.1	13.9	14.1

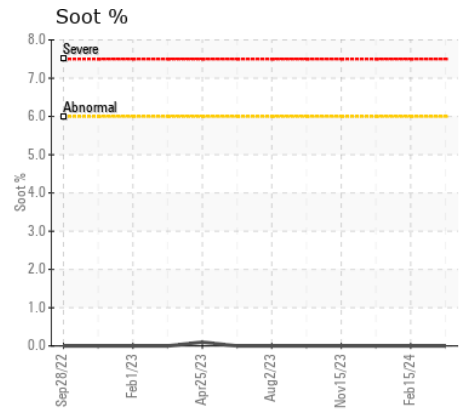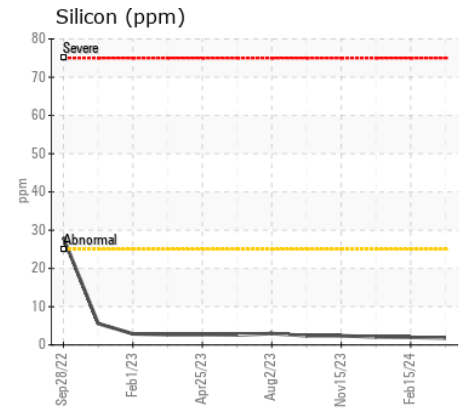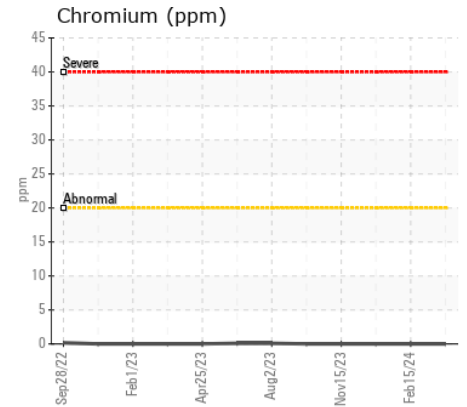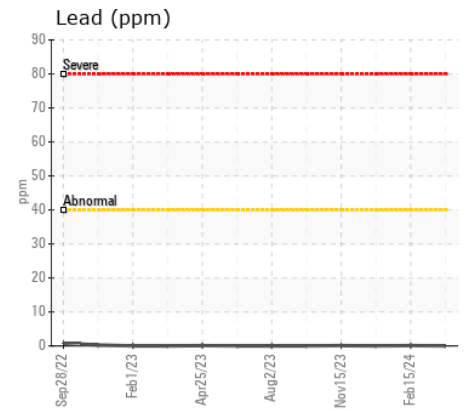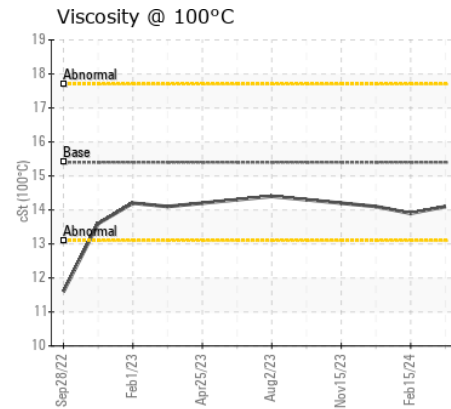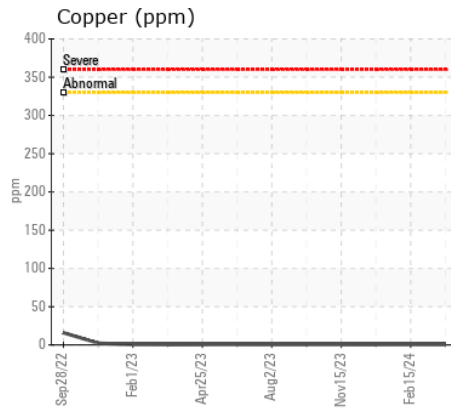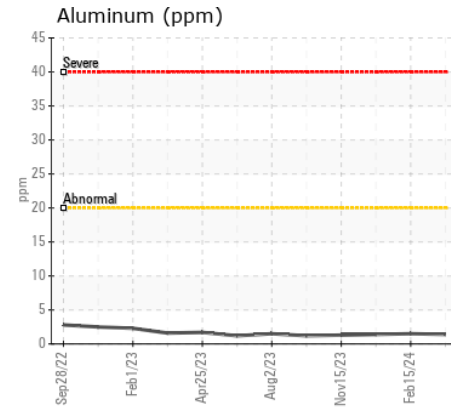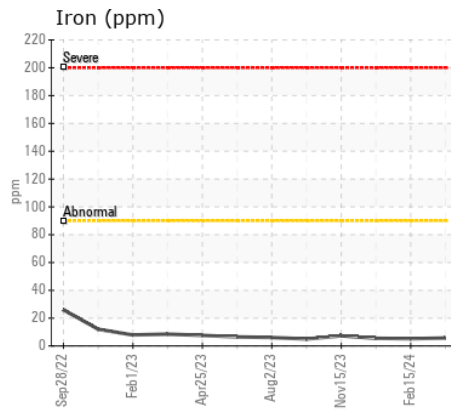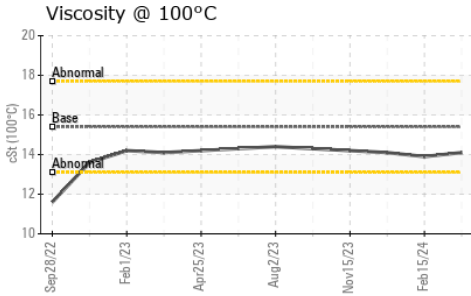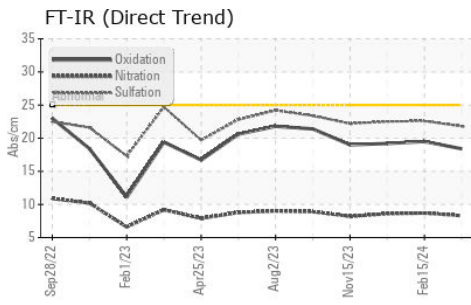

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0888991 **Received** : 22 Apr 2024
Lab Number : 02630519 **Tested** : 22 Apr 2024
Unique Number : 5763651 **Diagnosed** : 22 Apr 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: Visual)

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.