



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
1257
 Component
Rear Diesel Engine
 Fluid
PETRO CANADA DURON HP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0925675	WC0905416	WC0895798
Sample Date		Client Info		16 Apr 2024	22 Feb 2024	10 Jan 2024
Machine Age	kms	Client Info		45470	44934	44465
Oil Age	kms	Client Info		531	474	515
Filter Age	kms	Client Info		531	474	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>100	12	10	11
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	2	2	2
Lead	ppm	ASTM D5185(m)	>40	0	<1	0
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	2	3	3
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	9.1	8.8	9.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	22.3	21.6	23.5
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	2	1
Boron	ppm	ASTM D5185(m)	0	2	1	2
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	60	57	56	57
Manganese	ppm	ASTM D5185(m)	0	0	0	0
Magnesium	ppm	ASTM D5185(m)	1010	956	927	946
Calcium	ppm	ASTM D5185(m)	1070	1038	1131	1029
Phosphorus	ppm	ASTM D5185(m)	1150	968	981	982
Zinc	ppm	ASTM D5185(m)	1270	1169	1161	1146
Sulfur	ppm	ASTM D5185(m)	2060	2449	2791	2605
Oxidation	Abs/.1mm	ASTM D7414*	>25	21.7	19.7	23.9
Visc @ 100°C	cSt	ASTM D7279(m)	15.6	13.3	13.6	13.4

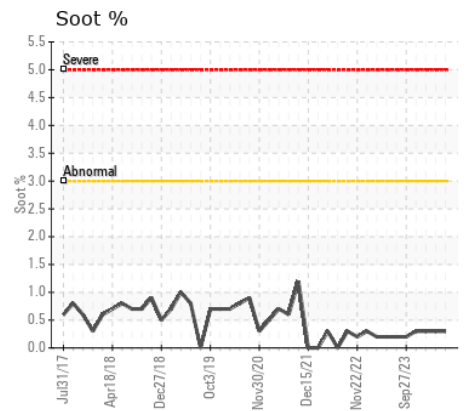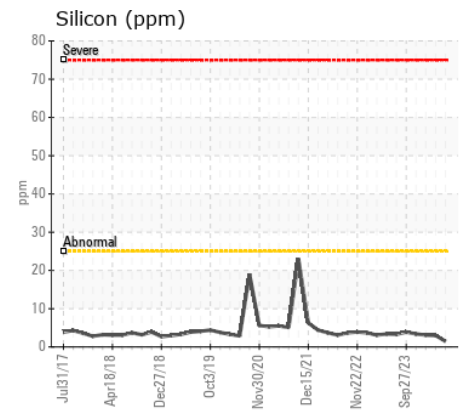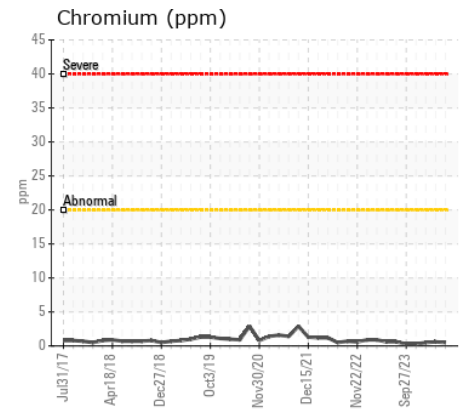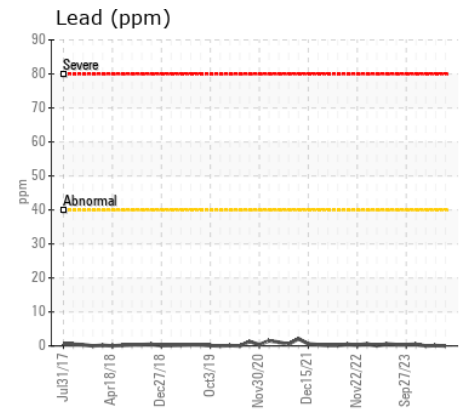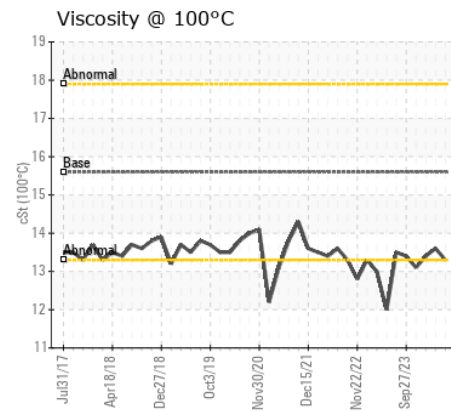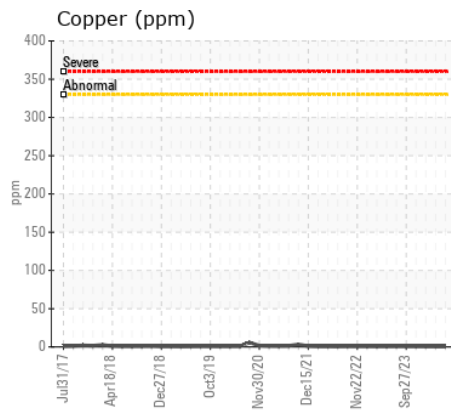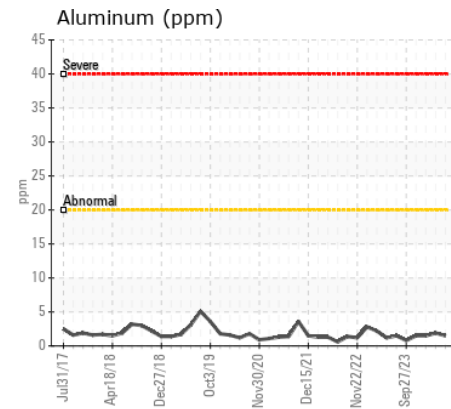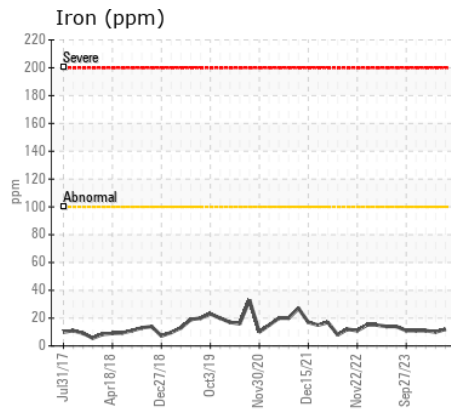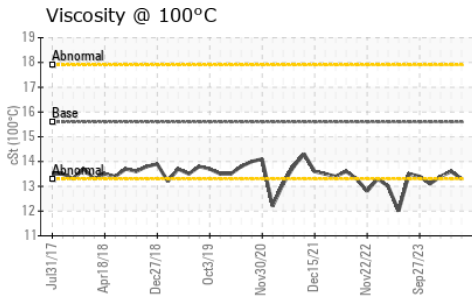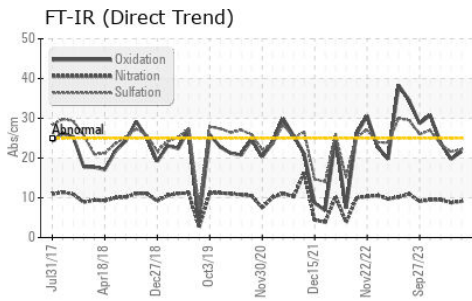

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0925675 **Received** : 25 Apr 2024
Lab Number : 02631290 **Tested** : 25 Apr 2024
Unique Number : 5772443 **Diagnosed** : 25 Apr 2024 - Wes Davis
Test Package : MOB 1

KINGSTON TRANSIT
 1181 JOHN COUNTER BLVD
 KINGSTON, ON
 CA K7K 6C7
 Contact: Brent Gunter
 bgunter@cityofkingston.ca
 T: (613)546-4291
 F: (613)542-1504

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.