



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area

[DIETRICH]

Machine Id

JOHN DEERE 9460RT NOUNITWC0824300

Component

Diesel Engine

Fluid

PETRO CANADA DURON SHP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0824300	---	---
Sample Date		Client Info		01 May 2024	---	---
Machine Age	hrs	Client Info		39	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>51	5	---	---
Chromium	ppm	ASTM D5185(m)	>11	0	---	---
Nickel	ppm	ASTM D5185(m)	>5	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>3	0	---	---
Aluminum	ppm	ASTM D5185(m)	>31	2	---	---
Lead	ppm	ASTM D5185(m)	>26	<1	---	---
Copper	ppm	ASTM D5185(m)	>26	2	---	---
Tin	ppm	ASTM D5185(m)	>4	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>22	4	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Fuel		WC Method	>2.1	<1.0	---	---
Water		WC Method	>0.21	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>3	0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	5.1	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	18.0	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	VLITE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.21	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>31	2	---	---
Boron	ppm	ASTM D5185(m)	0	1	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	60	58	---	---
Manganese	ppm	ASTM D5185(m)	0	0	---	---
Magnesium	ppm	ASTM D5185(m)	1010	954	---	---
Calcium	ppm	ASTM D5185(m)	1070	1016	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	986	---	---
Zinc	ppm	ASTM D5185(m)	1270	1151	---	---
Sulfur	ppm	ASTM D5185(m)	2060	2533	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	12.9	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.2	---	---

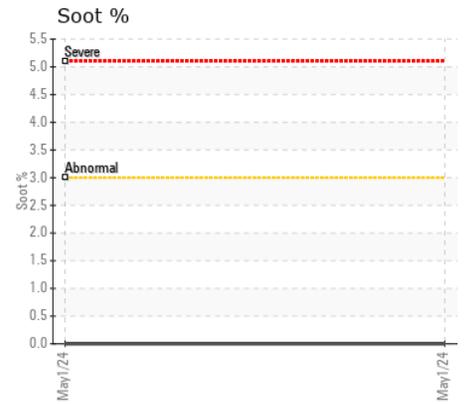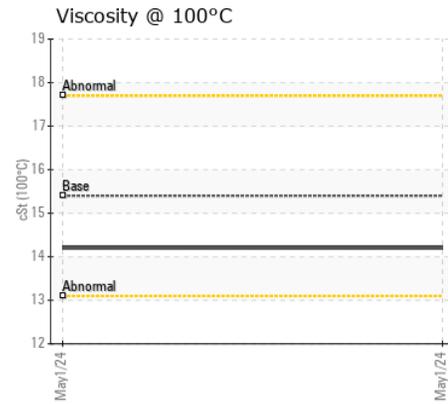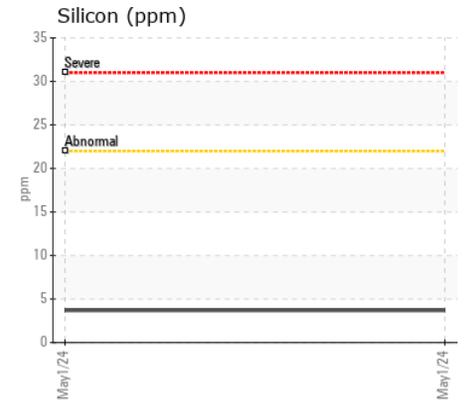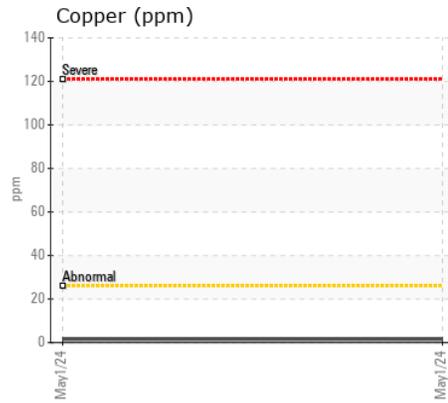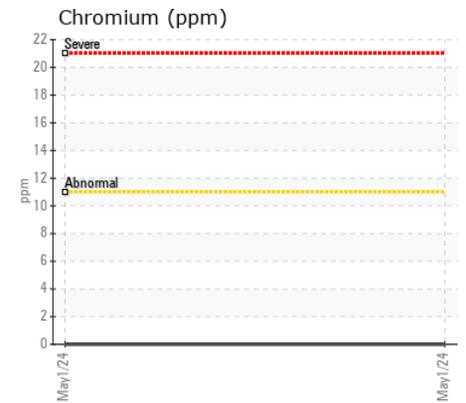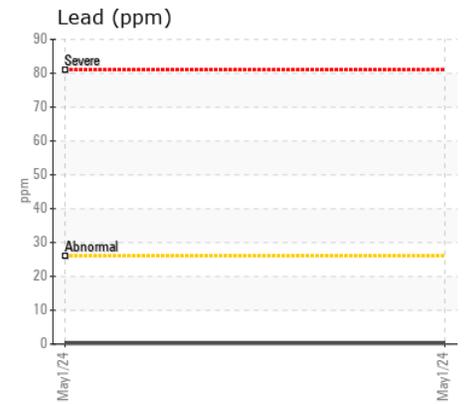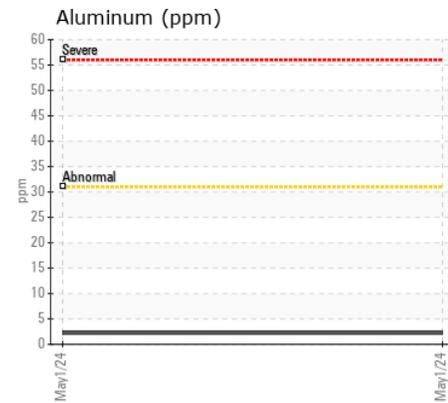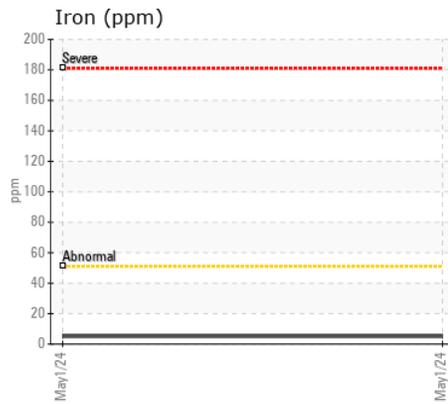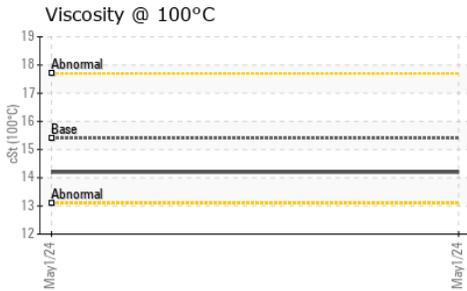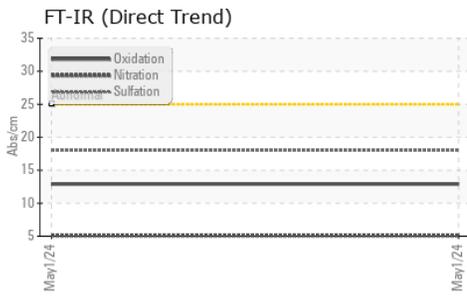

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0824300 **Received** : 02 May 2024
Lab Number : 02632667 **Tested** : 02 May 2024
Unique Number : 5773820 **Diagnosed** : 02 May 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: Visual)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

PROMECHANICAL
 33422 ROMAN LINE, RR # 3
 LUCAN, ON
 CA N0M 2J0
 Contact: Jody Regier
 promechanical@hotmail.com
 T: (519)227-0077
 F: (519)227-0786