



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**(366409)**

Machine Id  
**LIEBHERR R945 053994-1866**

Component  
**Splitter Box**

Fluid  
**PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0289722</b>	LH0285029	LH0237706
Sample Date		Client Info		<b>02 May 2024</b>	08 Feb 2024	11 Aug 2023
Machine Age	hrs	Client Info		<b>4540</b>	4053	3069
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>7</b>	16	16
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>2</b>	2	2
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	1	1
Lead	ppm	ASTM D5185(m)	>30	<b>0</b>	<1	0
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>30	<b>3</b>	4	4
Potassium	ppm	ASTM D5185(m)	>20	<b>6</b>	<1	1
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	<b>3</b>	<1	2
Boron	ppm	ASTM D5185(m)	328	<b>196</b>	47	264
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>3</b>	2	2
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>67</b>	38	26
Calcium	ppm	ASTM D5185(m)	7	<b>172</b>	160	123
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1541</b>	2007	1403
Zinc	ppm	ASTM D5185(m)	3	<b>153</b>	111	103
Sulfur	ppm	ASTM D5185(m)	17909	<b>19946</b>	22203	19458
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>101</b>	144	96.2

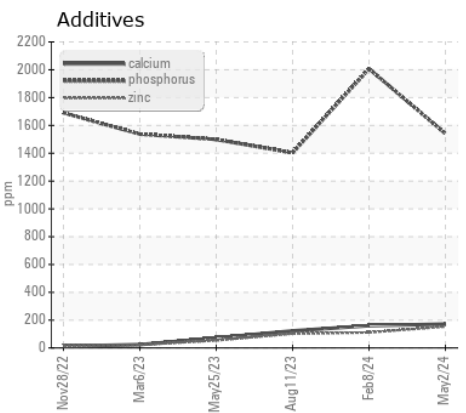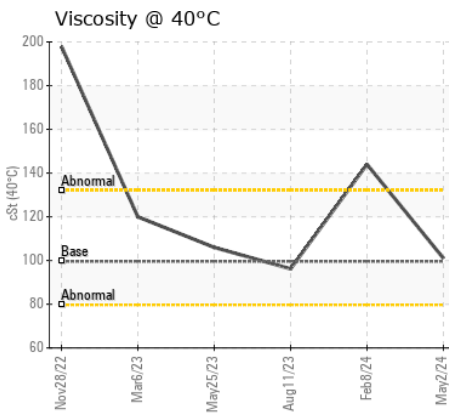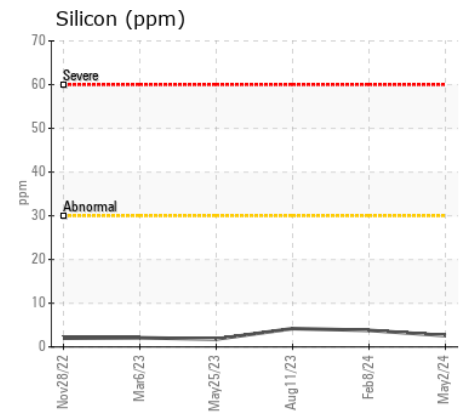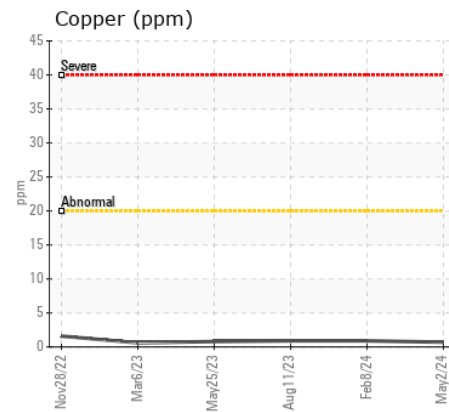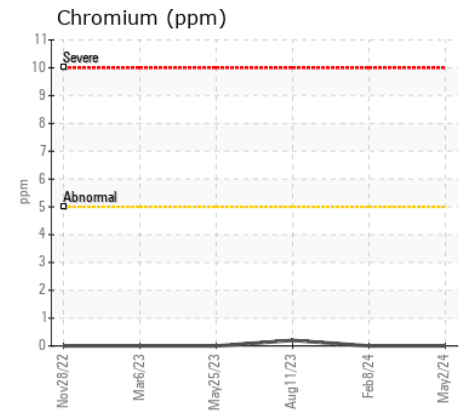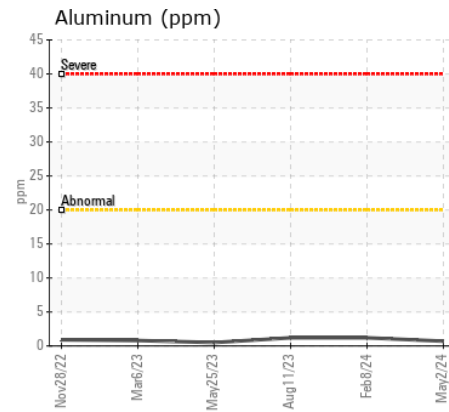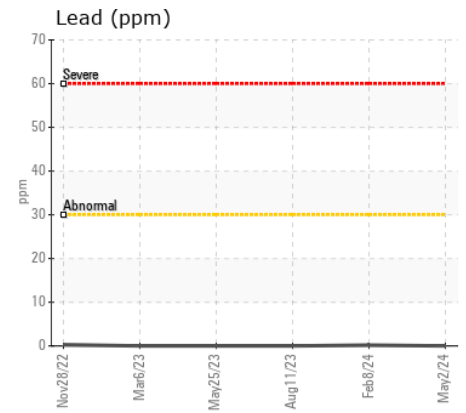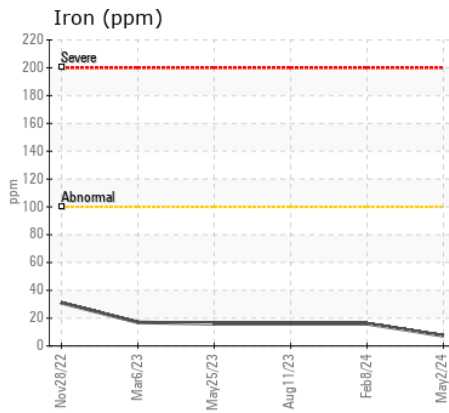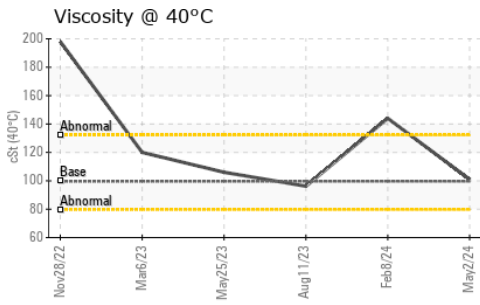

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0289722  
**Lab Number** : 02633604  
**Unique Number** : 5774757  
**Test Package** : MOB 1  
**Received** : 06 May 2024  
**Tested** : 06 May 2024  
**Diagnosed** : 06 May 2024 - Wes Davis

**THOMAS CAVANAGH CONSTRUCTION LTD**  
 RR # 2, 9094 CAVANAGH ROAD  
 ASHTON, ON  
 CA K0A 1B0  
 Contact: Keith

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T: (613)257-4995  
 F: (613)253-0071