



Machine Id
911041
Component
Diesel Fuel
Fluid
No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)

RECOMMENDATION

Veillez communiquer avec un représentant GFL Environmental au sujet de l'achat d'une trousse d'échantillonnage appropriée à vos besoins.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0120768	---	---
Sample Date		Client Info		30 Apr 2024	---	---
Machine Age	kms	Client Info		153172	---	---
Sample Status				NORMAL	---	---

CORROSION

{sans objet}

Iron	ppm	ASTM D5185(m)	>2	0	---	---
Chromium	ppm	ASTM D5185(m)	>2	0	---	---
Nickel	ppm	ASTM D5185(m)	>2	0	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	0	---	---
Aluminum	ppm	ASTM D5185(m)	>2	0	---	---
Lead	ppm	ASTM D5185(m)	>2	0	---	---
Copper	ppm	ASTM D5185(m)	>2	0	---	---
Tin	ppm	ASTM D5185(m)	>2	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINANTS

Il n'y a aucune indication de contamination dans le composant (non confirmée).


Silicon	ppm	ASTM D5185(m)	>10	0	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	NEG	---	---

FUEL CONDITION


La quantité de l'échantillonnage du fuel ne suffisait pas à déterminer sa condition et/ou sa classification.

Sodium	ppm	ASTM D5185(m)	>5	<1	---	---
Boron	ppm	ASTM D5185(m)	2	<1	---	---
Barium	ppm	ASTM D5185(m)	2	0	---	---
Molybdenum	ppm	ASTM D5185(m)	2	0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	2	0	---	---
Calcium	ppm	ASTM D5185(m)	2	0	---	---
Phosphorus	ppm	ASTM D5185(m)	2	0	---	---
Zinc	ppm	ASTM D5185(m)	2	0	---	---
Sulfur	ppm	ASTM D5185(m)	10	5	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	3.0	2.5	---	---

Viscosity @ 40°C

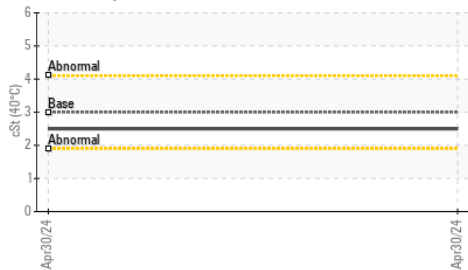

Pensky-Martens Flash Point (°C)

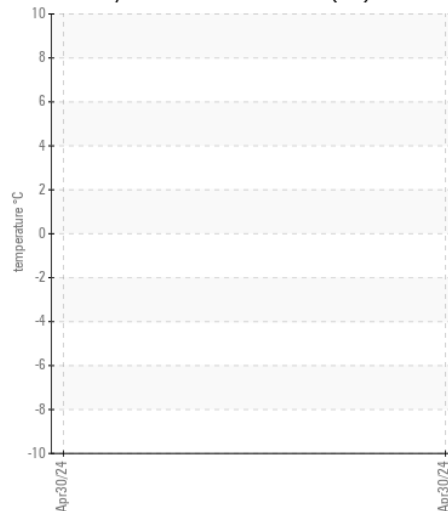

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 747 - GMA - Solid Waste**
Sample No. : GFL0120768 **Received** : 07 May 2024 4 Chemin du Tremblay,
Lab Number : 02633972 **Tested** : 07 May 2024 Boucherville, QC
Unique Number : 5775125 **Diagnosed** : 07 May 2024 - Kevin Marson CA J4B 6Z5
Test Package : MOB 1 **Contact:** Steve Voyer
svoyer@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.