



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
ALLISON 225
Component
Transmission (Auto)
Fluid
CASTROL TRANSYND (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0888974	WC0889046	WC0889156
Sample Date		Client Info		09 May 2024	13 Mar 2024	29 Jan 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		47542	38516	29072
Filter Age	hrs	Client Info		47542	38516	29072
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

PQ		ASTM D8184*	>105	0	---	0
Iron	ppm	ASTM D5185(m)	>230	33	31	24
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	0	0	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>5	0	0	0
Aluminum	ppm	ASTM D5185(m)	>65	6	6	4
Lead	ppm	ASTM D5185(m)	>55	0	<1	<1
Copper	ppm	ASTM D5185(m)	>85	4	4	3
Tin	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	VLITE	NONE	NONE

CONTAMINATION













There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185(m)	>20	5	5	4
Potassium	ppm	ASTM D5185(m)	>20	<1	1	1
Water		WC Method	>0.1	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

Sodium	ppm	ASTM D5185(m)		3	3	2
Boron	ppm	ASTM D5185(m)	150	71	70	70
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	1	<1	<1
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	1	<1	<1
Calcium	ppm	ASTM D5185(m)	40	129	125	122
Phosphorus	ppm	ASTM D5185(m)	320	228	235	224
Zinc	ppm	ASTM D5185(m)	5	4	3	3
Sulfur	ppm	ASTM D5185(m)	1050	1494	1577	1554
Acid Number (AN)	mg KOH/g	ASTM D974*	1.0	0.94	1.20	0.89
Visc @ 40°C	cSt	ASTM D7279(m)	38.9	32.6	32.7	32.7
Visc @ 100°C	cSt	ASTM D7279(m)	7.3	6.4	6.5	6.5
Viscosity Index (VI)	Scale	ASTM D2270*	168	152	157	157

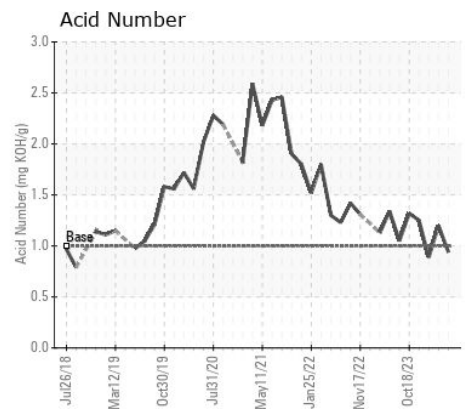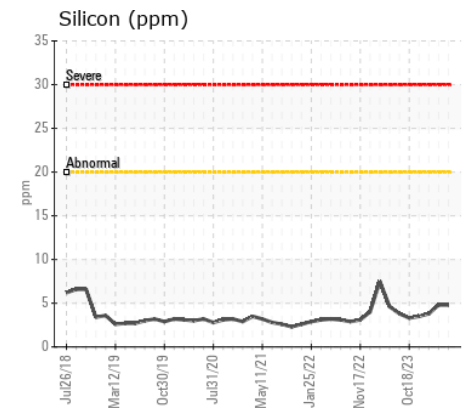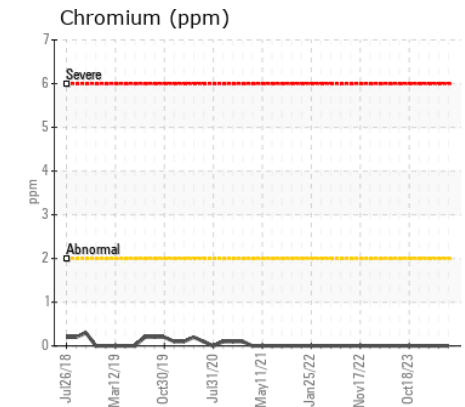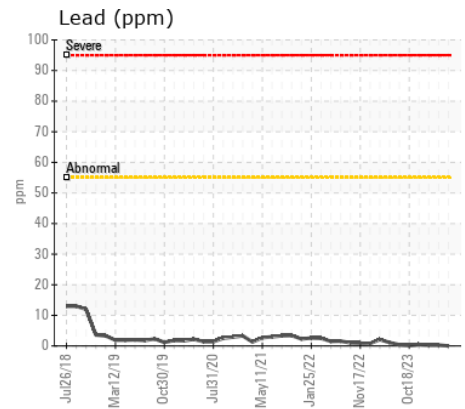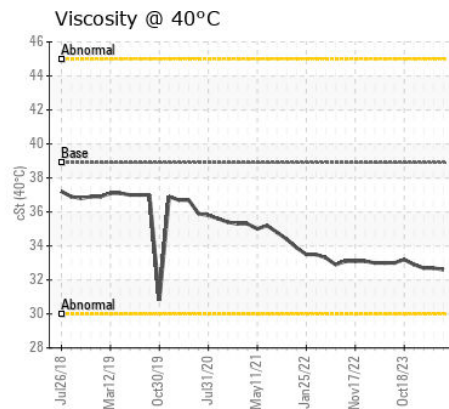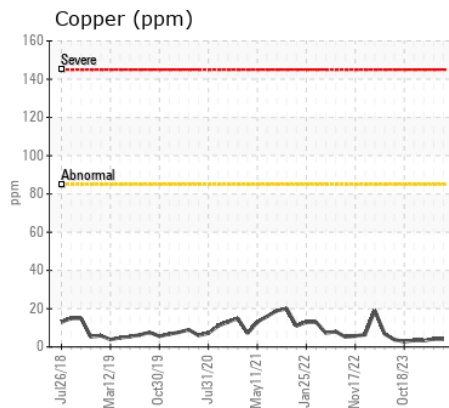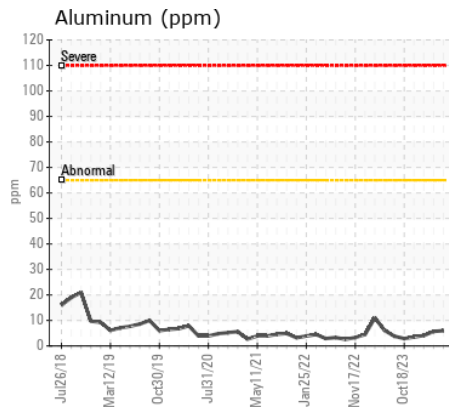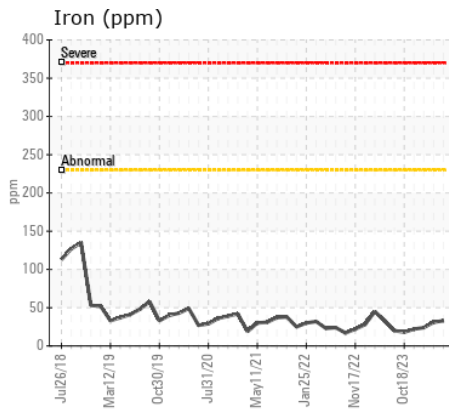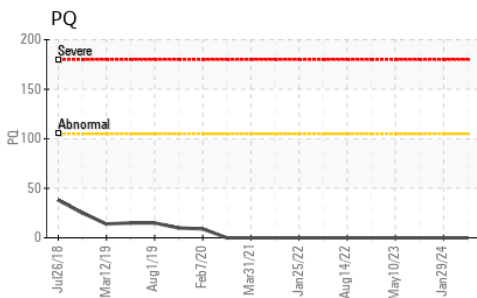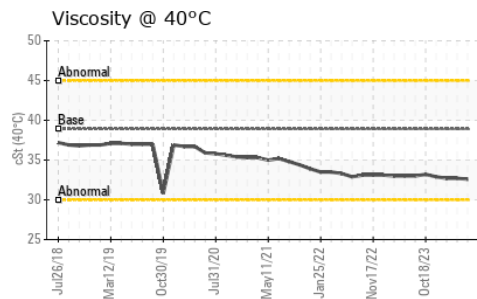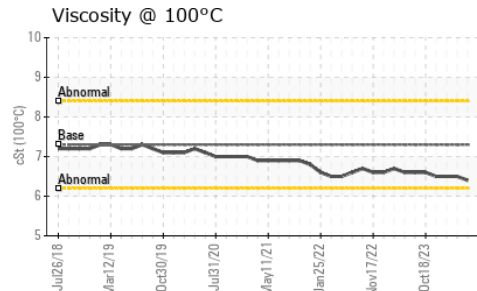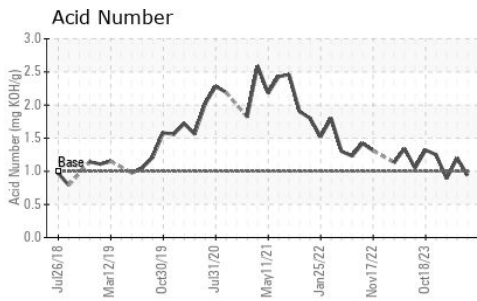

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0888974
Lab Number : 02634994
Unique Number : 5776147
Test Package : MOB 2 (Additional Tests: KV100, PQ, VI)

Received : 13 May 2024
Tested : 14 May 2024
Diagnosed : 14 May 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237