



Machine Id  
**927066**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (--- LTR)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0113264</b>	GFL0113275	GFL0097538
Sample Date		Client Info		<b>07 May 2024</b>	29 Feb 2024	22 Dec 2023
Machine Age	hrs	Client Info		<b>296890</b>	0	19431
Oil Age	hrs	Client Info		<b>296890</b>	0	575
Filter Age	hrs	Client Info		<b>296890</b>	0	575
Oil Changed		Client Info		<b>Changed</b>	N/A	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>120	<b>7</b>	9	6
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>2</b>	4	3
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<b>1</b>	2	<1
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0

### CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>3</b>	6	3
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	2
Fuel		WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>4	<b>0.1</b>	0.1	0.1
Nitration	Abs/cm	ASTM D7624*	>20	<b>8.7</b>	8.5	8.6
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>20.9</b>	20.2	20.2
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>3</b>	2	3
Boron	ppm	ASTM D5185(m)	0	<b>3</b>	2	2
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	60	<b>59</b>	58	59
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1010	<b>966</b>	956	989
Calcium	ppm	ASTM D5185(m)	1070	<b>1051</b>	1055	1082
Phosphorus	ppm	ASTM D5185(m)	1150	<b>982</b>	1010	1014
Zinc	ppm	ASTM D5185(m)	1270	<b>1181</b>	1160	1195
Sulfur	ppm	ASTM D5185(m)	2060	<b>2245</b>	2490	2577
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>17.7</b>	17.3	17.6
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>13.4</b>	13.5	13.4

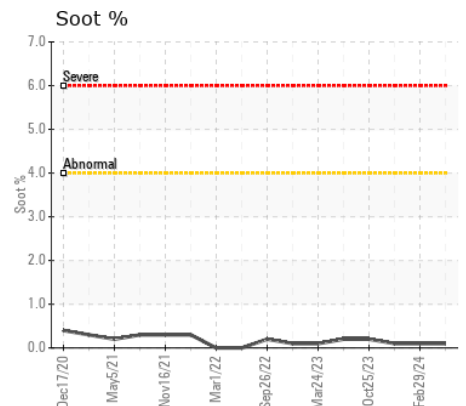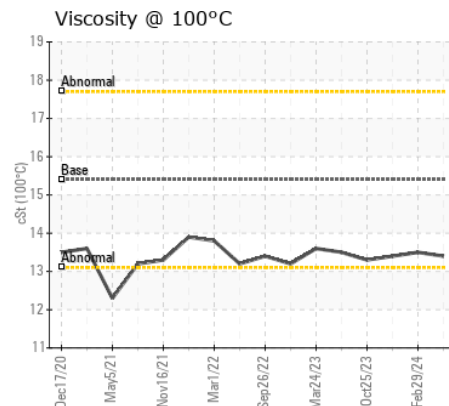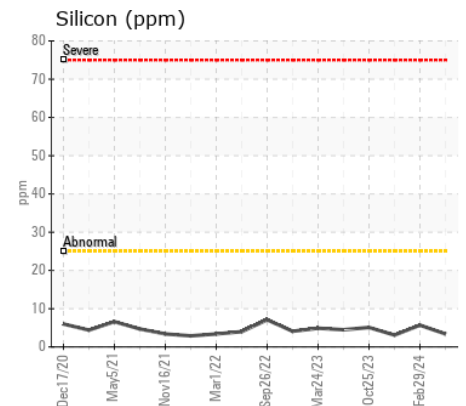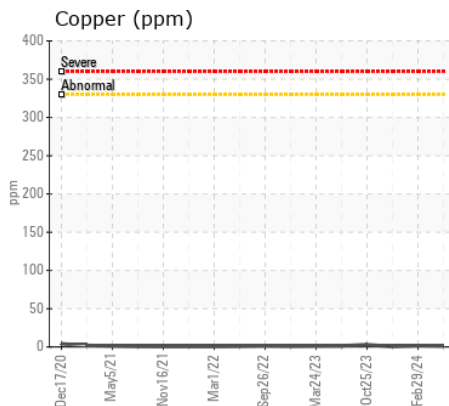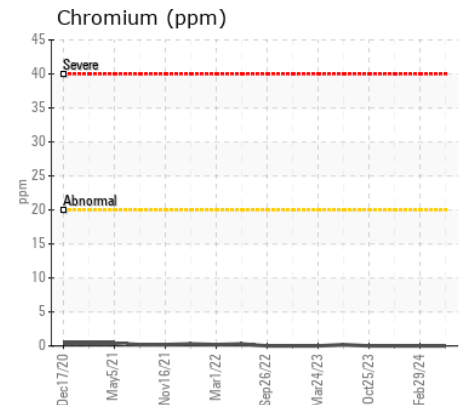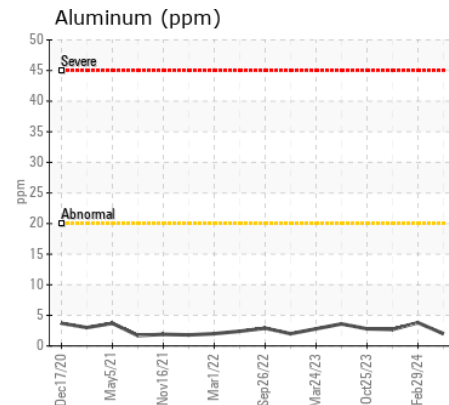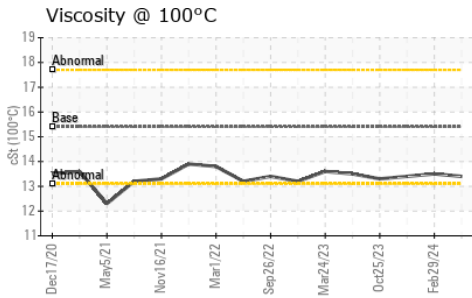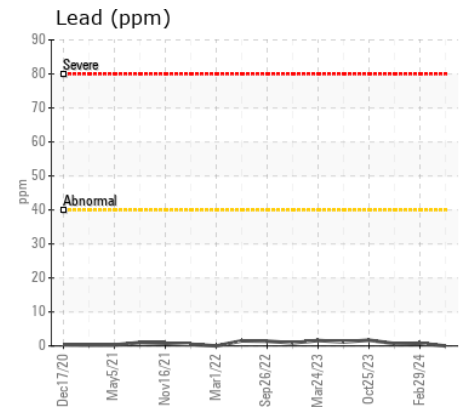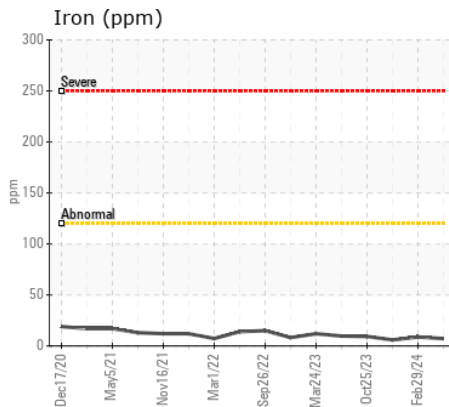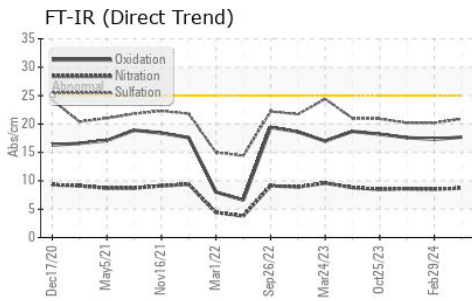

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0113264 **Received** : 15 May 2024  
**Lab Number** : 02635543 **Tested** : 15 May 2024  
**Unique Number** : 5776696 **Diagnosed** : 15 May 2024 - Wes Davis  
**Test Package** : MOB 1

**GFL Environmental - 216**  
 15 Bermondsey Road  
 Toronto, ON  
 CA M4B 1Y9  
 Contact: Tom Hatzioannidis  
 thatzioannidis@gflenv.com  
 T: (416)678-9340  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.