



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
7818
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (18 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0113291	GFL0113265	GFL0097533
Sample Date		Client Info		23 May 2024	07 May 2024	17 Dec 2023
Machine Age	hrs	Client Info		0	27858	0
Oil Age	hrs	Client Info		0	27858	0
Filter Age	hrs	Client Info		0	27858	0
Oil Changed		Client Info		N/A	Changed	N/A
Filter Changed		Client Info		N/A	Changed	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>75	12	29	14
Chromium	ppm	ASTM D5185(m)	>5	<1	1	<1
Nickel	ppm	ASTM D5185(m)	>4	0	<1	<1
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	<1
Aluminum	ppm	ASTM D5185(m)	>15	2	7	2
Lead	ppm	ASTM D5185(m)	>25	0	0	<1
Copper	ppm	ASTM D5185(m)	>100	<1	1	<1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	3	4	4
Potassium	ppm	ASTM D5185(m)	>20	4	14	2
Fuel		WC Method	>3.0	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>6	0.5	1.8	0.7
Nitration	Abs/cm	ASTM D7624*	>20	7.1	11.8	8.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.8	25.2	20.2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		4	5	4
Boron	ppm	ASTM D5185(m)	0	4	4	4
Barium	ppm	ASTM D5185(m)	0	0	0	<1
Molybdenum	ppm	ASTM D5185(m)	60	59	65	62
Manganese	ppm	ASTM D5185(m)	0	0	<1	0
Magnesium	ppm	ASTM D5185(m)	1010	968	1064	987
Calcium	ppm	ASTM D5185(m)	1070	1046	1163	1110
Phosphorus	ppm	ASTM D5185(m)	1150	973	1060	992
Zinc	ppm	ASTM D5185(m)	1270	1178	1296	1224
Sulfur	ppm	ASTM D5185(m)	2060	2472	2429	2455
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.5	19.4	15.7
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.3	15.3	14.8

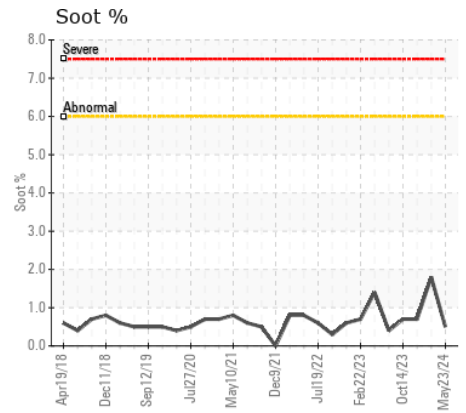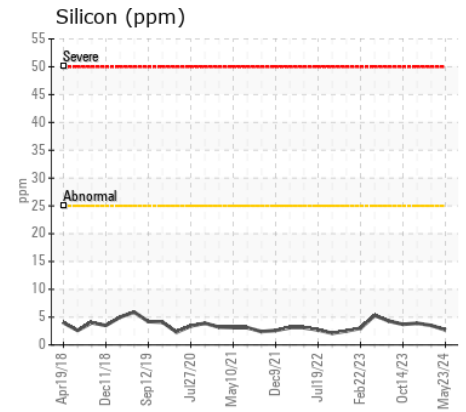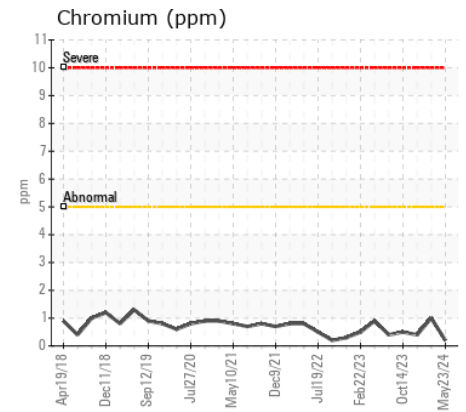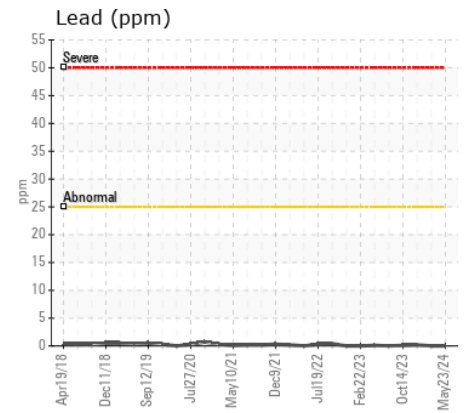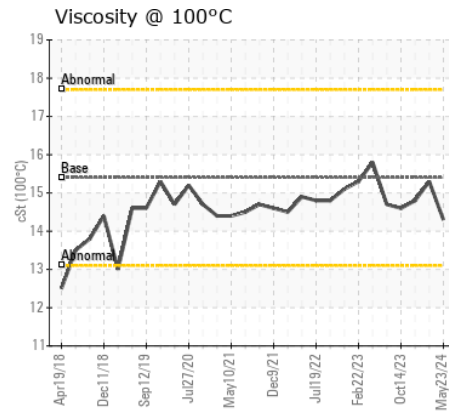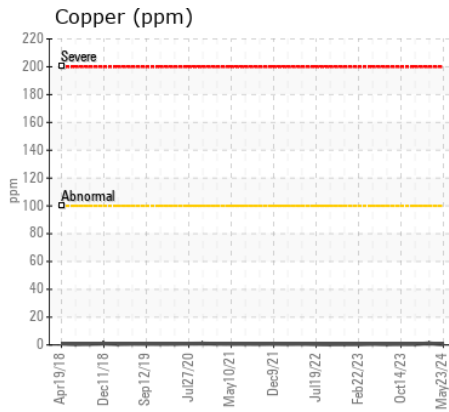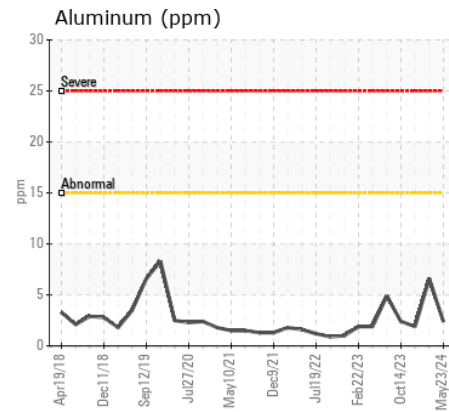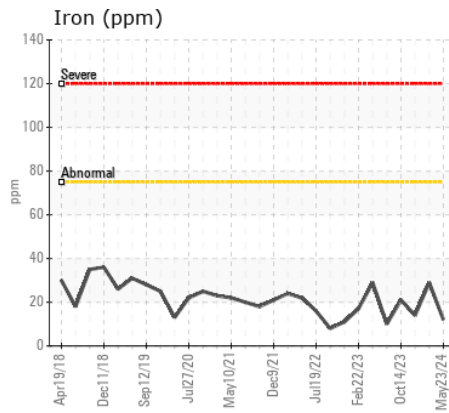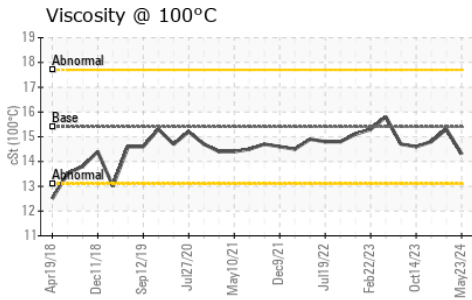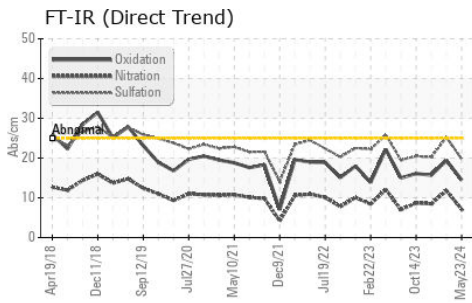

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0113291 **Received** : 24 May 2024
Lab Number : 02637418 **Tested** : 24 May 2024
Unique Number : 5786580 **Diagnosed** : 24 May 2024 - Wes Davis
Test Package : MOB 1

GFL Environmental - 216
 15 Bermondsey Road
 Toronto, ON
 CA M4B 1Y9
 Contact: Tom Hatzioannidis
 thatzioannidis@gflenv.com
 T: (416)678-9340
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.