



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(349196)

Machine Id
LIEBHERR L556 059592-1332

Component
Rear Differential

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (35 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0288304	LH0281238	LH0265588
Sample Date		Client Info		23 Apr 2024	23 Feb 2024	25 Oct 2023
Machine Age	hrs	Client Info		13157	12000	11042
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>1000	64	173	159
Chromium	ppm	ASTM D5185(m)	>10	0	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>5	0	0	0
Copper	ppm	ASTM D5185(m)	>100	12	3	4
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	VLITE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>100	0	<1	3
Potassium	ppm	ASTM D5185(m)	>20	<1	1	0
Water		WC Method	>.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	VLITE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		1	<1	<1
Boron	ppm	ASTM D5185(m)	328	270	4	26
Barium	ppm	ASTM D5185(m)	1	0	0	<1
Molybdenum	ppm	ASTM D5185(m)		8	16	13
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	2	2	2
Calcium	ppm	ASTM D5185(m)	7	10	8	7
Phosphorus	ppm	ASTM D5185(m)	1145	1872	1690	1823
Zinc	ppm	ASTM D5185(m)	3	9	16	32
Sulfur	ppm	ASTM D5185(m)	17909	19872	16128	15512
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	98.3	80.3	81.5

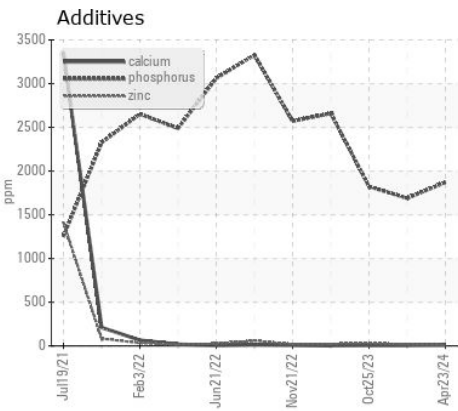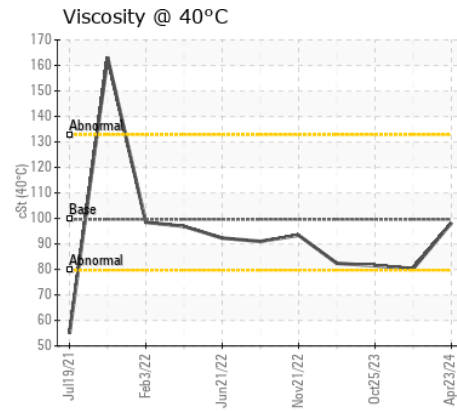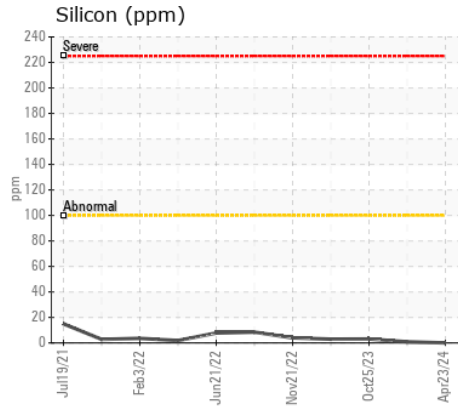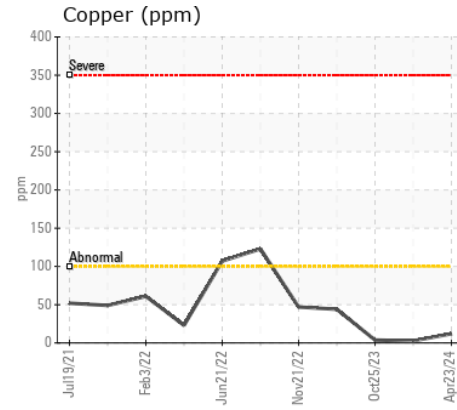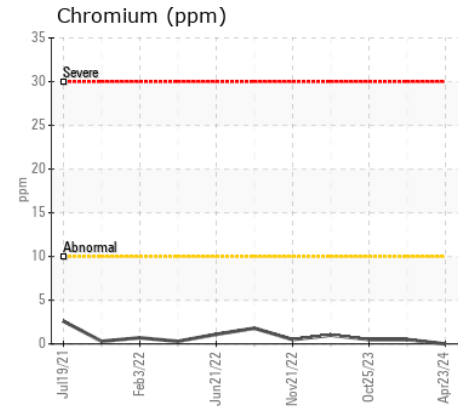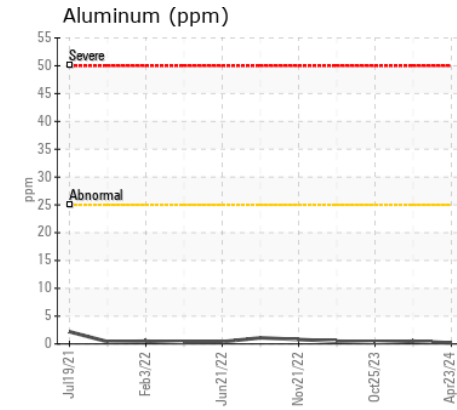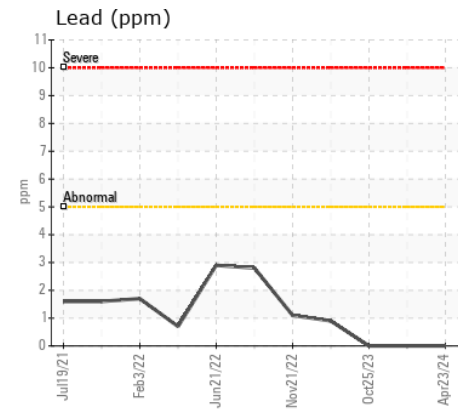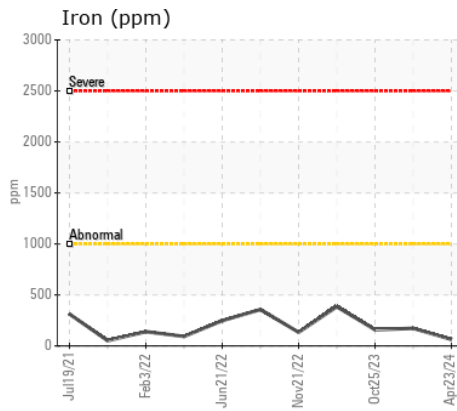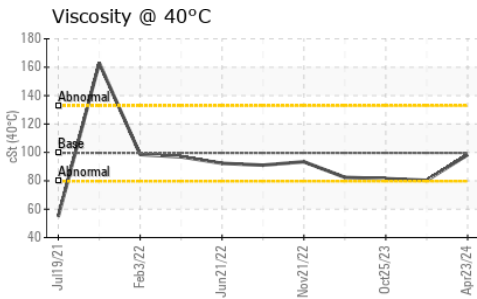

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0288304 **Received** : 28 May 2024
Lab Number : 02638233 **Tested** : 29 May 2024
Unique Number : 5787395 **Diagnosed** : 29 May 2024 - Wes Davis
Test Package : MOB 1

Eacom Timber Corporation
 100 Old Nairn Centre Road
 Nairn Centre, ON
 CA P0M 2L0
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: