Honeywell

OIL ANALYSIS REPORT

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

Area (CGCPX) SKYCARE AIR AMBULANCE [53352] [CGCPX] FAIRCHILD SA226 P-54101C (S/N TC274)

Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION

This is a baseline read-out on the submitted sample.

 	_	
 _		_
	/ A .	
_		

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT58023	GT57712	GT57811
Sample Date		Client Info		04 Jun 2024	18 May 2024	29 Apr 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		650	579	517
Filter Age	hrs	Client Info		71	58	124
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	
Iron	ppm	ASTM D5185(m)	>8	<1	<1	0
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	<1	0
Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.57	0.51	0.49
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.3	24.5	

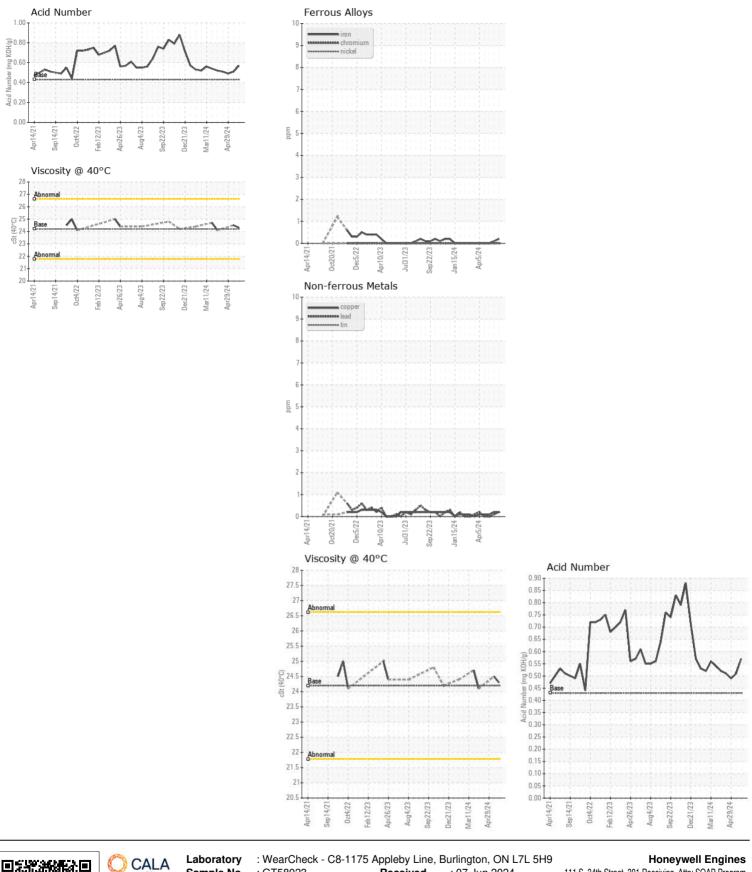

Sample No. Received : 07 Jun 2024 111 S. 34th Street, 301 Receiving, Attn: SOAP Program : GT58023 Lab Number : 02640613 Tested PHOENIX, AZ : 07 Jun 2024 ISO 17025:2017 Accredited Laboratory Unique Number : 5789775 : 07 Jun 2024 - Wes Davis US 85034 Diagnosed Test Package : G331 (Additional Tests: ICP) Contact: GARRETT To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: Validity of results and interpretation are based on the sample and information as supplied. F: (602)365-2676

Contact/Location: GARRETT ? - HONPHO Page 2 of 2