

Area
[1291183]
Machine Id
512026
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0118540	GFL0028554	GFL0110705
Sample Date		Client Info		07 Jun 2024	14 Mar 2024	16 Jan 2024
Machine Age	hrs	Client Info		4424	0	3552
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	N/A	N/A
Filter Changed		Client Info		Changed	N/A	N/A
Sample Status				NORMAL	NORMAL	MARGINAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>90	13	8	12
Chromium	ppm	ASTM D5185(m)	>20	1	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	0	<1	<1
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	4	2	4
Lead	ppm	ASTM D5185(m)	>40	<1	<1	2
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	2	3	4
Potassium	ppm	ASTM D5185(m)	>20	8	4	10
Fuel		WC Method	>3.0	<1.0	<1.0	▲ 1.4
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>6	0.2	0.1	0.2
Nitration	Abs/cm	ASTM D7624*	>20	7.7	6.6	8.0
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.0	18.8	20.3
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		4	3	4
Boron	ppm	ASTM D5185(m)	0	2	4	2
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	60	60	59	58
Manganese	ppm	ASTM D5185(m)	0	<1	0	0
Magnesium	ppm	ASTM D5185(m)	1010	974	944	969
Calcium	ppm	ASTM D5185(m)	1070	1045	1061	1089
Phosphorus	ppm	ASTM D5185(m)	1150	972	1022	1001
Zinc	ppm	ASTM D5185(m)	1270	1183	1170	1187
Sulfur	ppm	ASTM D5185(m)	2060	2441	2740	2631
Oxidation	Abs/.1mm	ASTM D7414*	>25	15.7	14.5	15.9
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.3	13.3	12.7

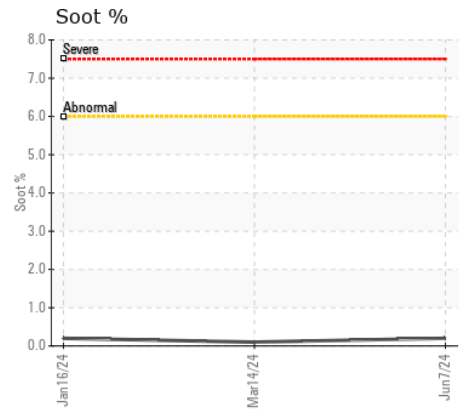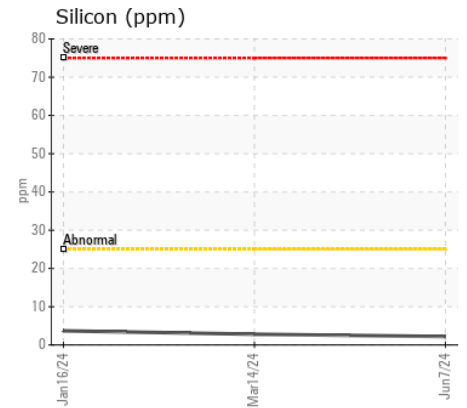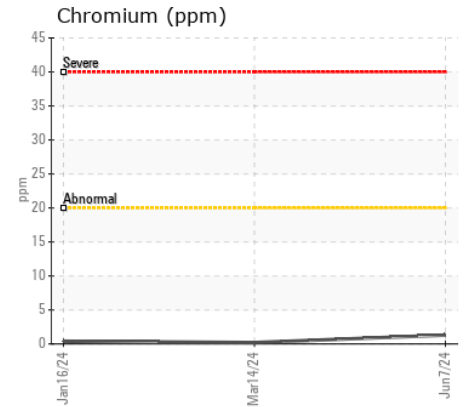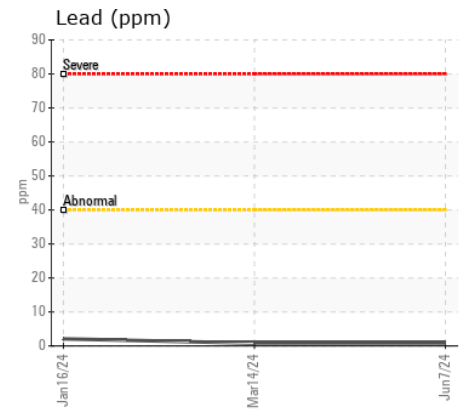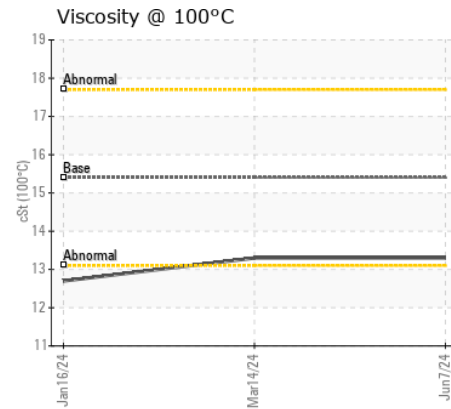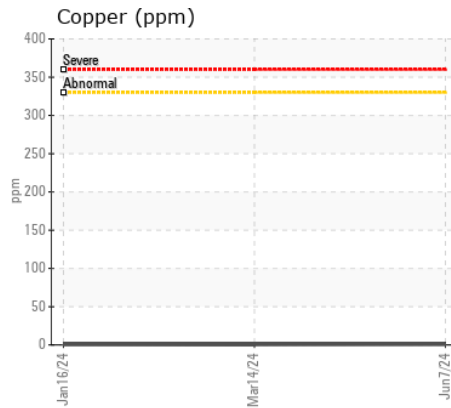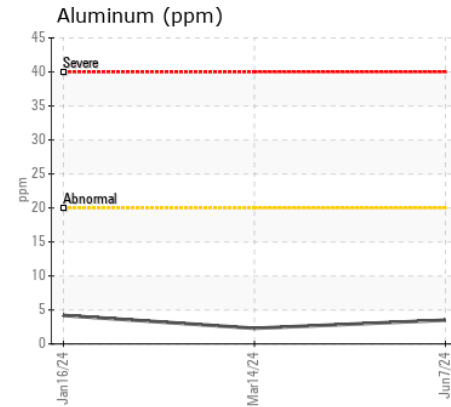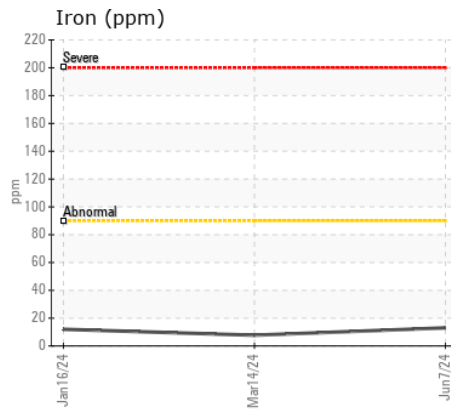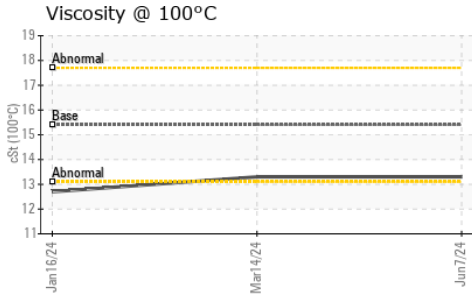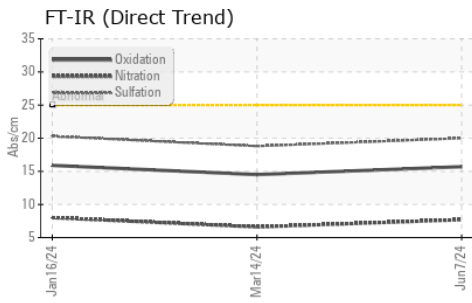

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0118540
Lab Number : 02640986
Unique Number : 5798525
Test Package : MOB 1

Received : 11 Jun 2024
Tested : 11 Jun 2024
Diagnosed : 11 Jun 2024 - Wes Davis

GFL Environmental - 207 - Pickering SW
 1034 TOY AVENUE, PICKERING YARD
 PICKERING, ON
 CA L1W 3P1
 Contact: Ian Patton
 ipatton@gflenv.com
 T: (905)831-6297
 F: (905)426-3577

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.