



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**801053**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (19 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0122302</b>	GFL0111737	GFL0107144
Sample Date		Client Info		<b>11 Jun 2024</b>	26 Mar 2024	08 Jan 2024
Machine Age	hrs	Client Info		<b>9157</b>	8599	8075
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>80	<b>23</b>	21	23
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>30	<b>2</b>	2	3
Lead	ppm	ASTM D5185(m)	>30	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>150	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>20	<b>3</b>	3	6
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	2	2
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0.6</b>	0.6	0.6
Nitration	Abs/cm	ASTM D7624*	>20	<b>10.3</b>	9.7	10.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>21.2</b>	20.4	21.4
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>8</b>	8	8
Boron	ppm	ASTM D5185(m)	0	<b>6</b>	8	16
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	60	<b>60</b>	58	61
Manganese	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1010	<b>951</b>	916	892
Calcium	ppm	ASTM D5185(m)	1070	<b>1046</b>	1000	1065
Phosphorus	ppm	ASTM D5185(m)	1150	<b>978</b>	932	985
Zinc	ppm	ASTM D5185(m)	1270	<b>1194</b>	1141	1169
Sulfur	ppm	ASTM D5185(m)	2060	<b>2422</b>	2313	2536
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>17.7</b>	16.6	17.7
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>14.0</b>	13.5	13.8

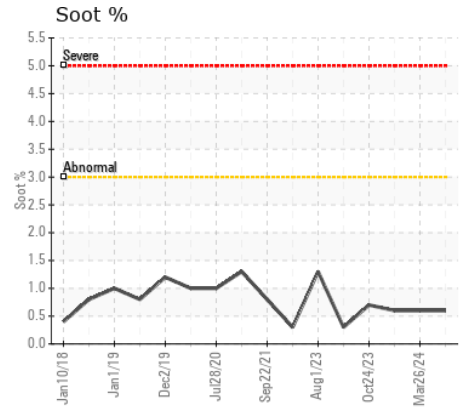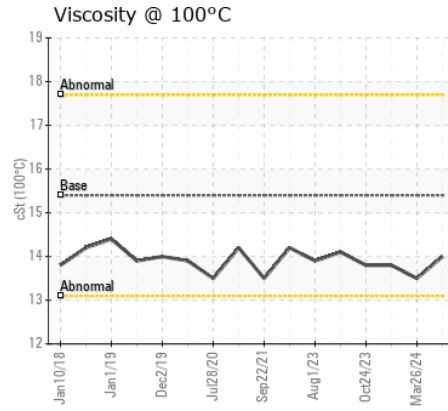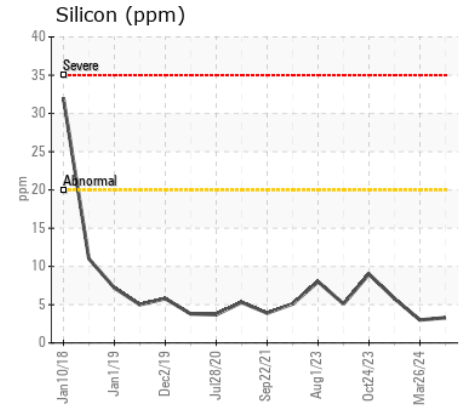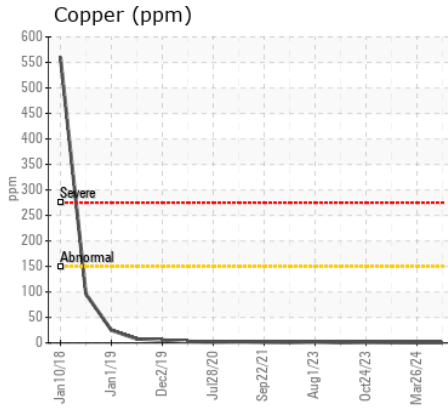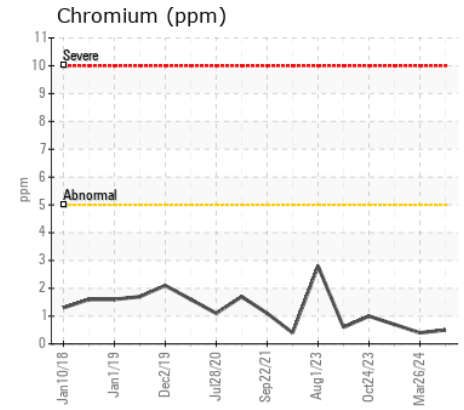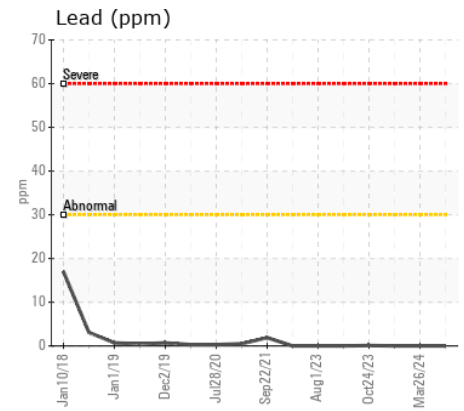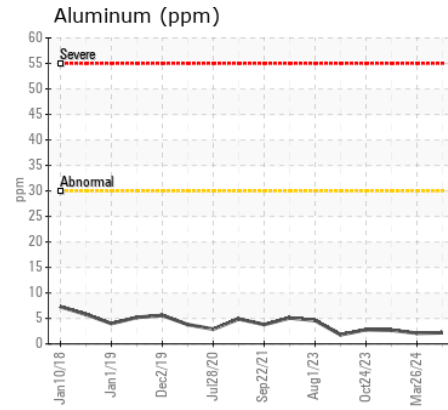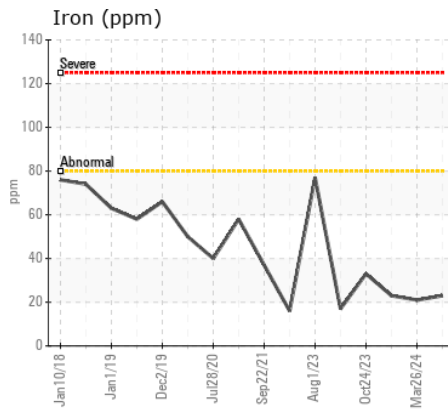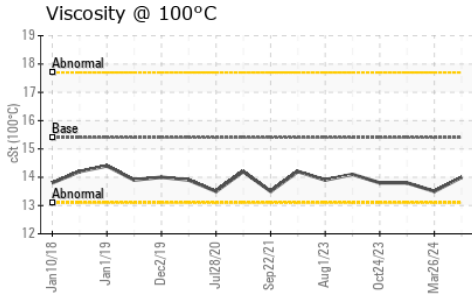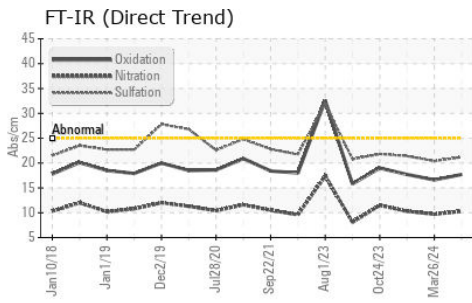

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0122302  
**Lab Number** : 02641662  
**Unique Number** : 5799201  
**Test Package** : MOB 1

**GFL Environmental - 217 - Aurora**  
 14131 BAYVIEW AVE, AURORA YARD  
 AURORA, ON  
 CA L4G 0K6  
 Contact: Mike Havens  
 MHavens@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
 F: (905)713-2445