



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[1294011]**  
Machine Id  
**910078**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (36 GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0118551</b>	GFL0110695	GFL0102728
Sample Date		Client Info		<b>12 Jun 2024</b>	04 Apr 2024	02 Feb 2024
Machine Age	hrs	Client Info		<b>10340</b>	9742	9191
Oil Age	hrs	Client Info		<b>600</b>	0	0
Filter Age	hrs	Client Info		<b>600</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	N/A	N/A
Filter Changed		Client Info		<b>Changed</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>120	<b>6</b>	7	8
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185(m)	>15	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	2	3
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>330	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>2</b>	7	18
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	1	2
Fuel		WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>4	<b>0.3</b>	0.2	0.2
Nitration	Abs/cm	ASTM D7624*	>20	<b>7.8</b>	8.0	8.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>19.6</b>	19.0	19.6
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>4</b>	2	5
Boron	ppm	ASTM D5185(m)	0	<b>2</b>	2	1
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	60	<b>58</b>	58	58
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1010	<b>956</b>	959	950
Calcium	ppm	ASTM D5185(m)	1070	<b>1032</b>	1018	1081
Phosphorus	ppm	ASTM D5185(m)	1150	<b>954</b>	961	982
Zinc	ppm	ASTM D5185(m)	1270	<b>1165</b>	1182	1173
Sulfur	ppm	ASTM D5185(m)	2060	<b>2342</b>	2419	2595
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>15.7</b>	15.1	15.7
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>13.9</b>	13.8	13.7

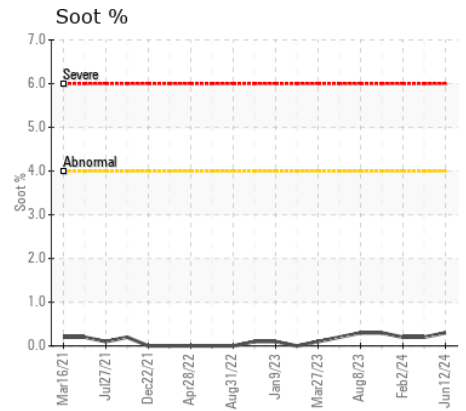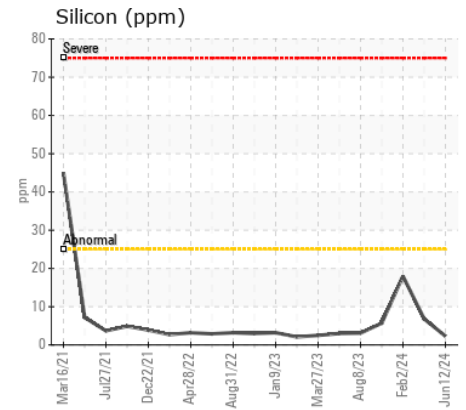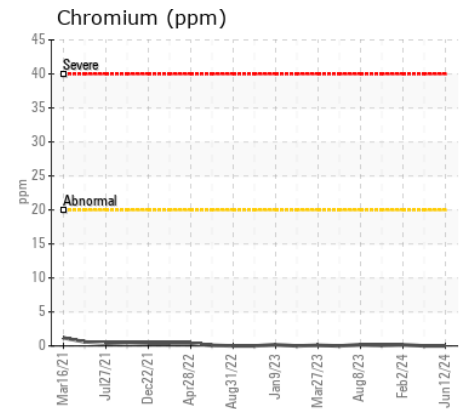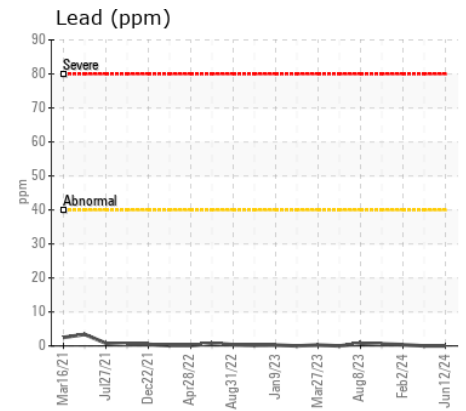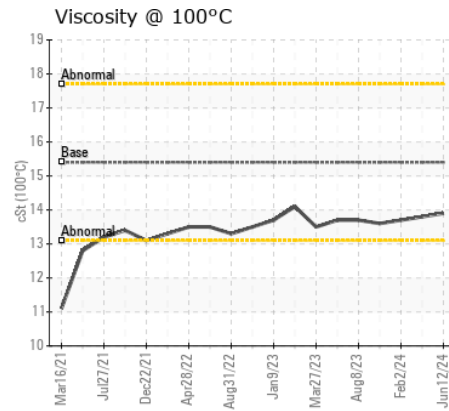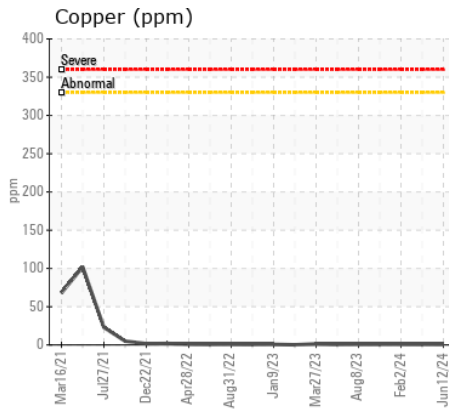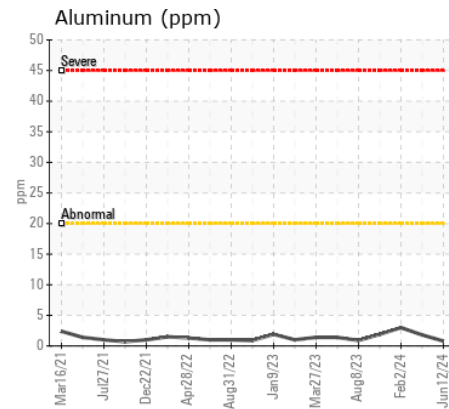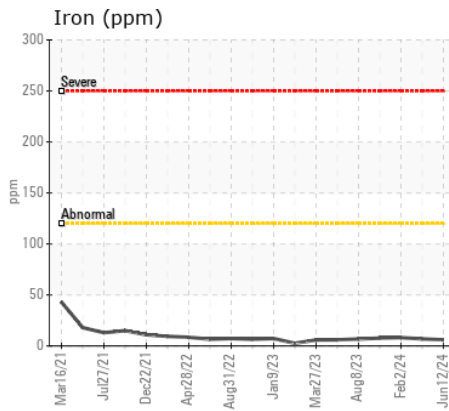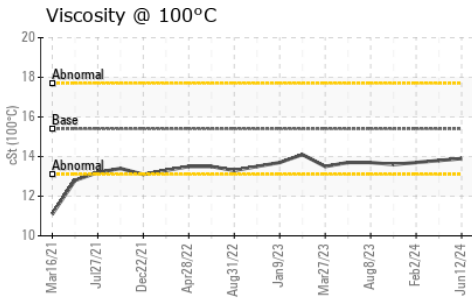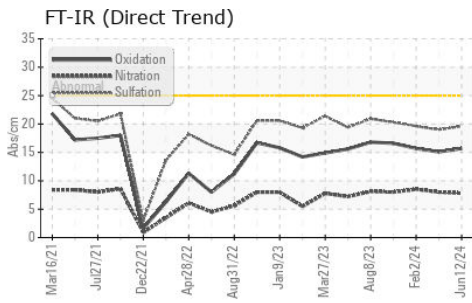

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0118551  
**Lab Number** : 02641924  
**Unique Number** : 5799463  
**Test Package** : MOB 1

**GFL Environmental - 207 - Pickering SW**  
 1034 TOY AVENUE, PICKERING YARD  
 PICKERING, ON  
 CA L1W 3P1  
 Contact: Ian Patton  
 ipatton@gflenv.com  
 T: (905)831-6297  
 F: (905)426-3577

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.