



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(341435)
Machine Id
LIEBHERR LH50M 128733-1216
Component
Diesel Engine
Fluid
SAE 5W30 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0289407	LH0286551	LH0278632
Sample Date		Client Info		17 Jun 2024	19 Mar 2024	17 Jan 2024
Machine Age	hrs	Client Info		10161	9241	8647
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>66	6	5	3
Chromium	ppm	ASTM D5185(m)	>4	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>8	1	<1	2
Lead	ppm	ASTM D5185(m)	>10	<1	0	<1
Copper	ppm	ASTM D5185(m)	>74	2	2	1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>15	8	6	5
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	10.0	10.1	8.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	22.7	21.7	19.0
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	4	1
Boron	ppm	ASTM D5185(m)		5	27	4
Barium	ppm	ASTM D5185(m)		<1	0	0
Molybdenum	ppm	ASTM D5185(m)		62	62	56
Manganese	ppm	ASTM D5185(m)		<1	0	0
Magnesium	ppm	ASTM D5185(m)		1004	1141	940
Calcium	ppm	ASTM D5185(m)		1117	869	1088
Phosphorus	ppm	ASTM D5185(m)		1018	1001	998
Zinc	ppm	ASTM D5185(m)		1254	1213	1161
Sulfur	ppm	ASTM D5185(m)		2524	2675	2752
Oxidation	Abs/.1mm	ASTM D7414*	>25	22.9	22.5	16.4
Visc @ 100°C	cSt	ASTM D7279(m)	11.0	12.4	11.3	13.0

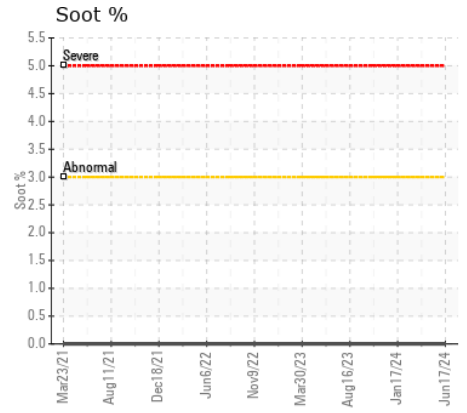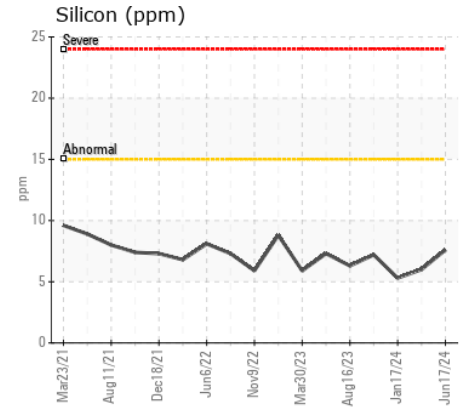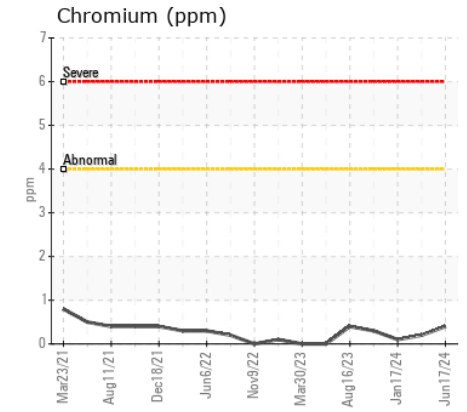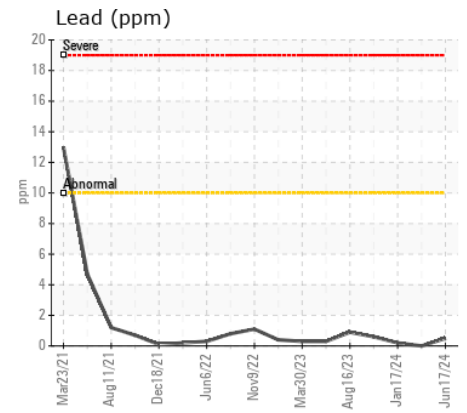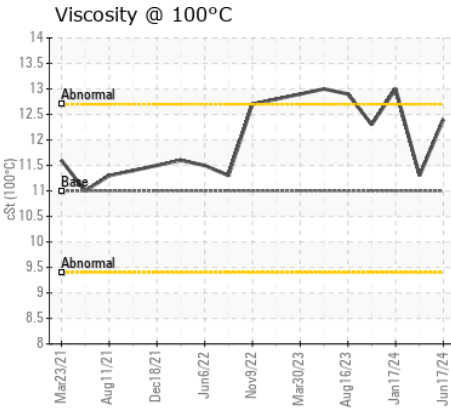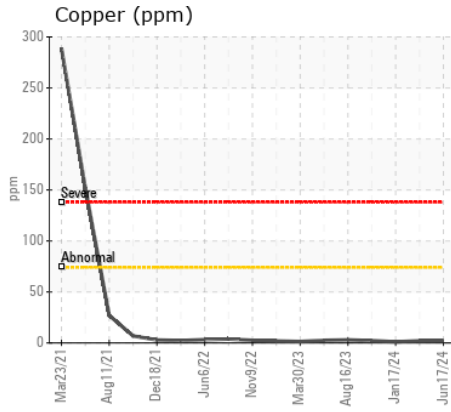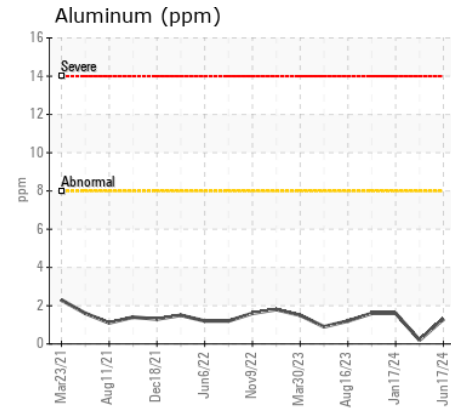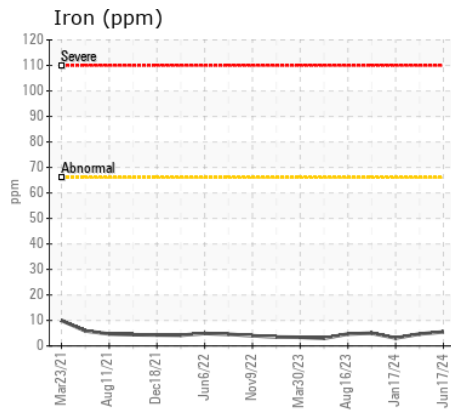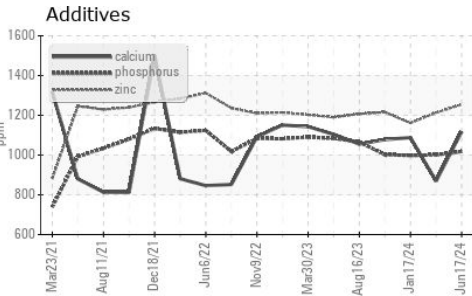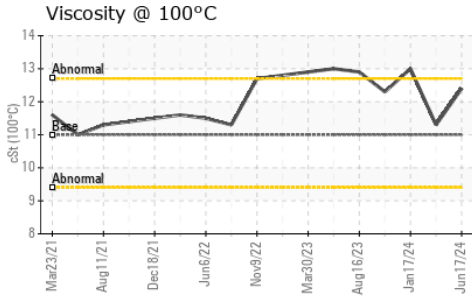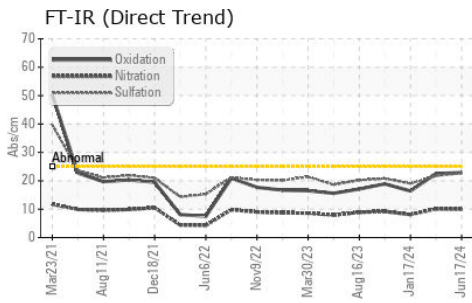

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0289407
Lab Number : 02642496
Unique Number : 5800035
Test Package : MOB 1
Received : 18 Jun 2024
Tested : 18 Jun 2024
Diagnosed : 18 Jun 2024 - Wes Davis

COMBINED METAL INDUSTRIES
 454 DOBBIE DRIVE
 CAMBRIDGE, ON
 CA N1T 1S7
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
 F: