WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

LocomotivesMachine Id

2008

Railway diesel

RECOMMENDATION	T+	11044	Mada	Line St / Alle	(a	I links or of	I liata a co
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MOB 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid. this testkit includes BN to determine the suitability of the oil for continued use.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		WC0938510	WC0938525	WC093853
	Sample Date	lawa	Client Info		12 Jun 2024	10 Jun 2024	30 May 202
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		0	0	0
	Filter Age	hrs	Client Info		0	O New Observer	0
	Oil Changed		Client Info		Not Changd	Not Changd	Not Chang
	Filter Changed		Client Info		Not Changd	Not Changd	Not Chang
	Sample Status				NORMAL	NORMAL	NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>42	13	14	13
Component wear rates appear to be normal (unconfirmed).	Chromium	ppm	ASTM D5185(m)	>6	<1	<1	<1
	Nickel	ppm	ASTM D5185(m)	>2	<1	<1	0
	Titanium	ppm	ASTM D5185(m)		0	0	0
	Silver	ppm	ASTM D5185(m)	>5	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>4	3	3	3
	Lead	ppm	ASTM D5185(m)	>30	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>95	5	5	5
	Tin	ppm	ASTM D5185(m)	>10	<1	<1	<1
	Vanadium	ppm	ASTM D5185(m)		0	0	0
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>22	5	6	4
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	1	<1	1
	Fuel		WC Method	>4.0	<1.0	<1.0	<1.0
	Water		WC Method	>0.1	NEG	NEG	NEG
	Glycol		WC Method		NEG	NEG	NEG
	Soot %	%	ASTM D7844*		0.3	0.3	0.3
	Nitration	Abs/cm	ASTM D7624*	>20	12.7	12.6	12.7
	Sulfation	Abs/.1mm	ASTM D7415*	>30	15.1	14.8	15.0
	Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		3	4	4
The condition of the oil is acceptable for the time in service (unconfirmed).	Boron	ppm	ASTM D5185(m)	10	<1	1	1
	Barium	ppm	ASTM D5185(m)	10	0	<1	0
	Molybdenum	ppm	ASTM D5185(m)	25	0	0	0
	Manganese	ppm	ASTM D5185(m)		<1	<1	<1
	Magnesium	ppm	ASTM D5185(m)	20	16	17	17
	Calcium	ppm	ASTM D5185(m)	4500	4577	4815	4734
	Phosphorus	ppm	ASTM D5185(m)	10	3	5	3
	Zinc	ppm	ASTM D5185(m)	10	4	5	4
	Sulfur	ppm	ASTM D5185(m)	5000	2898	2961	2879
	Ovidation		A QTM D7/11/1*		10.1	0.0	10.1

Oxidation

Visc @ 100°C cSt

ASTM D7279(m) 14.4

9.9


15.0

10.1

15.0

10.1

15.1

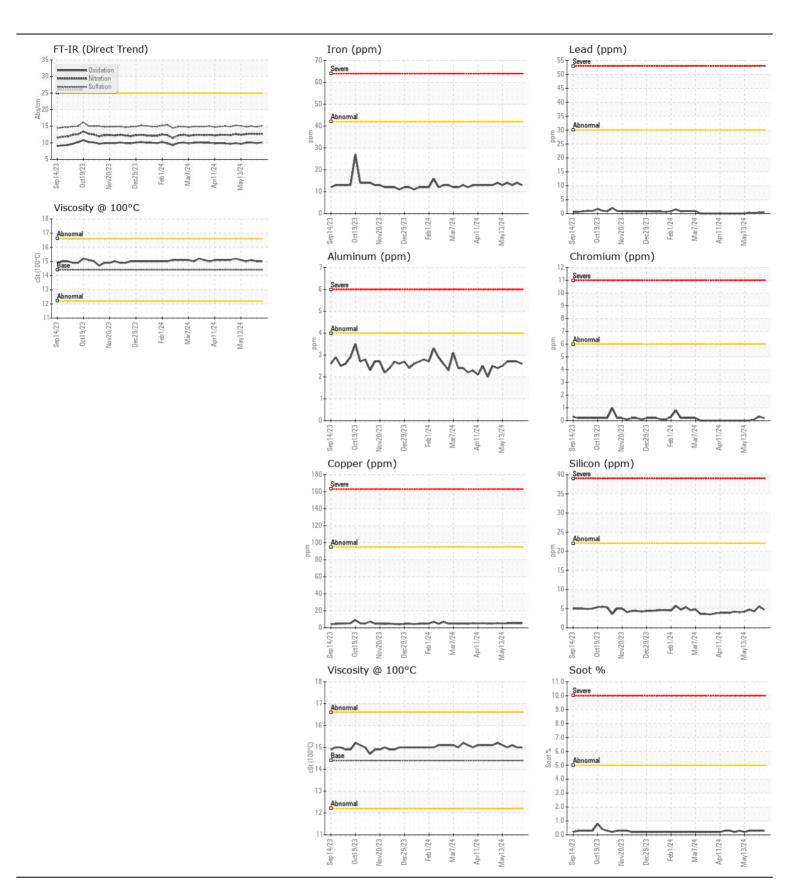



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WC0938510 Lab Number : 02643327 Unique Number : 5800866 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 21 Jun 2024 **Tested** Diagnosed

: 21 Jun 2024 : 21 Jun 2024 - Wes Davis

Transportation Department, (Services - Mobile Equipment) COPPER CLIFF, ON CA P0M 1N0 Contact: Richard Rochon richard.rochon@vale.com

T: (705)682-6014

Vale - Transportation (Mobile Equipment)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

Contact/Location: Richard Rochon - VALCOPTR

F: