



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(359465)

Machine Id
LIEBHERR L556 064990-1757

Component
Front Differential

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0250639	LH0276906	LH0276889
Sample Date		Client Info		11 Jun 2024	11 Jan 2024	24 Oct 2023
Machine Age	hrs	Client Info		11958	9970	9023
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>1000	13	41	31
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>5	0	<1	<1
Copper	ppm	ASTM D5185(m)	>100	6	11	17
Tin	ppm	ASTM D5185(m)	>10	0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	Visual*	NONE	VLITE	NONE	LIGHT

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>100	<1	2	2
Potassium	ppm	ASTM D5185(m)	>20	6	<1	0
Water		WC Method	>.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	VLITE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	<1	<1
Boron	ppm	ASTM D5185(m)	328	300	63	302
Barium	ppm	ASTM D5185(m)	1	0	0	<1
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		<1	0	0
Magnesium	ppm	ASTM D5185(m)	1	1	2	<1
Calcium	ppm	ASTM D5185(m)	7	11	6	3
Phosphorus	ppm	ASTM D5185(m)	1145	2318	2056	2412
Zinc	ppm	ASTM D5185(m)	3	10	23	12
Sulfur	ppm	ASTM D5185(m)	17909	19582	16789	20117
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	99.3	84.3	101

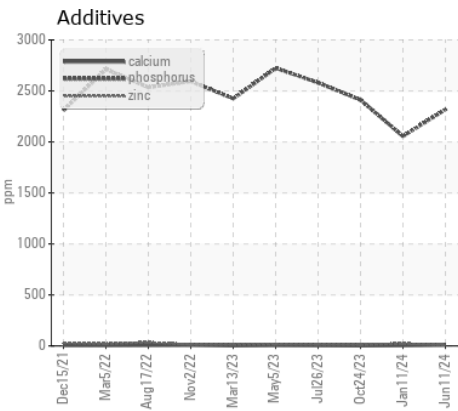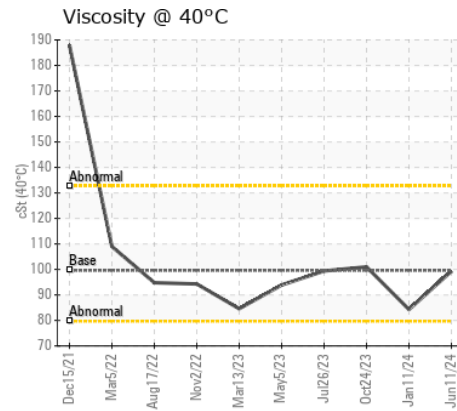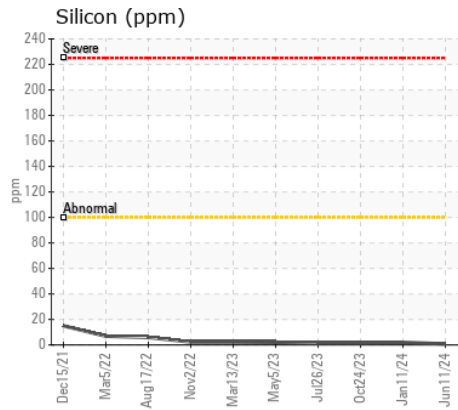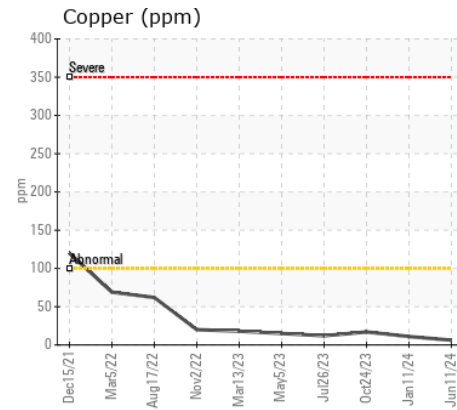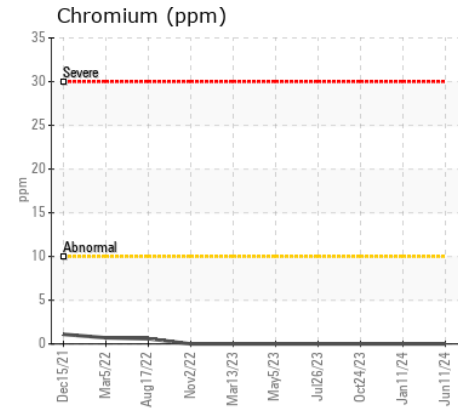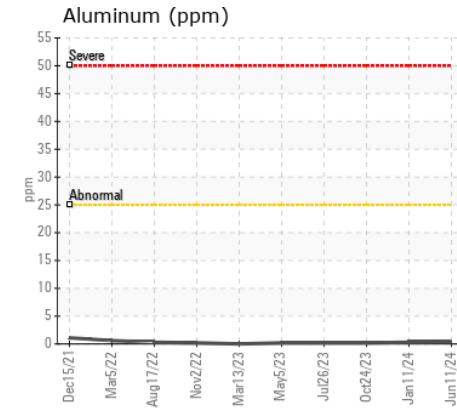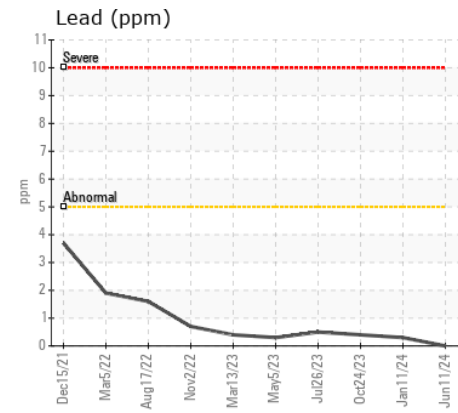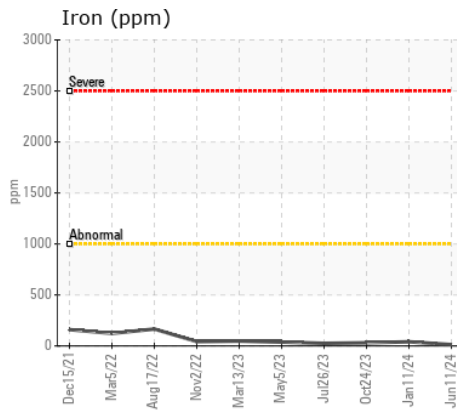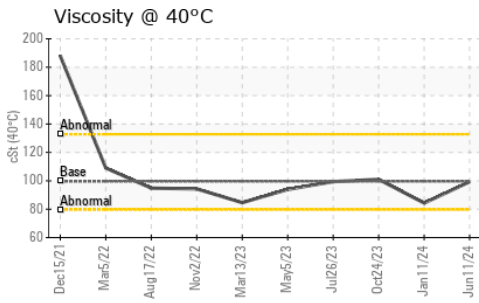

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Sample No. : LH0250639

Lab Number : 02644638

Unique Number : 5802177

Test Package : MOB 1

Received : 28 Jun 2024

Tested : 28 Jun 2024

Diagnosed : 28 Jun 2024 - Wes Davis

Eacom Timber Corporation

100 Old Nairn Centre Road

Nairn Centre, ON

CA P0M 2L0

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T:

F: