WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL ABNORMAL

Machine Id

428093

Transmission (Manual)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0089852		
	Sample Date		Client Info		20 Mar 2024		
	Machine Age	hrs	Client Info		9857		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
VEAR	Iron	ppm	ASTM D5185(m)	>200	59		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)		<1		
	Nickel	ppm	ASTM D5185(m)		<1		
	Titanium	ppm	ASTM D5185(m)		<1		
	Silver	ppm	ASTM D5185(m)	>7	0		
	Aluminum	ppm	ASTM D5185(m)	>25	6		
	Lead	ppm	ASTM D5185(m)	>45	0		
	Copper	ppm	ASTM D5185(m)	>225	1		
	Tin	ppm	ASTM D5185(m)	>10	0		
	Vanadium	ppm	ASTM D5185(m)		0		
	White Metal	scalar	Visual*	NONE	VLITE		
	Yellow Metal	scalar	Visual*	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185(m)	>125	13		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185(m)		2		
	Water	1-1-	WC Method	>0.1	NEG		
	Silt	scalar	Visual*	NONE	LIGHT		
	Debris	scalar	Visual*	NONE	NONE		
	Sand/Dirt	scalar	Visual*	NONE	NONE		
	Appearance	scalar	Visual*	NORML	NORML		
	Odor	scalar	Visual*	NORML	NORML		
	Emulsified Water	scalar	Visual*	>0.1	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185(m)		5		
Viscosity of sample indicates oil is within ISO 46 range, advise investigate. The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	0	<1		
	Barium	ppm	ASTM D5185(m)	0	<1		
	Molybdenum	ppm	ASTM D5185(m)	0	0		
	Manganese	ppm	ASTM D5185(m)	1	<1		
	Magnesium	ppm	ASTM D5185(m)	0	5		
	Calcium	ppm	ASTM D5185(m)	50	55		
	Phosphorus	ppm	ASTM D5185(m)	330	306		
	Zinc	ppm	ASTM D5185(m)	430	401		
	Sulfur	ppm	ASTM D5185(m)	760	1071		

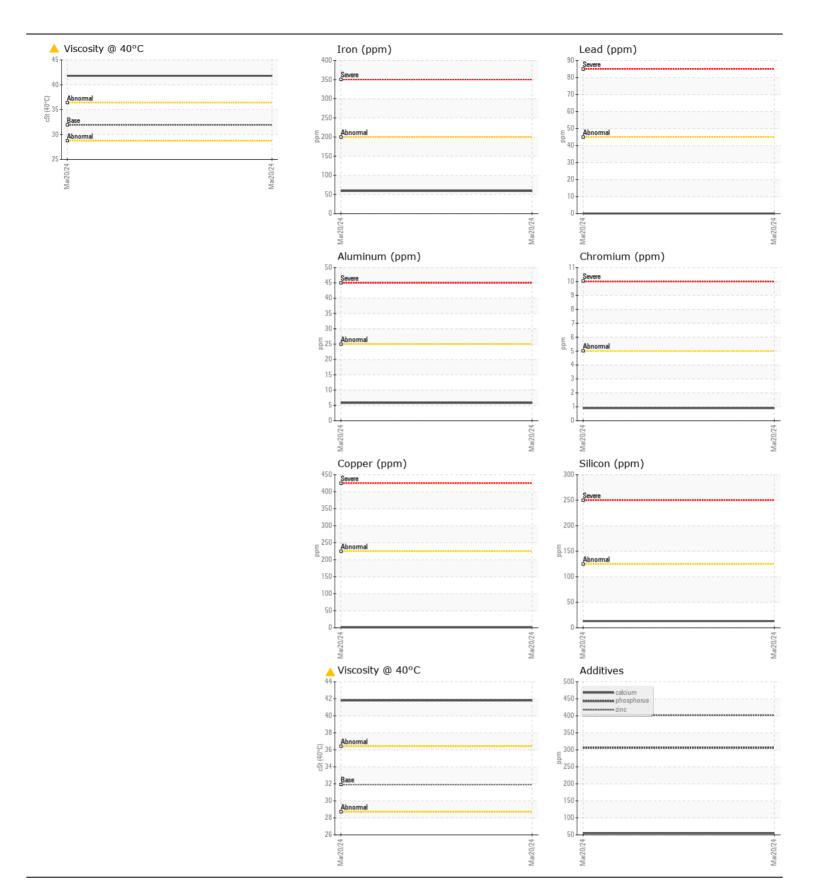



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: GFL0089852 Lab Number : 02644924 Unique Number : 5802463 Test Package : MOB 1

Received **Tested** Diagnosed

: 02 Jul 2024 : 03 Jul 2024

: 03 Jul 2024 - Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental DO NOT USE_USE GFL582 4624 Cumberland Road Cumberland, BC CA VOR 1S0

Contact: Kyle Fallowfield kfallowfield@gflenv.com T:

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: