



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
INGERSOL RAND D-40
 Component
Diesel Engine
 Fluid
SAFETY-KLEEN PERFORMANCE PLUS 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0922844	---	---
Sample Date		Client Info		25 Jun 2024	---	---
Machine Age	hrs	Client Info		8187	---	---
Oil Age	hrs	Client Info		132	---	---
Filter Age	hrs	Client Info		132	---	---
Oil Changed		Client Info		Not Changd	---	---
Filter Changed		Client Info		Not Changd	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>51	28	---	---
Chromium	ppm	ASTM D5185(m)	>11	<1	---	---
Nickel	ppm	ASTM D5185(m)	>5	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>3	0	---	---
Aluminum	ppm	ASTM D5185(m)	>31	2	---	---
Lead	ppm	ASTM D5185(m)	>26	23	---	---
Copper	ppm	ASTM D5185(m)	>26	2	---	---
Tin	ppm	ASTM D5185(m)	>4	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	LIGHT	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>22	3	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Fuel		WC Method	>2.1	<1.0	---	---
Water		WC Method	>0.21	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>3	0.2	---	---
Nitration	Abs/cm	ASTM D7624*	>20	11.7	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	23.4	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	VLITE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.21	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>31	4	---	---
Boron	ppm	ASTM D5185(m)	1.4	10	---	---
Barium	ppm	ASTM D5185(m)	0.1	0	---	---
Molybdenum	ppm	ASTM D5185(m)	0.1	25	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)	2.7	99	---	---
Calcium	ppm	ASTM D5185(m)	2328	2430	---	---
Phosphorus	ppm	ASTM D5185(m)	924	900	---	---
Zinc	ppm	ASTM D5185(m)	1004	1138	---	---
Sulfur	ppm	ASTM D5185(m)	3828	2960	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	18.1	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	112	97.7	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.3	13.6	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	143	139	---	---

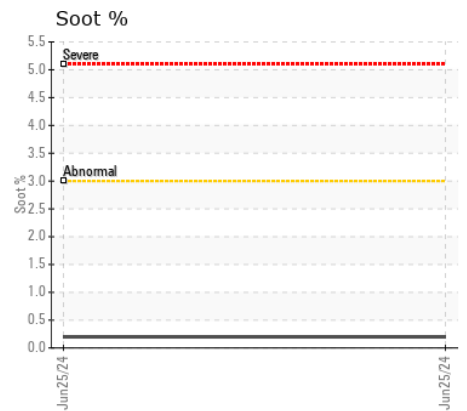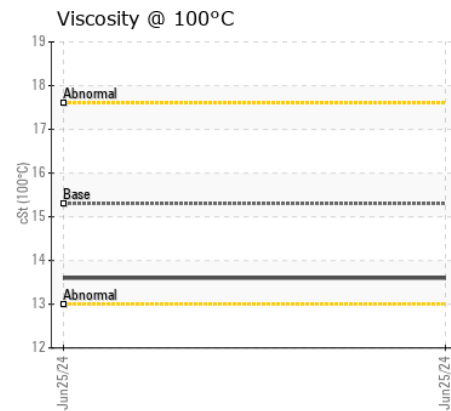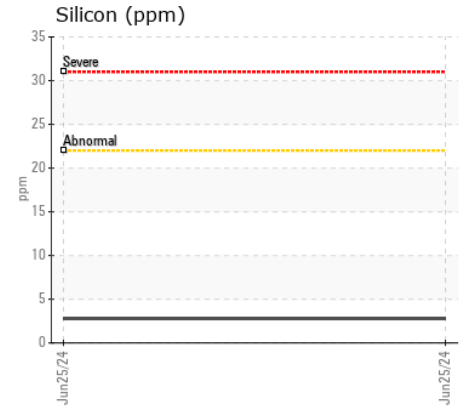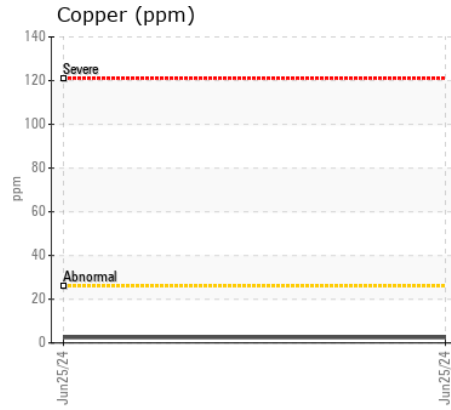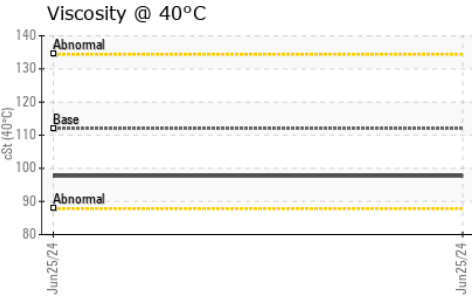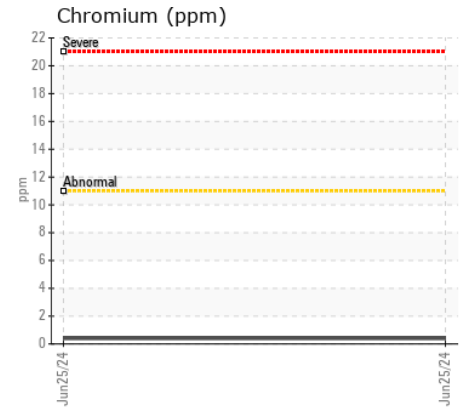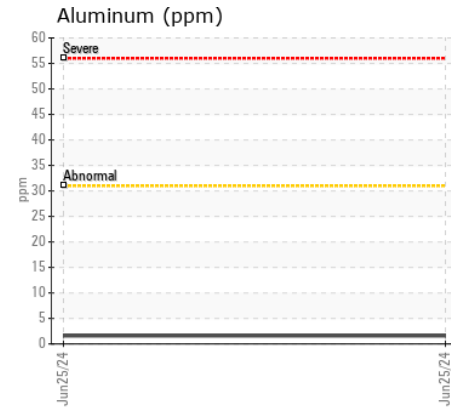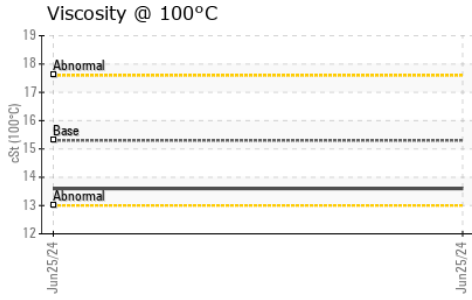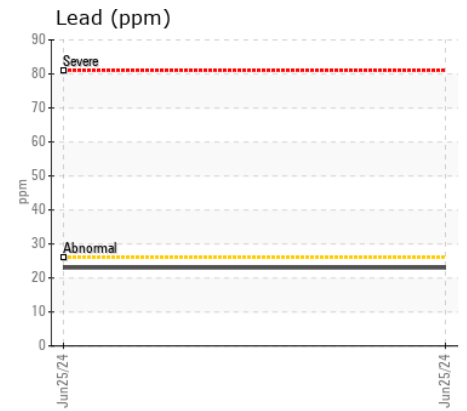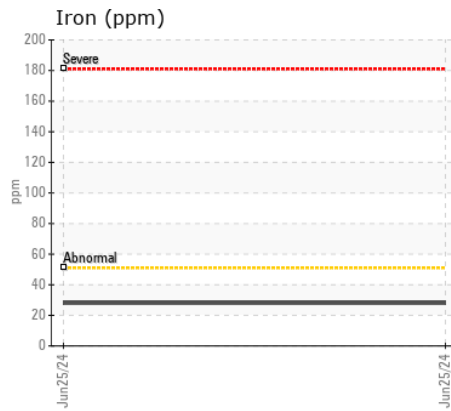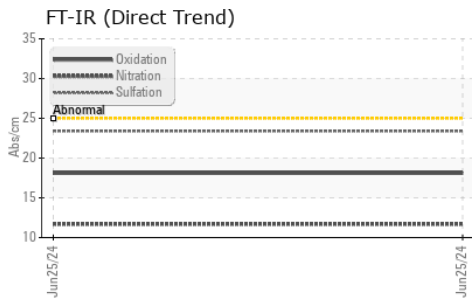

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0922844 **Received** : 05 Jul 2024
Lab Number : 02645736 **Tested** : 05 Jul 2024
Unique Number : 5803275 **Diagnosed** : 05 Jul 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: KV40, VI, Visual)

MIDDLESEX COUNTY ROAD DEPARTMENT
 1988 GAINSBOROUGH ROAD, R.R. #41
 LONDON, ON
 CA N6H 5L2
 Contact: PAUL MONIZ
 pmoniz@middlesex.ca
 T: (519)471-2020
 F: (519)471-2335

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.