



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
52000 series
 Machine Id
Navistar 52848
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 10W30 (40 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0935004	WC0915482	WC0892097
Sample Date		Client Info		09 Jun 2024	20 Apr 2024	03 Feb 2024
Machine Age	mls	Client Info		438503	23308	388426
Oil Age	mls	Client Info		50077	23308	27367
Filter Age	mls	Client Info		50077	23308	27367
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	15	12	13
Chromium	ppm	ASTM D5185(m)	>20	1	<1	1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	3	2	3
Lead	ppm	ASTM D5185(m)	>40	0	0	<1
Copper	ppm	ASTM D5185(m)	>330	<1	<1	2
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	5	4	6
Potassium	ppm	ASTM D5185(m)	>20	4	<1	2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.4	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	8.0	7.7	8.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	18.7	18.6	19.4
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	2	2
Boron	ppm	ASTM D5185(m)	2	3	4	4
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	50	60	62	62
Manganese	ppm	ASTM D5185(m)	0	<1	<1	0
Magnesium	ppm	ASTM D5185(m)	950	968	997	984
Calcium	ppm	ASTM D5185(m)	1050	1048	1088	1113
Phosphorus	ppm	ASTM D5185(m)	995	1009	1027	1066
Zinc	ppm	ASTM D5185(m)	1180	1198	1216	1221
Sulfur	ppm	ASTM D5185(m)	2600	2576	2592	2781
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.6	14.3	15.0
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.5	11.2	11.2

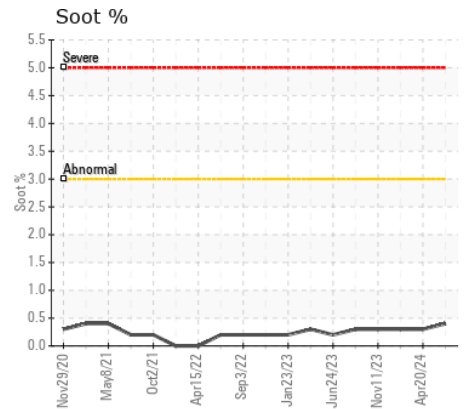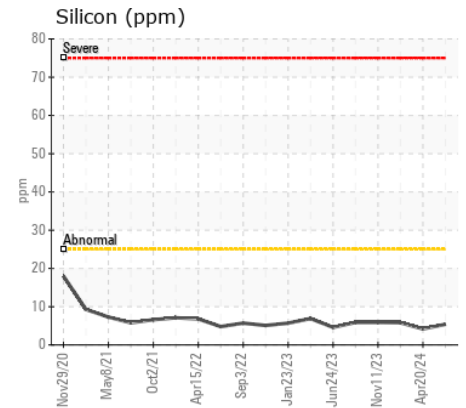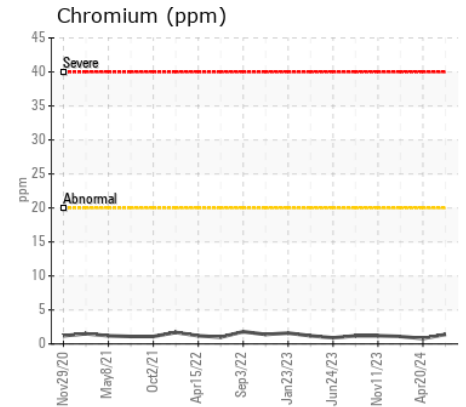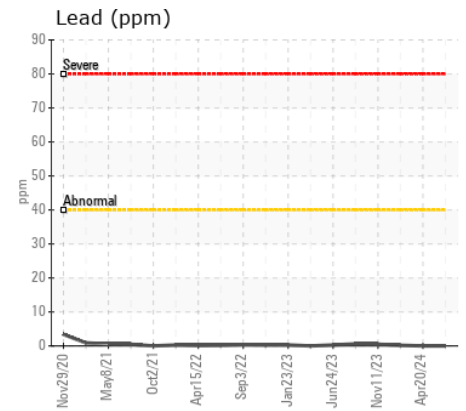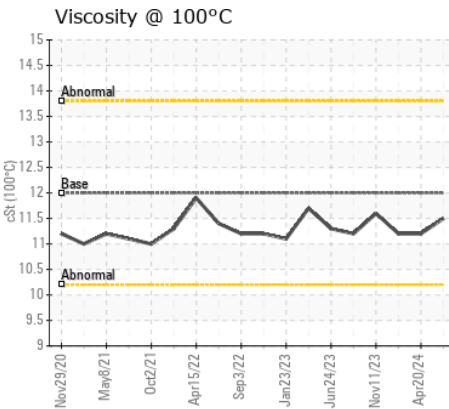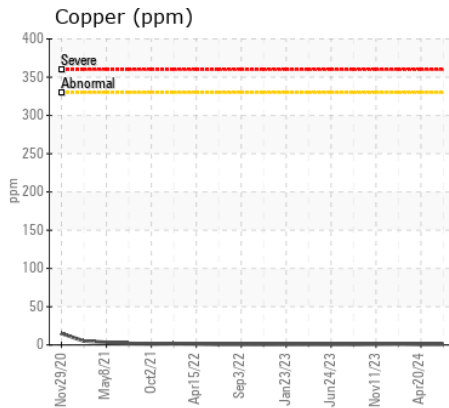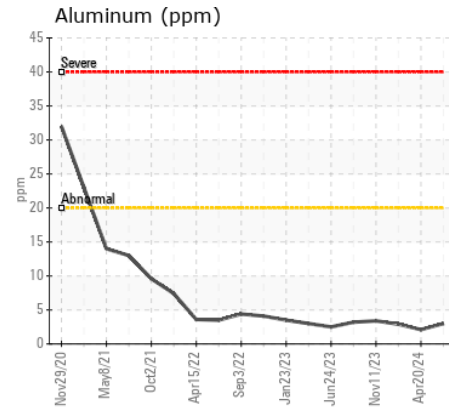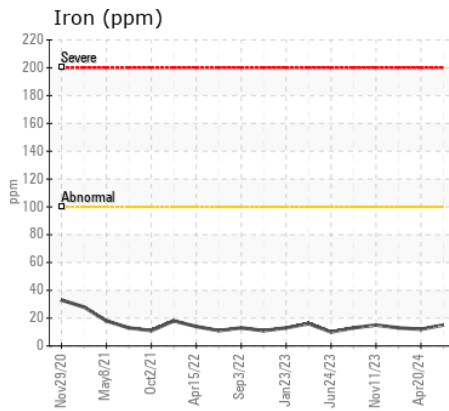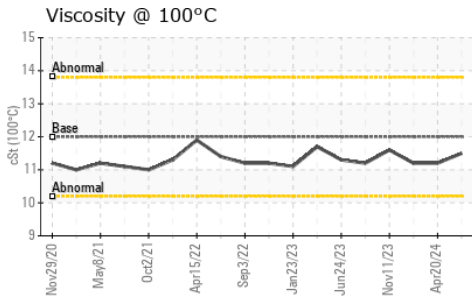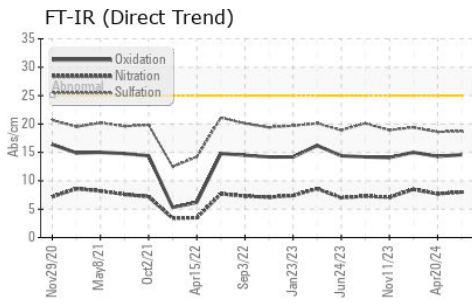

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0935004
Lab Number : 02645766
Unique Number : 5803305
Test Package : MOB 1

Received : 05 Jul 2024
Tested : 05 Jul 2024
Diagnosed : 05 Jul 2024 - Wes Davis

MANITOULIN TRANSPORT
 75 MUMFORD ROAD
 LIVELY, ON
 CA P3Y 1L1
 Contact: Todd Smith
 tosmith@manitoulintransport.com
 T: (705)562-3302
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.