



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
INTERNATIONAL 51985
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (--- LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0935003	WC0904864	WC0892080
Sample Date		Client Info		10 Jun 2024	29 Apr 2024	12 Mar 2024
Machine Age	kms	Client Info		30655	128571	150588
Oil Age	kms	Client Info		30655	35019	0
Filter Age	kms	Client Info		30655	35019	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>100	17	22	19
Chromium	ppm	ASTM D5185(m)	>20	<1	1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	<1	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	7	8	6
Lead	ppm	ASTM D5185(m)	>40	<1	<1	1
Copper	ppm	ASTM D5185(m)	>330	1	1	2
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	4	4	6
Potassium	ppm	ASTM D5185(m)	>20	13	14	7
Fuel		WC Method	>2.0	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.2
Nitration	Abs/cm	ASTM D7624*	>20	8.9	9.1	8.6
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.1	20.9	20.2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	3	1
Boron	ppm	ASTM D5185(m)	2	4	5	5
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	50	60	62	65
Manganese	ppm	ASTM D5185(m)	0	<1	<1	0
Magnesium	ppm	ASTM D5185(m)	950	962	981	988
Calcium	ppm	ASTM D5185(m)	1050	1061	1090	1121
Phosphorus	ppm	ASTM D5185(m)	995	981	999	1036
Zinc	ppm	ASTM D5185(m)	1180	1210	1211	1231
Sulfur	ppm	ASTM D5185(m)	2600	2346	2330	2574
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.7	17.0	16.8
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.2	11.2	11.1

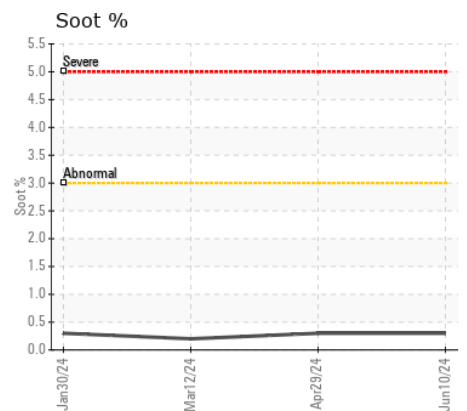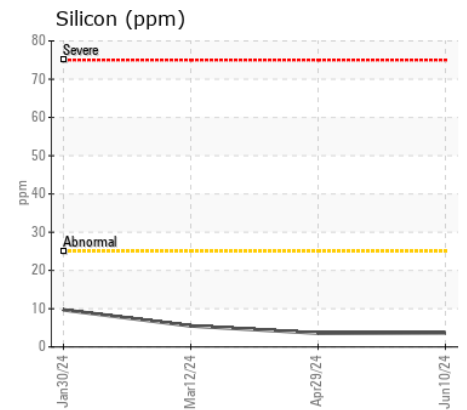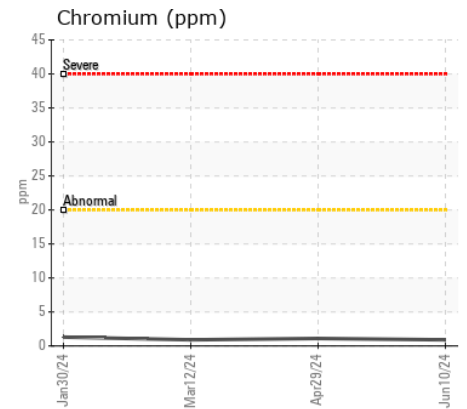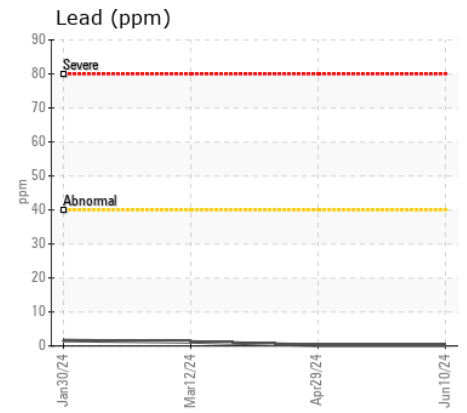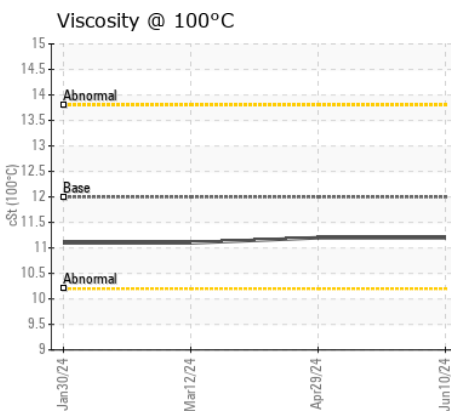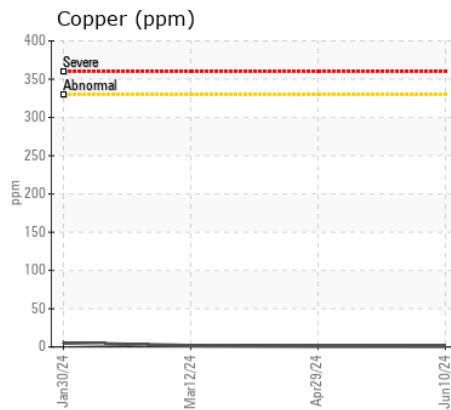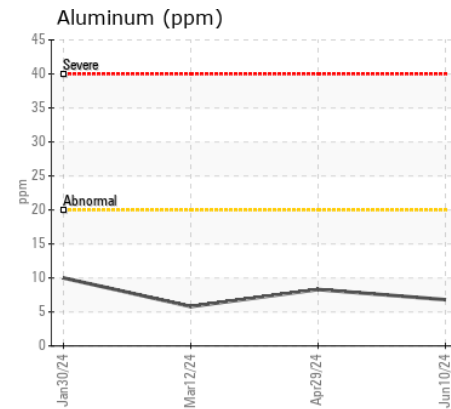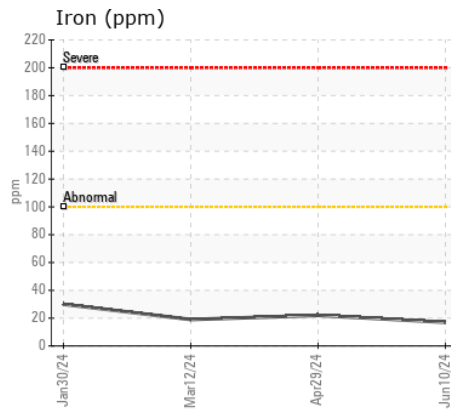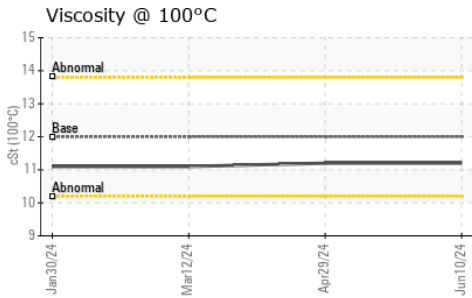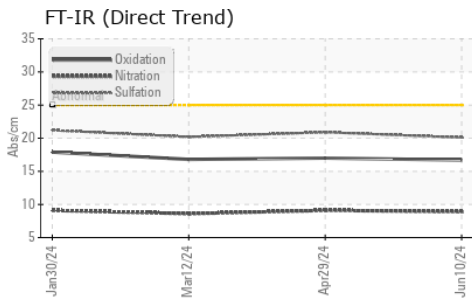

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0935003 **Received** : 05 Jul 2024
Lab Number : 02645789 **Tested** : 05 Jul 2024
Unique Number : 5803328 **Diagnosed** : 05 Jul 2024 - Wes Davis
Test Package : MOB 1

MANITOU LIN TRANSPORT
 75 MUMFORD ROAD
 LIVELY, ON
 CA P3Y 1L1
 Contact: Todd Smith
 tosmith@manitoulintransport.com
 T: (705)562-3302
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.