

### NORMAL WEAR CONTAMINATION NORMAL FLUID CONDITION **ATTENTION**

# [7010428]

VOLVO A45G 342692

**Bogie/Center Axle** 

GEAR OIL SAE 75W90 (--- GAL)

RECOMMENDATION

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

### **WEAR**

All component wear rates are normal.

## CONTAMINATION


There is no indication of any contamination in the oil.


# **FLUID CONDITION**

The oil viscosity is higher than normal. Confirm oil type.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP340129		
Sample Date		Client Info		14 Jul 2022		
Machine Age	hrs	Client Info		4208		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		N/A		
Sample Status				ATTENTION		
Iron	ppm	ASTM D5185m	>900	148		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		<1		
Aluminum	ppm	ASTM D5185m	>30	1		
Lead	ppm	ASTM D5185m	>50	<1		
Copper	ppm	ASTM D5185m	>150	<1		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	VLITE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	14		
Potassium	ppm	ASTM D5185m	>20	<1		
Water		WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m		0		
Boron	ppm	ASTM D5185m	400	125		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	2		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m	12	<1		
Calcium	ppm	ASTM D5185m	150	23		
Phosphorus	ppm	ASTM D5185m	1650	587		
Zinc	ppm	ASTM D5185m	125	7		
C. If	ppm	ASTM D5185m	22500	19193		
Sulfur Visc @ 40°C	cSt	ASTM D445	109	317		

Contact/Location: KYLE RATLIFFE - VOLVO8882

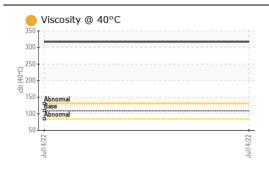

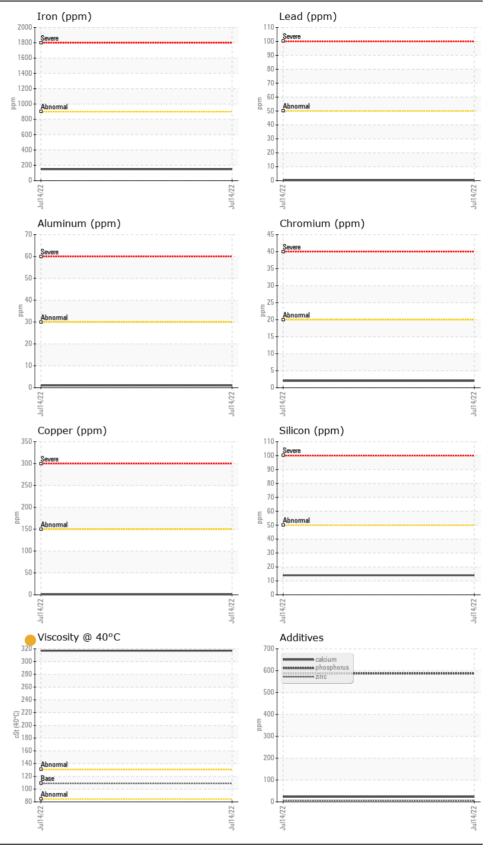

MCCLUNG-LOGAN EQUIPMENT CO - RICHMOND Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 回貨 Sample No. Received 1345 MOUNTAIN ROAD : VCP340129 : 19 Jul 2022 Lab Number : 05595022 Tested GLEN ALLEN, VA : 20 Jul 2022 Diagnosed Unique Number : 10059502 : 20 Jul 2022 - Jonathan Hester US 23060 Test Package : MOB 1 Contact: KYLE RATLIFFE Certificate L2367 KRATLIFFE@MCCLUNG-LOGAN.COM To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (804)266-1611

Contact/Location: KYLE RATLIFFE - VOLVO8882