WEAR
CONTAMINATION
FLUID CONDITION


ABNORMAL NORMAL NORMAL

Machine Id

LINKBELT RTC-8050I M8050 (S/N J6JA-7132)

Swing Drive

RECOMMENDATION No corrective action is recommended at this time. Resample at the next service interval to monitor.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		DC0026478		
	Sample Date		Client Info		30 Jan 2023		
	Machine Age	hrs	Client Info		863		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
/FAD							
WEAR	Iron	ppm	ASTM D5185m		<u>476</u>		
Gear wear is indicated. All other component wear rates are normal.	Chromium	ppm	ASTM D5185m		1		
	Nickel	ppm	ASTM D5185m	>10	3		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		0		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		2		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>50	7		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		2		
	Water	1-1-		>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUD CONDITION							
LUID CONDITION	Sodium	ppm	ASTM D5185m		<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		4		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		24		
	Phosphorus	ppm	ASTM D5185m		750		
	Zinc	ppm	ASTM D5185m		48		
	Sulfur	ppm	ASTM D5185m		18172		

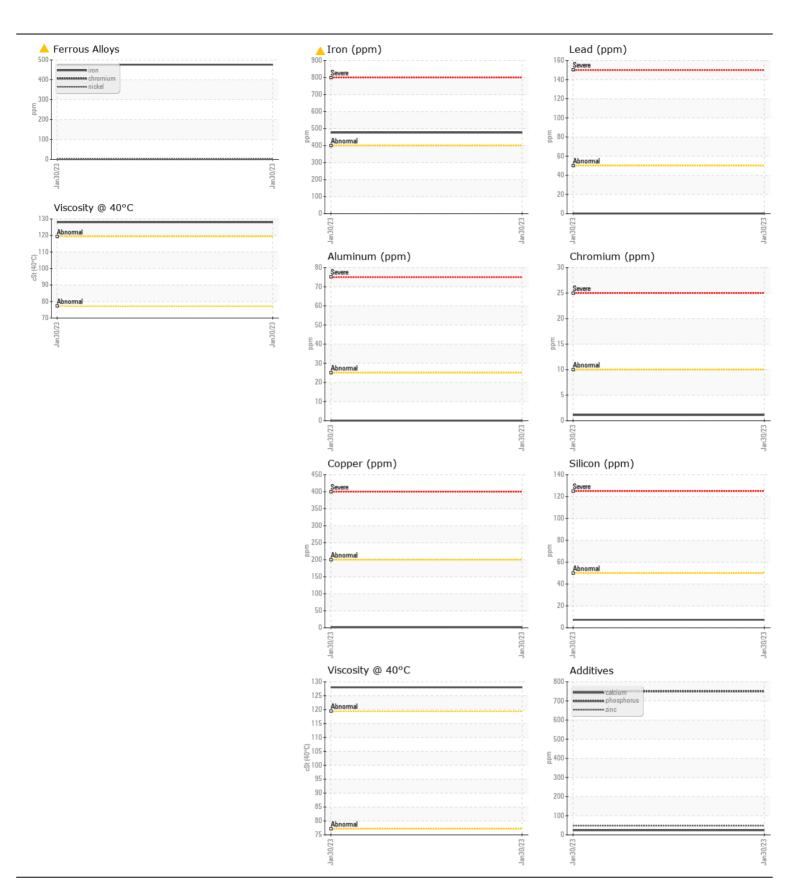



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: DC0026478 : 05771429 : 10346046 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 17 Feb 2023 Diagnosed : 20 Feb 2023 Diagnostician

: Don Baldridge

CRANEWORKS INC - SPECIAL PROJECTS 11089 LEADBETTER ROAD ASHLAND, VA

US 23005 Contact: JOSH DIXON

jdixon@vacraneworks.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: