

## JOHN DEERE 410L 402732

## Component Transmission (Manual)

## JOHN DEERE HY-GARD HYD/TRANS (--- GAL)

JOHN DEERE HT-GARD HTD/ IRANS ( G/	4L)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		MT0005883		
	Sample Date		Client Info		16 Feb 2023		
	Machine Age	hrs	Client Info		1065		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184	>95	24		
	Iron	ppm	ASTM D5185m		52		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	20	0		
	Silver	ppm	ASTM D5185m	>7	0		
	Aluminum	ppm	ASTM D5185m		11		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m	>225	13		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>125	7		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	6		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		7		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m	6	18		
	Barium	ppm	ASTM D5185m	0	0		
	Molybdenum	ppm	ASTM D5185m	0	<1		
	Manganese	ppm	ASTM D5185m		4		
	Magnesium	ppm	ASTM D5185m		82		
	Calcium	ppm	ASTM D5185m		3445		
	Phosphorus	ppm	ASTM D5185m		1006		
	Zinc	ppm	ASTM D5185m	1640	1241		
	Sulfur	ppm	ASTM D5185m		3361		


Visc @ 40°C


cSt


Contact/Location: DUSTIN DAILEY - MURCAM

49.2

ASTM D445 57.0

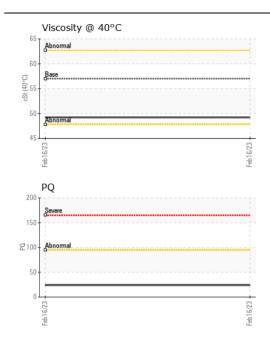

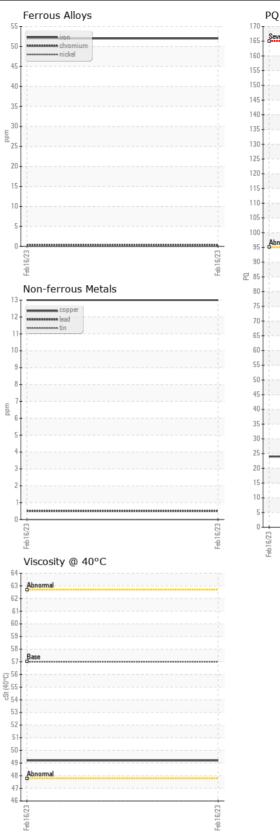

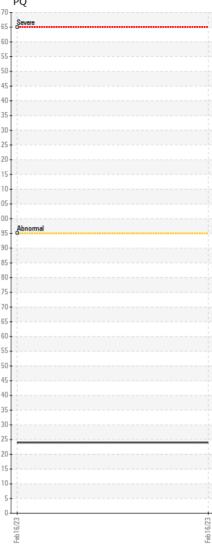

**MURPHY TRACTOR - CAMBRIDGE** Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Recieved : 21 Feb 2023 60611 HULSE DRIVE : MT0005883 Lab Number : 22 Feb 2023 CAMBRIDGE, OH : 05773050 Diagnosed Unique Number : 10347667 Diagnostician : Don Baldridge US 43725 Test Package : CONST (Additional Tests: PQ) Contact: DUSTIN DAILEY Certificate L2367 DDAILEY@MURPHYTRACTOR.COM To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: F: (740)439-2325 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: DUSTIN DAILEY - MURCAM

Page 2 of 2