WEAR CONTAMINATION FLUID CONDITION **ABNORMAL NORMAL NORMAL**

Ascendum Machinery VOLVO A40G ED-03 (S/N 352321)

Brake Cooling System VOLVO WB 102 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The fluid change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.	Sample Number		Client Info		ASC0005413		
	Sample Date		Client Info		04 Oct 2023		
	Machine Age	hrs	Client Info		3999		
	Oil Age	hrs	Client Info		3999		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>50	32		
The copper level is abnormal. All other component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m	>10	6		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	3		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>200	△ 305		
	Tin	ppm	ASTM D5185m	>20	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	26		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		11		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		126		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		12		
	Calcium	ppm	ASTM D5185m		3311		
	Phosphorus	ppm	ASTM D5185m		1278		
	Zinc	ppm	ASTM D5185m		1460		

3908

39.9


ASTM D5185m

ASTM D445 55

ppm

Sulfur

Visc @ 40°C

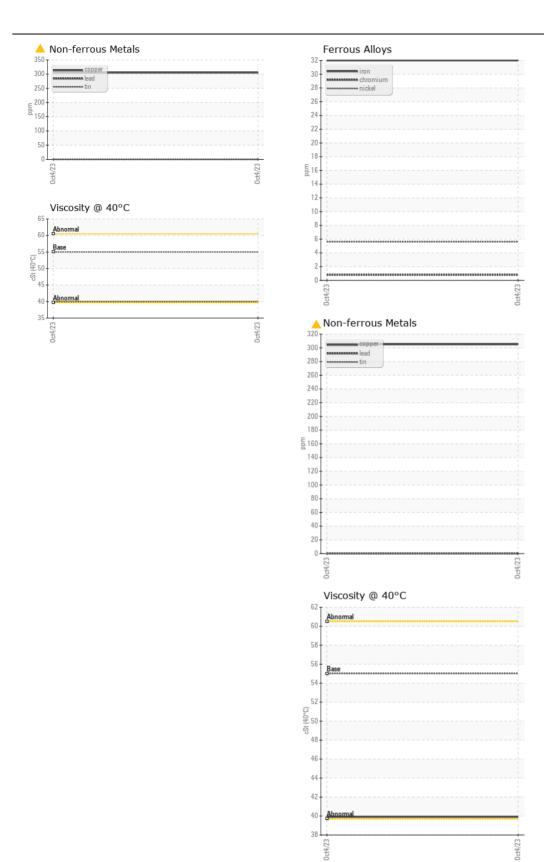





Laboratory Sample No.

Lab Number : 05971846 Unique Number: 10683796 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : ASC0005413

Received **Tested** Diagnosed

: 06 Oct 2023 : 09 Oct 2023

: 10 Oct 2023 - Don Baldridge

CAROLINA EXCAVATING 1036 BRANCHVIEW DR, SUITE 106 CONCORD, NC

US 28025 Contact: KEVIN LADGERWOOD

kevin@carlinaexcavation.com

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)