



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
JLG 600S PL9294
 Component
Diesel Engine
 Fluid
{not provided} (--- QTS)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		HPL0003799	---	---
Sample Date		Client Info		05 Jan 2024	---	---
Machine Age	hrs	Client Info		251	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	12	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>4	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	4	---	---
Lead	ppm	ASTM D5185m	>40	0	---	---
Copper	ppm	ASTM D5185m	>330	9	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	17	---	---
Potassium	ppm	ASTM D5185m	>20	2	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.1	---	---
Nitration	Abs/cm	*ASTM D7624	>20	10.9	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.8	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		4	---	---
Boron	ppm	ASTM D5185m		53	---	---
Barium	ppm	ASTM D5185m		10	---	---
Molybdenum	ppm	ASTM D5185m		103	---	---
Manganese	ppm	ASTM D5185m		2	---	---
Magnesium	ppm	ASTM D5185m		725	---	---
Calcium	ppm	ASTM D5185m		1373	---	---
Phosphorus	ppm	ASTM D5185m		764	---	---
Zinc	ppm	ASTM D5185m		884	---	---
Sulfur	ppm	ASTM D5185m		3318	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	22.8	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		9.86	---	---
Visc @ 100°C	cSt	ASTM D445		13.5	---	---

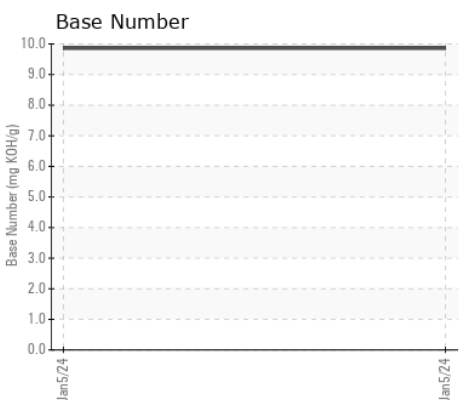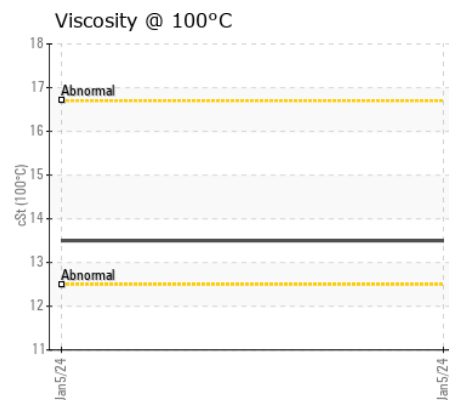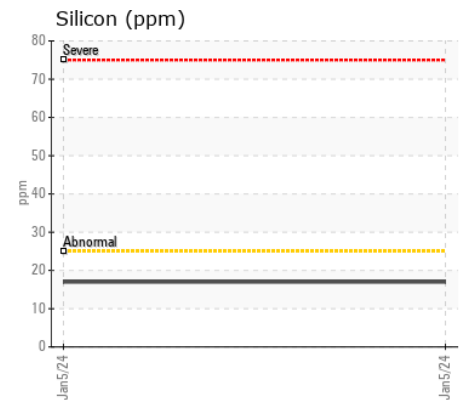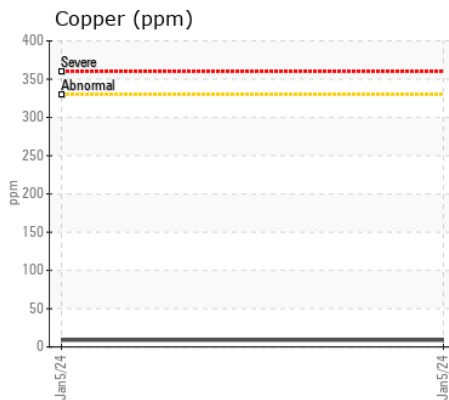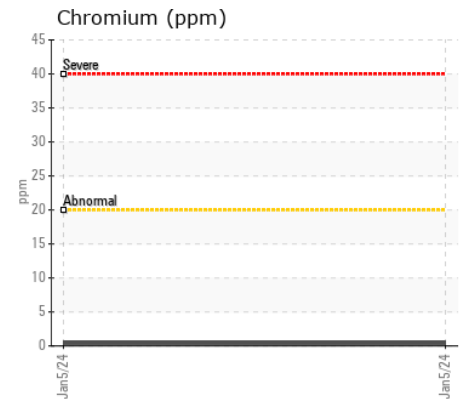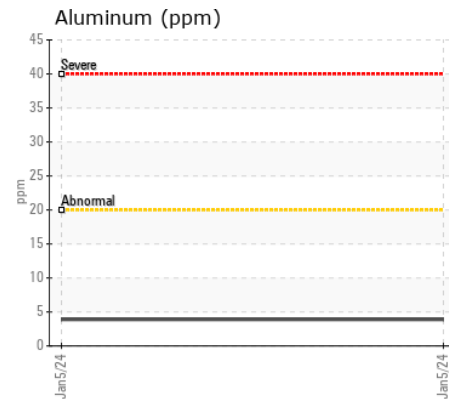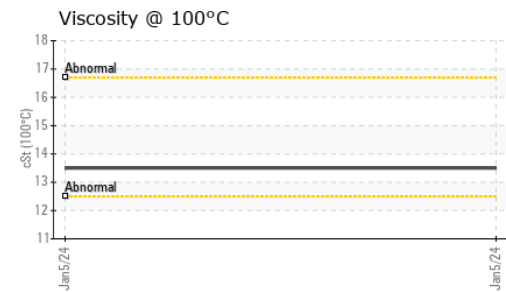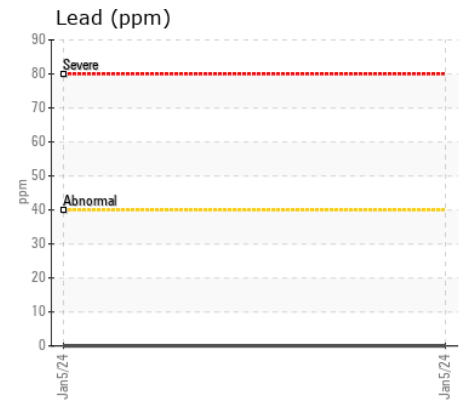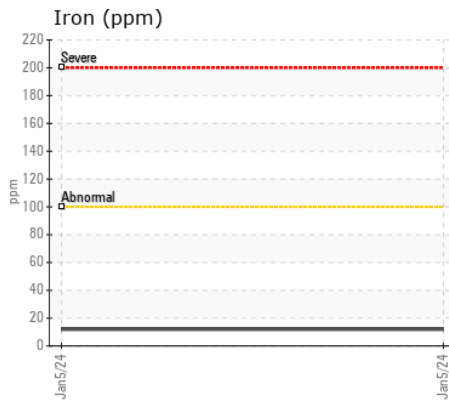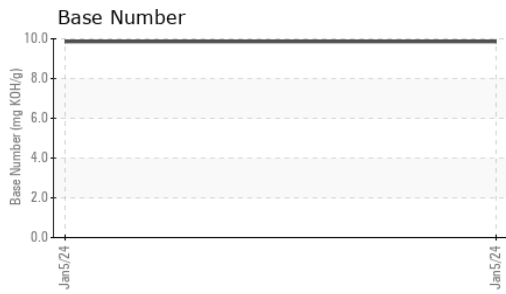

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : HPL0003799 **Received** : 08 Jan 2024
Lab Number : 06054140 **Diagnosed** : 09 Jan 2024
Unique Number : 10820089 **Diagnostician** : Wes Davis
Test Package : MOB 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

STEVENS ON CRANE
 410 STEVENSON DR
 BOLINGBROOK, IL
 US 60440

Contact: DAVE KOEHNE
 davidk@stevensoncrane.com

T: (630)972-9199

F: