
WEAR CONTAMINATION FLUID CONDITION **ABNORMAL NORMAL NORMAL**

JOHN DEERE 7760 1N07760XKC0040517

Component Rear Differential

GEAR OIL SAE 90W140 (GAL)							
RECOMMENDATION No corrective action is recommended at this time. Resample at the next service interval to monitor.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		JR0201946		
	Sample Date		Client Info		08 Jan 2024		
	Machine Age	hrs	Client Info		3091		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				ABNORMAL		
WEAR	PQ		ASTM D8184		209		
The lead level is abnormal. All other component wear rates are normal.	Iron	ppm	ASTM D5185m	>500	311		
	Chromium	ppm	ASTM D5185m	>10	4		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	<1		
	Lead	ppm	ASTM D5185m	>25	^ 26		
	Copper	ppm	ASTM D5185m	>100	34		
	Tin	ppm	ASTM D5185m	>10	3		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>75	10		
	Potassium	ppm	ASTM D5185m		6		
	Water	1-1-	WC Method	>.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		5		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	400	160		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		6		
	Manganese	ppm	ASTM D5185m		7		
	Magnesium	ppm	ASTM D5185m	12	5		
	Calcium	ppm	ASTM D5185m		23		
	Phosphorus	ppm	ASTM D5185m		950		
	Zinc	ppm	ASTM D5185m		11		
	Sulfur	ppm	ASTM D5185m		26877		
	Visc @ 40°C	cSt	ASTM D445		309		
Report Id: IAMWAK [WI ISCAR] 06055568 (Generated: 01/10/2024 21:50:47) Rev: 1	<u> </u>				t/Location: F		100000



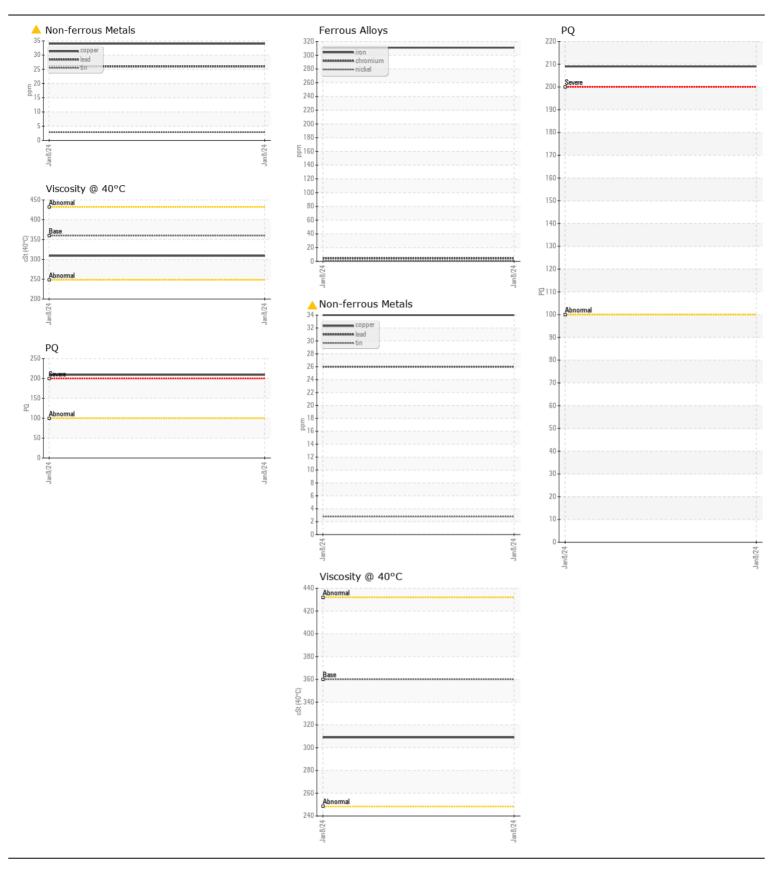

Certificate L2367

Laboratory Sample No. Lab Number

Unique Number

: JR0201946 : 06055568 : 10821517

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved

Diagnosed Diagnostician : Sean Felton Test Package : CONST (Additional Tests: PQ)

: 09 Jan 2024 : 10 Jan 2024

WAKEFIELD, VA US 23888 Contact: BILL ACKER backer@jamesriverequipment.com

10489 GENERAL MAHONE HWY

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Contact/Location: BILL ACKER - JAMWAK

JRE - WAKEFIELD

T: (757)899-3232

F: (757)899-6464